


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Finley Public School (3945)
Region : Riverina
State Electorate : Murray
Local Government Area : Berrigan

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Feb - 2017

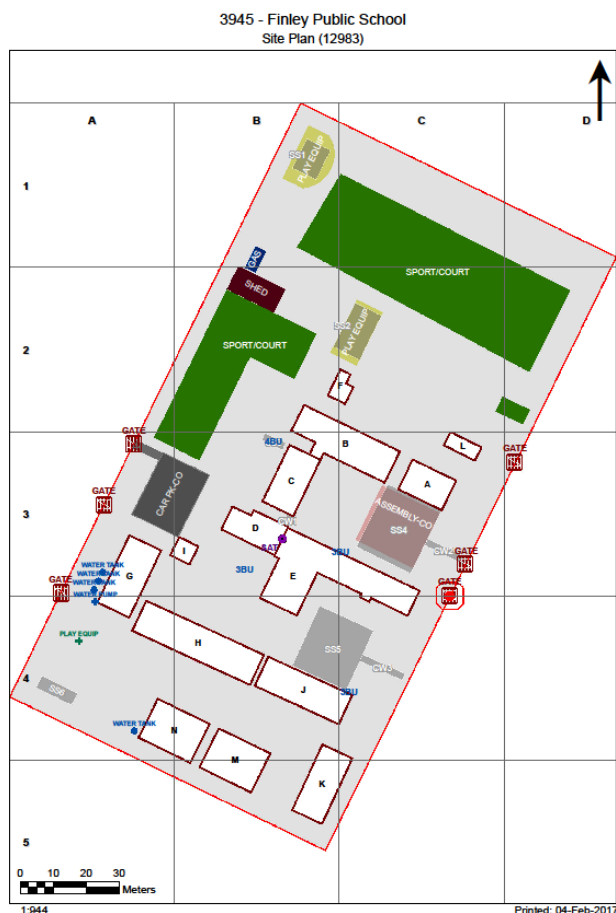

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00A - General Learning - 1966 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00A - R0001 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	45m2	All surfaces, Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	3m2	East facing, Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	45m2	All surfaces, Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	10m2	South facing, East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00A/R0003/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00B - General Learning - 1966 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Ceiling void - gable	Non Accessible Area - Area inaccessible - Access to ceiling cavity blocked by cupboard					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible - Access blocked by roof tiles & fence posts					
Window in-fill panel	No Asbestos Found					
Gable Verge Lining	No Asbestos Found					

Interior**B00B - R0001 - Home Base**

No Asbestos

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00B - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0003/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00B - R0004 - Plant

No Asbestos

B00B - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0003/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00B - R0008 - General Storeroom

No Asbestos

B00B - R0009 - Staff Room Annexe

No Asbestos

B00B - R0010 - Home Base

No Asbestos

B00B - R0011 - Access Shower/Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning - 1942 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Fibre Cement Casting (Monocrete) 3945/B00C/Eaves Linings/S17	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)					
Gable verge lining	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Not able to be sampled due to height					
Window in-fill panel	No Asbestos Found					

Interior**B00C - R0001 - Movement**

No Asbestos

B00C - R0002 - Home Base

No Asbestos

B00C - R0003 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3945/B00C/R0004/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00C - R0004 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3945/B00C/R0004/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Personal Effects Storage

No Asbestos

B00C - R0007 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3945/B00C/R0007/Ceiling Structures/Linings/S18					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3945/B00C/R0007/Ceiling Structures/Linings/S18					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00D - Pupil Facilities - 1942 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00D/Underfloor Voids/S16					Chrysotile (white asbestos)

Interior**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot be sampled due to proximity of student and staff to location of material and weather					

B00D - R0002 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles					
	3945/B00D/R0008/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00D - R0003 - Canteen Office/Store

No Asbestos

B00D - R0004 - Other-Vacant

No Asbestos

B00D - R0005 - Sports Store

Ceiling Structures/Linings No Asbestos Found

B00D - R0006 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3945/B00D/R0008/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00D - R0007 - Cleaning Supplies

Ceiling Structures/Linings No Asbestos Found

B00D - R0008 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles					
	3945/B00D/R0008/Floor Coverings Res/Textile/S8					No Asbestos Detected

Incinerator No Asbestos Found

B00D - R0009 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3945/B00D/R0008/Floor Coverings Res/Textile/S8					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00E - Administration/Library - 1966 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00E/Eaves Linings/S15					Chrysotile (white asbestos)
Gable Verge Lining	No Asbestos Found					

Interior**B00E - R0001 - Interview**

No Asbestos

B00E - R0002 - Principal

No Asbestos

B00E - R0003 - General Storeroom

No Asbestos

B00E - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0005 - Sick Bay - Shower/Toilet

Wall Linings Internal	Flat AC Sheeting					
	3945/B00E/R0012/Ceiling Structures/Linings/S14					No Asbestos Detected

B00E - R0006 - Sick Bay

No Asbestos

B00E - R0007 - Security Store

No Asbestos

B00E - R0008 - Deputy Principal

No Asbestos

B00E - R0009 - Movement

No Asbestos

B00E - R0011 - Reading Area

No Asbestos

B00E - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	3945/B00E/R0012/Ceiling Structures/Linings/S14					No Asbestos Detected

B00E - R0013 - General Storeroom

No Asbestos

B00E - R0014 - Special Programs Room

No Asbestos

B00E - R0015 - Communications Room

No Asbestos

B00E - R0016 - Library Office/Workroom

No Asbestos

B00E - R0017 - Disabled Toilet

Wall Linings Internal	Flat AC Sheeting					
	3945/B00E/R0012/Ceiling Structures/Linings/S14					No Asbestos Detected

B00E - R0018 - Cleaning Distributed Store

No Asbestos

B00E - R0019 - Duplicating Workroom

No Asbestos

B00E - R0020 - Clerical Office

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00E - R0021 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00E/Eaves Linings/S15				Chrysotile (white asbestos)	
B00E - R0022 - Staff Room						
No Asbestos						
B00E - R0023 - Staff Kitchen						
No Asbestos						
B00E - R0024 - Distribution Board				Note: No inspection of live electrical installation.		
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00F - Storage - 1989 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids -
Packing to Floor Joists

No Asbestos Found

Ceiling Voids

No Asbestos Found

Interior**B00F - R0001 - Sports Store**

Wall Linings Internal Flat AC Sheeting 16m2 All surfaces Minimal Damage (2) Low (1) Low Priority (2-3)

3945/B00F/R0003/Wall Linings Internal/S11

Chrysotile (white asbestos)

Ceiling Structures/Linings Flat AC Sheeting 10m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

3945/B00F/R0003/Wall Linings Internal/S11

Chrysotile (white asbestos)

B00F - R0002 - Garden Store

No Asbestos

B00F - R0003 - Garden Store

Wall Linings Internal Flat AC Sheeting 6m2 North facing Some Damage /
Unsealed (3) Low (1) Low Priority (2-3)

3945/B00F/R0003/Wall Linings Internal/S11

Chrysotile (white asbestos)

B00F - R0004 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00G - General Learning - 1989 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00G/Eaves Linings/S19					Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Not able to be sampled due to height					
Ceiling Voids	No Asbestos Found					
Window in-fill panel	No Asbestos Found					

Interior**B00G - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	43m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0002/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00G - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	120m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00G/R0002/Ceiling Structures/Linings/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0003/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00G - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00B/R0003/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	120m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00G/R0002/Ceiling Structures/Linings/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0004 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot be sampled due to proximity of student and staff to location of material and weather					

B00G - R0005 - Home Base

No Asbestos

B00G - R0006 - Withdrawal Space - 1hb

Electrical Backing Board No Asbestos Found

B00G - R0007 - Toilets - Boys/Girls

No Asbestos

B00G - R0008 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00G/R0008/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00G - R0009 - Staff Room Annexe

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00H - General Learning - 1966 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible - Access point blocked by mulch and garden. Cannot open door					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible - Acces door blocked by mulch and garden bed					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Access hatch damaged - unable to undo square holes as they are rounded off					

Interior**B00H - R0001 - Movement**

Wall Linings Internal	Flat AC Sheeting	5m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	93m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Mounting Board	Resinous Board	1Unit	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Not able to be sampled due to live					
Floor Coverings Res/Textile	Compressed AC Sheet 3945/B00H/R0001/Floor Coverings Res/Textile/S6 No Asbestos Detected					

B00H - R0002 - Withdrawal Space - 1hb

Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0003 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0004 - Home Base

Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00H - R0005 - Home Base						
Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00H - R0006 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00H - R0007 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00H - R0010 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00H - R0011 - No Access						
No Asbestos						
B00H - R0012 - Home Base						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00I - General Learning - 1966 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3945/B00I/Eaves Linings/S21					No Asbestos Detected

Interior**B00I - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00I/R0001/Ceiling Structures/Linings/S22					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00I - R0002 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00I/R0002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot be sampled due to proximity of student and staff to location of material and weather					

B00I - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00I/R0002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot be sampled due to proximity of student and staff to location of material and weather					

B00I - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00I/R0002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot be sampled due to proximity of student and staff to location of material and weather					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00J - General Learning - 1966 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Flat Roof No Asbestos Found

Underfloor Voids -
Packing to Floor Joists No Asbestos Found**Interior****B00J - R0001 - General Storeroom**

No Asbestos

B00J - R0002 - General Storeroom

No Asbestos

B00J - R0003 - Toilets - Boys/Girls

No Asbestos

B00J - R0004 - Home Base

No Asbestos

B00J - R0005 - Home Base

No Asbestos

B00J - R0006 - Craft Store

No Asbestos

B00J - R0007 - General Storeroom

No Asbestos

B00J - R0008 - MovementWall Linings Internal Flat AC Sheeting
3945/B00J/R0008/Wall Linings Internal/S7**No Asbestos Detected**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00K - Support Unit - 1966 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	18m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00K - R0001 - Home Base**

Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	3945/B00K/R0001/Floor Coverings Res/Textile/S13			No Asbestos Detected		
Floor Coverings Res/Textile	Compressed AC Sheet					
	3945/B00K/R0001/Floor Coverings Res/Textile/S13			No Asbestos Detected		

B00K - R0002 - Home Base - M

Wall Linings Internal	Flat AC Sheeting	40m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	39m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0003 - Practical Activities - M - 1hb

No Asbestos

B00K - R0004 - Sick Bay

No Asbestos

B00K - R0005 - General Storeroom

No Asbestos

B00K - R0006 - Toilet - M

Wall Linings Internal	Flat AC Sheeting					
	3945/B00K/R0006/Wall Linings Internal/S12			No Asbestos Detected		

B00K - R0007 - Toilet - M

Wall Linings Internal	Flat AC Sheeting					
	3945/B00K/R0006/Wall Linings Internal/S12			No Asbestos Detected		

B00K - R0008 - Laundry - P

Wall Linings Internal	Flat AC Sheeting					
	3945/B00K/R0006/Wall Linings Internal/S12			No Asbestos Detected		

B00K - R0009 - Movement

Wall Linings Internal	Flat AC Sheeting	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No			Test Result		
B00K - R0010 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00K - R0011 - Practical Activities - M - 1hb						
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3945/B00H/R0009/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00L - Building Services - 2009 - Metal Shed (Metal Shed)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior**B00L - R0001 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00M - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior**B00M - R0001 - External Movement**

No Asbestos

B00M - R0002 - Practical Activities - 1hb

No Asbestos

B00M - R0003 - Home Base Store

No Asbestos

B00M - R0004 - Home Base

No Asbestos

B00M - R0005 - Withdrawal Space - 2hb

No Asbestos

B00M - R0006 - Home Base

No Asbestos

B00M - R0007 - Home Base Store

No Asbestos

B00M - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00N - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior**B00N - R0001 - External Movement**

No Asbestos

B00N - R0002 - Practical Activities - 1hb

No Asbestos

B00N - R0003 - Home Base Store

No Asbestos

B00N - R0004 - Home Base

No Asbestos

B00N - R0005 - Withdrawal Space - 2hb

No Asbestos

B00N - R0006 - Home Base

No Asbestos

B00N - R0007 - Home Base Store

No Asbestos

B00N - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables
There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017