

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ilford Public School (2201)


Region : Western NSW

State Electorate : Bathurst

Local Government Area : Mid-Western

Initial Survey : Noel Arnold & Associates : 20 - May - 2008

Reviewed By : Parsons Brinckerhoff : 25 - Aug - 2016

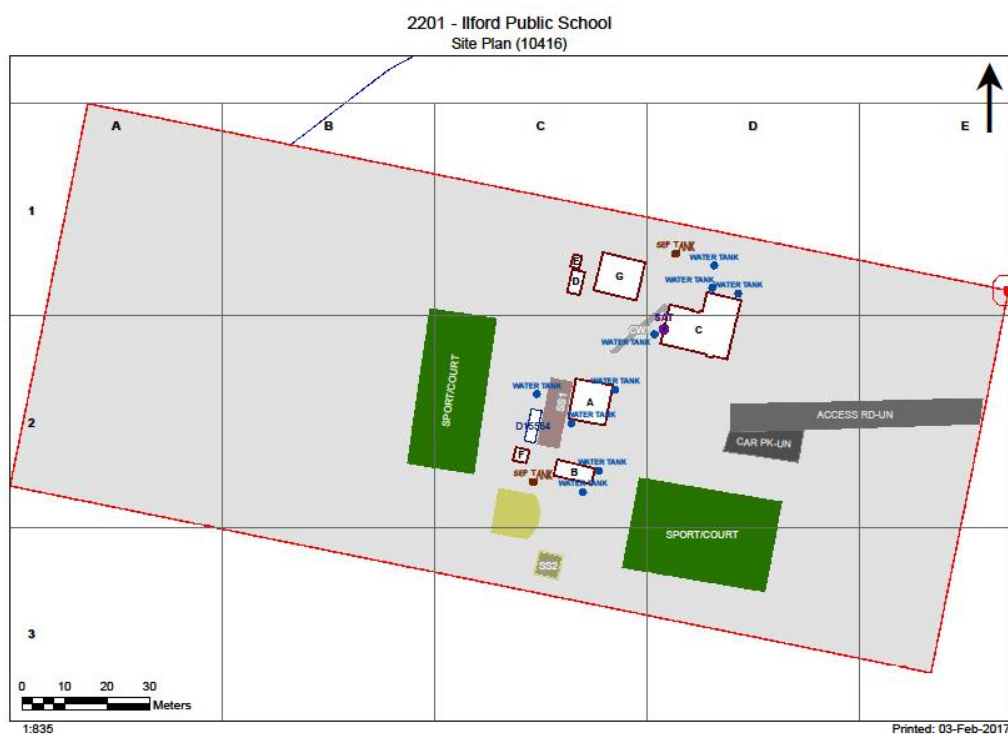

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00A - Staff Facilities/General Learning - 1920 - Timber (Timber)**Exterior**

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2201/B00A/Electrical Backing Board/S12					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00A - R0001 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting					
	2201/B00A/R0001/Ceiling Structures/Linings/S5					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	4m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2201/B00A/R0001/Wall Linings Internal/S8					Chrysotile (white asbestos)

B00A - R0003 - General Storeroom

No Asbestos

B00A - R0004 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00B - Special Purpose - 1950 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 2201/B00B/Eaves Linings/S1				No Asbestos Detected	
Wall Cladding	Flat AC Sheeting 2201/B00B/Wall Cladding/S2	30m2	West end of building	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Ceiling Void	No Asbestos Found				Chrysotile (white asbestos)	
Underfloor Void	No Asbestos Found					

Interior**B00B - R0001 - Craft Store**

Wall Linings Internal	Flat AC Sheeting 2201/B00B/R0001/Wall Linings Internal/S9				No Asbestos Detected	
-----------------------	--	--	--	--	-----------------------------	--

B00B - R0002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration - 1878 - Sandstone (Sandstone)**Exterior**

Wall Cladding	Flat AC Sheeting 2201/B00C/Wall Cladding/S3	No Asbestos Detected				
Electrical Backing Board	Resinous Board 2201/B00C/Electrical Backing Board/S13	No Asbestos Detected				
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00C - R0001 - Other-Before School Care**

No Asbestos

B00C - R0002 - Staff Shower/Change

Wall Linings Internal	Flat AC Sheeting 2201/B00C/R0002/Wall Linings Internal/S11	No Asbestos Detected				
-----------------------	---	----------------------	--	--	--	--

B00C - R0003 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	8m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2201/B00C/R0011/Wall Linings Internal/S10	Chrysotile (white asbestos)				
Ceiling Structures/Linings	Flat AC Sheeting 2201/B00C/R0011/Ceiling Structures/Linings/S6	No Asbestos Detected				

B00C - R0006 - Clerical Office/Workroom

No Asbestos

B00C - R0007 - Principal

No Asbestos

B00C - R0008 - Movement

Wall Linings Internal	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2201/B00C/R0011/Wall Linings Internal/S10	Chrysotile (white asbestos)				
Ceiling Structures/Linings	Flat AC Sheeting 2201/B00C/R0011/Ceiling Structures/Linings/S6	No Asbestos Detected				

B00C - R0009 - Canteen

No Asbestos

B00C - R0010 - Canteen Office/Store

Wall Linings Internal	Flat AC Sheeting	8m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2201/B00C/R0011/Wall Linings Internal/S10	Chrysotile (white asbestos)				
Ceiling Structures/Linings	Flat AC Sheeting 2201/B00C/R0011/Ceiling Structures/Linings/S6	No Asbestos Detected				

B00C - R0011 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	8m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2201/B00C/R0011/Wall Linings Internal/S10	Chrysotile (white asbestos)				
Ceiling Structures/Linings	Flat AC Sheeting 2201/B00C/R0011/Ceiling Structures/Linings/S6	No Asbestos Detected				

B00C - R0012 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2201/B00C/R0011/Wall Linings Internal/S10	Chrysotile (white asbestos)				
Ceiling Structures/Linings	Flat AC Sheeting 2201/B00C/R0011/Ceiling Structures/Linings/S6	No Asbestos Detected				

B00C - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2201/B00C/R0013/Ceiling Structures/Linings/S7	No Asbestos Detected				
----------------------------	---	----------------------	--	--	--	--

B00C - R0014 - Reading Area

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

No Asbestos

B00C - R0015 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00D - Other - 1999 - Timber (Timber)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00D - R0001 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00E - Other - 1990 - Metal Shed (Metal Shed)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00E - R0001 - Garden Store**

Floor area	AC Fragments/Debris	1m2	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2201/B00E/R0001/Floor area/S4					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00F - Other - 1999 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00G - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00G - R0001 - Home Base**

No Asbestos

B00G - R0002 - Home Base Store

No Asbestos

B00G - R0003 - Practical Activities

No Asbestos

B00G - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables**Demountable details as per the AMS records as of 15 Feb 2017.****OS 842 - D15564 - Country Toilet - Relta - Boys/Girls : Placement Date - 30/06/1995****Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

Interior**R1 - Toilets-Girls**

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2

R3 - Toilets-Boys

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R4 - Staff Toilet

Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2
---------	---------------	------------------	------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2201_ASB_221112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017