Asbestos Register

(Hazardous Materials and Risk Assessment)

School :	**Tullamore Central School (3270)**
Region :	**Western NSW**
State Electorate :	**Orange**
Local Government Area :	**Parkes**

Initial Survey :	**Noel Arnold & Associates : 29 - Mar - 2008**
Reviewed By :	**Parsons Brinckerhoff : 25 - Aug - 2016**

3270 - Tullamore Central School
Site Plan (All Sites)

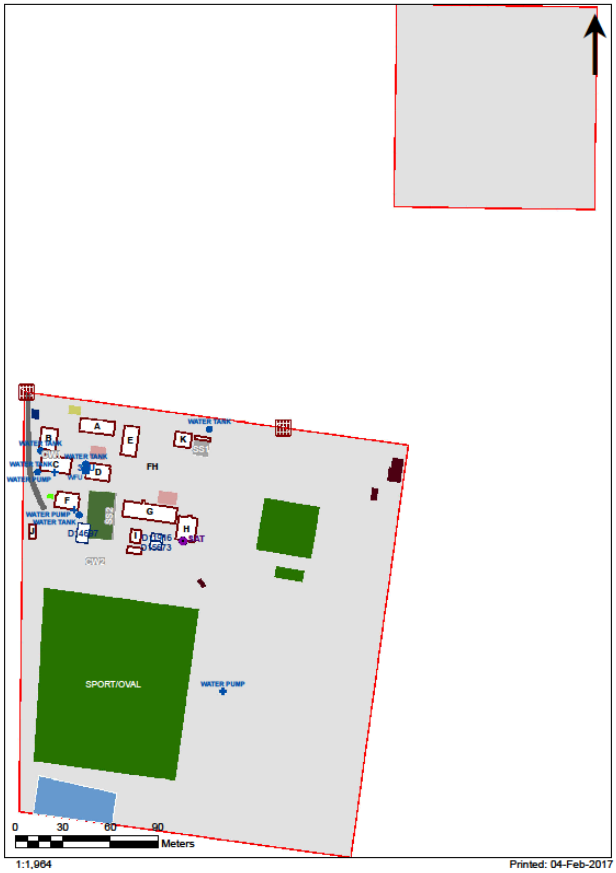

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00A - Administration - 1963 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Clerical Office

No Asbestos

B00A - R0003 - Interview

No Asbestos

B00A - R0004 - Principal

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**
B00B - General Learning - 1940 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	25m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/Eaves Linings/S5					**Chrysotile (white asbestos)**
In-fill-panel	Compressed AC Sheet	12m2	East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/Infill panel/S19					**Chrysotile (white asbestos)**
Ceiling Void	No Asbestos Found					
Infill panel	Compressed AC Sheet	12m2	East & West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/Infill panel/S19					**Chrysotile (white asbestos)**
Infill panels	Putty					
	3270/B00B/Infill panels/S20					**No Asbestos Detected**
Interior						
B00B - R0001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0008/Ceiling Structures/Linings/S13					**Chrysotile (white asbestos) , Amosite (brown asbestos)**
B00B - R0002 - Home Base						
No Asbestos						
B00B - R0003 - Toilets - Boys/Girls						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0005/Floor Coverings Res/Textile/S1					**Chrysotile (white asbestos)**
B00B - R0004 - Home Base Store						
No Asbestos						
B00B - R0005 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0005/Floor Coverings Res/Textile/S1					**Chrysotile (white asbestos)**
B00B - R0006 - Distribution Board						Note: No inspection of live electrical installation.
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0006/Ceiling Structures/Linings/S12					**Chrysotile (white asbestos)**
Electrical Backing Board	Resinous Board	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0006/Electrical Backing Board/S21					**Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00C - Pupil Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/Eaves Linings/S5				**Chrysotile (white asbestos)**	
In-fill-panel	Compressed AC Sheet	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0011/Infill panels/S18				**Chrysotile (white asbestos)**	
Ceiling Void	No Asbestos Found					

Interior

B00C - R0003 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R0004/Partition Walls (Cubicles)/S2				**Chrysotile (white asbestos)**	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0008/Ceiling Structures/Linings/S13				**Chrysotile (white asbestos) , Amosite (brown asbestos)**	
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					

B00C - R0006 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R0004/Partition Walls (Cubicles)/S2				**Chrysotile (white asbestos)**	
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0008/Ceiling Structures/Linings/S13				**Chrysotile (white asbestos) , Amosite (brown asbestos)**	

B00C - R0007 - Disabled Toilet

No Asbestos

B00C - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0008/Ceiling Structures/Linings/S13				**Chrysotile (white asbestos) , Amosite (brown asbestos)**	

B00C - R0009 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R0004/Partition Walls (Cubicles)/S2				**Chrysotile (white asbestos)**	
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0008/Ceiling Structures/Linings/S13				**Chrysotile (white asbestos) , Amosite (brown asbestos)**	

B00C - R0010 - Art Learning Space

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0008/Ceiling Structures/Linings/S13				**Chrysotile (white asbestos) , Amosite (brown asbestos)**	

B00C - R0011 - External Movement

Infill panels	Flat AC Sheeting	1m2	South, Upper level	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0011/Infill panels/S18				**Chrysotile (white asbestos)**	
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00C/R0008/Ceiling Structures/Linings/S13				**Chrysotile (white asbestos) , Amosite (brown asbestos)**	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00D - General Learning - 1940 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00D/Eaves Linings/S6					**Chrysotile (white asbestos) , Amosite (brown asbestos)**
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00D - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00D/R0001/Ceiling Structures/Linings/S14					**Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)**

B00D - R0002 - General Learning Space

No Asbestos

B00D - R0003 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00E - General Learning - 1925 - Timber (Timber)

Exterior

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3270/B00E/Underfloor Voids/S10					**Chrysotile (white asbestos) , Amosite (brown asbestos)**
Ceiling Void	No Asbestos Found					
Underfloor Void	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	3270/B00E/Underfloor Void/S11					**Chrysotile (white asbestos) , Amosite (brown asbestos)**

Interior

B00E - R0001 - General Storeroom

No Asbestos

B00E - R0002 - Staff Room Annexe

No Asbestos

B00E - R0003 - Home Base

No Asbestos

B00E - R0004 - General Learning Space

No Asbestos

B00E - R0005 - Craft Store

No Asbestos

B00E - R0006 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00F - Staff Facilities - 1963 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00F/Eaves Linings/S7					**Chrysotile (white asbestos) , Amosite (brown asbestos)**
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00F - R0001 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00F/R0005/Ceiling Structures/Linings/S15					**Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00F - R0002 - Staff Room Annexe

No Asbestos

B00F - R0003 - Staff Room

No Asbestos

B00F - R0004 - Staff Room Annexe

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00F/R0005/Ceiling Structures/Linings/S15					**Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00F - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00F/R0005/Ceiling Structures/Linings/S15					**Chrysotile (white asbestos) , Amosite (brown asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00G - General Learning/Pupil Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/Eaves Linings/S8					**Chrysotile (white asbestos) , Amosite (brown asbestos)**
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00G - R0001 - Main Switch Board

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R0001/Electrical Backing Board/S22					**Chrysotile (white asbestos)**

B00G - R0003 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R0004/Partition Walls (Cubicles)/S2					**Chrysotile (white asbestos)**

B00G - R0004 - Staff Toilet

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R0004/Partition Walls (Cubicles)/S2					**Chrysotile (white asbestos)**

B00G - R0006 - Sports Store

No Asbestos

B00G - R0007 - Cleaning Distributed Store

No Asbestos

B00G - R0008 - Movement

No Asbestos

B00G - R0009 - Movement

No Asbestos

B00G - R0010 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R0004/Partition Walls (Cubicles)/S2					**Chrysotile (white asbestos)**

B00G - R0011 - Toilets - Girls

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R0004/Partition Walls (Cubicles)/S2					**Chrysotile (white asbestos)**

B00G - R0012 - Movement

No Asbestos

B00G - R0013 - Cleaning Distributed Store

No Asbestos

B00G - R1001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R1001/Ceiling Structures/Linings/S17					**Chrysotile (white asbestos)**

B00G - R1002 - Music Learning Space

No Asbestos

B00G - R1003 - Music Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**
B00G - R1004 - Computer Store						
No Asbestos						
B00G - R1005 - Staff Room Annexe						
No Asbestos						
B00G - R1006 - General Storeroom						
No Asbestos						
B00G - R1007 - Distribution Board						Note: No inspection of live electrical installation.
Electrical Backing Board	Resinous Board	1m2	South	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	3270/B00G/R0001/Electrical Backing Board/S22					**Chrysotile (white asbestos)**
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R1007/Wall Linings Internal/S4					**Chrysotile (white asbestos) , Amosite (brown asbestos)**
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0005/Floor Coverings Res/Textile/S1					**Chrysotile (white asbestos)**
B00G - R1008 - Craft Store						
No Asbestos						
B00G - R1009 - Staff Room Annexe						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0005/Floor Coverings Res/Textile/S1					**Chrysotile (white asbestos)**
B00G - R1010 - General Learning Space						
Floor Coverings Res/Textile	Vinyl Tiles	94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0005/Floor Coverings Res/Textile/S1					**Chrysotile (white asbestos)**
B00G - R1011 - Darkroom Space						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0005/Floor Coverings Res/Textile/S1					**Chrysotile (white asbestos)**
B00G - R1012 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R1012/Ceiling Structures/Linings/S16					**Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)**
B00G - R1013 - Preparation						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00B/R0005/Floor Coverings Res/Textile/S1					**Chrysotile (white asbestos)**
Fume Cupboard	Compressed AC Sheet	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00G/R1013/Fume Cupboard/S3					**Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00H - Library - 1970 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
underfloor Void	No Asbestos Found

Interior

B00H - R0001 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found

B00H - R0002 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found

B00H - R0003 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found

B00H - R0004 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found

B00H - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00I - General Learning - 1923 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3270/B00I/Eaves Linings/S9					**Chrysotile (white asbestos)**
Ceiling Void	Non Accessible Area - No manhole in Building					
Underfloor Void	No Asbestos Found					

Interior

B00I - R0001 - General Learning Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00J - Shed - 1970 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00J - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00K - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00K - R0001 - Reading Area

No Asbestos

B00K - R0002 - K.L.A. Store

No Asbestos

B00K - R0003 - Practical Activities

No Asbestos

B00K - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00L - Storage - 2010 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00L - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00M - Building Services - 2013 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Maintenance Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 750 - D11916 - Learning Unit - ESL : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	5.76 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2

OS 710 - D14697 - Home Science/Pantry/Laundry : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	14.4 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

R2 - Food Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	73 m2

R3 - Laundry

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

OS 750 - D15673 - Learning Unit - ESL : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	5.76 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017