Asbestos Register

(Hazardous Materials and Risk Assessment)

School :	**Vaucluse Public School (3325)**
Region :	**Sydney**
State Electorate :	**Vaucluse**
Local Government Area :	**Woollahra**

Initial Survey :	**Noel Arnold & Associates : 25 - Jan - 2008**
Reviewed By :	**Parsons Brinckerhoff : 14 - Feb - 2017**

3325 - Vaucluse Public School
Site Plan (12889)

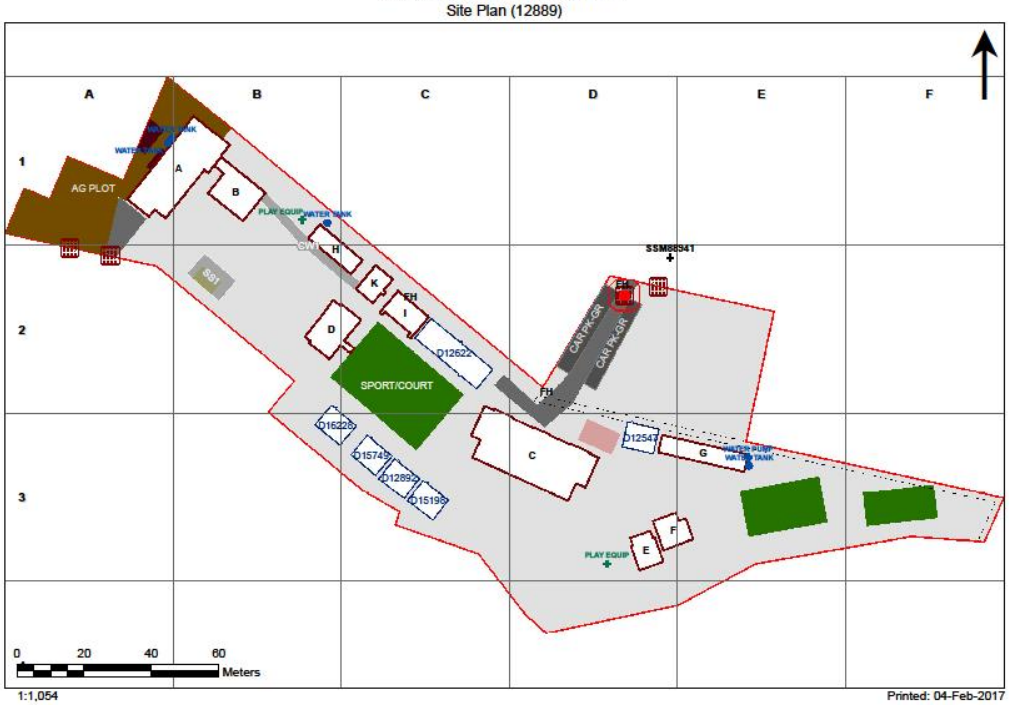

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00A - General Learning/Administration - 1966 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00A/Eaves Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable verge lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00A/Gable verge lining/S28				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Flat AC Sheeting	NA	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	3325/B00A/Ceiling Voids/S26				Chrysotile (white asbestos)	

Interior

B00A - R0001 - Home Base

No Asbestos

B00A - R0015 - Interview

No Asbestos

B00A - R0016 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00A/R0013/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0017 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00A/R0013/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0018 - Home Base

No Asbestos

B00A - R0019 - General Storeroom

No Asbestos

B00A - R0020 - Home Base Store

No Asbestos

B00A - R0021 - Practical Activities - 2hb

No Asbestos

B00A - R0022 - Home Base

No Asbestos

B00A - R0023 - Withdrawal Space - 1hb

No Asbestos

B00A - R0024 - Home Base Store

No Asbestos

B00A - R0025 - Practical Activities - 1hb

No Asbestos

B00A - R0026 - External Movement

No Asbestos

B00A - R9001 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00A/R9001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R9002 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00A - R9003 - General Assistant/Bulk Store

Non Accessible

B00A - R9005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00B - General Learning - 1966 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - No Access Due To Height Restriction					
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - No Access Due To Height Restriction					

Interior

B00B - R0001 - External Movement

No Asbestos

B00B - R0002 - Home Base

Ceiling Structures/Linings	Vermiculite	89m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	3325/B00A/R0008/Ceiling Structures/Linings/S5				**Chrysotile (white asbestos) , Amosite (brown asbestos)**	

B00B - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00B/R0003/Floor Coverings Res/Textile/S7				**Chrysotile (white asbestos)**	

B00B - R0004 - Toilets - Boys/Girls

No Asbestos

B00B - R1001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00A/R0013/Ceiling Structures/Linings/S6				**Chrysotile (white asbestos) , Amosite (brown asbestos)**	

B00B - R1002 - Home Base

No Asbestos

B00B - R1003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00B/R0003/Floor Coverings Res/Textile/S7				**Chrysotile (white asbestos)**	

B00B - R1004 - Toilets - Boys/Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00C - General Learning/Administration - 1925 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Movement

No Asbestos

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - Home Base

No Asbestos

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - Home Base

No Asbestos

B00C - R0008 - Movement

No Asbestos

B00C - R0009 - Movement

No Asbestos

B00C - R0010 - Movement

No Asbestos

B00C - R0011 - Toilets - Boys/Girls

No Asbestos

B00C - R0012 - Cleaning Distributed Store

No Asbestos

B00C - R0013 - General Storeroom

No Asbestos

B00C - R0019 - Principal

No Asbestos

B00C - R0020 - Security Store

No Asbestos

B00C - R0022 - General Assistant/Bulk Store

No Asbestos

B00C - R0023 - Stairs

No Asbestos

B00C - R0024 - Stairs

No Asbestos

B00C - R0025 - Resource/Toy Space

No Asbestos

B00C - R0026 - Staff Toilet

Non Accessible

B00C - R0027 - Staff Toilet

No Asbestos

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00C/R0027/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)

B00C - R0028 - Duplicating Workroom

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority

Sample No	Test Result

No Asbestos

B00C - R0029 - Clerical Office

No Asbestos

B00C - R0030 - Movement

No Asbestos

B00C - R0031 - Access Shower/Toilet/Change

No Asbestos

B00C - R1001 - General Storeroom

No Asbestos

B00C - R1002 - Movement

No Asbestos

B00C - R1003 - Interview

No Asbestos

B00C - R1004 - Special Programs Room

No Asbestos

B00C - R1006 - Home Base

No Asbestos

B00C - R1007 - Movement

No Asbestos

B00C - R1008 - General Storeroom

No Asbestos

B00C - R1009 - General Storeroom

No Asbestos

B00C - R1010 - Communal Space

No Asbestos

B00C - R1011 - Raised Platform

No Asbestos

B00C - R1012 - Stairs

No Asbestos

B00C - R1013 - Stairs

No Asbestos

B00C - R1014 - Home Base

Recently Modified Space Requires Inspection

B00C - R1015 - Home Base

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00D - General Learning - 1913 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	16m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00D/Eaves Linings/S29				**Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)**	
Ceiling Voids	Non Accessible Area - No Access Due To Height Restriction					

Interior

B00D - R0004 - Staff Room

No Asbestos

B00D - R0005 - Special Programs Room

No Asbestos

B00D - R0006 - External Movement

No Asbestos

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00D/R0006/Ceiling Structures/Linings/S30				**Chrysotile (white asbestos) , Crocidolite (blue asbestos)**	

B00D - R0007 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00E - General Learning - 1966 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00E/Eaves Linings/S34					**Chrysotile (white asbestos)**

Interior

B00E - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00E/R0001/Ceiling Structures/Linings/S18					**Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00E - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	3m2	South facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00E/R0002/Wall Linings Internal/S17					**Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					**Test Result**

B00F - Other-After School Care - 1966 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Craft Store

Wall Linings Internal	Flat AC Sheeting	16m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00F/R0001/Wall Linings Internal/S16					**Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00F - R0002 - Other-After School Care

Floor Coverings Res/Textile	Vinyl Tiles					
	3325/B00F/R0002/Floor Coverings Res/Textile/S14					**No Asbestos Detected**
Wall Linings Internal	Flat AC Sheeting	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00F/R0002/Wall Linings Internal/S15					**Chrysotile (white asbestos)**

B00F - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - Pupil Facilities/Building Services - 1966 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting					
	3325/B00G/Eaves Linings/S33					**No Asbestos Detected**

Interior

B00G - R0001 - Drinking Facilities

No Asbestos

B00G - R0003 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00G/R0003/Ceiling Structures/Linings/S12					**Chrysotile (white asbestos)**

B00G - R0004 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00G/R0003/Ceiling Structures/Linings/S12					**Chrysotile (white asbestos)**

B00G - R0005 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00G/R0003/Ceiling Structures/Linings/S12					**Chrysotile (white asbestos)**

B00G - R0006 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00G/R0003/Ceiling Structures/Linings/S12					**Chrysotile (white asbestos)**
Partition Walls (Cubicles)	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00G/R0009/Partition Walls (Cubicles)/S13					**Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00G - R0007 - Cleaning Distributed Store

Non Accessible

B00G - R0008 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00G/R0003/Ceiling Structures/Linings/S12					**Chrysotile (white asbestos)**

B00G - R0009 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00G/R0003/Ceiling Structures/Linings/S12					**Chrysotile (white asbestos)**
Partition Walls (Cubicles)	Flat AC Sheeting	6m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00G/R0009/Partition Walls (Cubicles)/S13					**Chrysotile (white asbestos) , Amosite (brown asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Pupil Facilities - 1966 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00H/Eaves Linings/S31					Chrysotile (white asbestos)

Interior

B00H - R0001 - Toilets - Girls

Partition Walls (Cubicles)	Flat AC Sheeting	8m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00H/R0001/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00H/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00H - R0002 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00H/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00H - R0003 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00H/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00H - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00H/R0001/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3325/B00H/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority

	Sample No	Test Result

B00I - General Learning - 1999 - Steel (Steel)

Exterior

Packing to piers	Flat AC Sheeting 3325/B00I/Packing to piers/S21	**No Asbestos Detected**
Ceiling Voids	No Asbestos Found	

Interior

B00I - R0001 - Other-Community Use

No Asbestos

B00I - R0002 - Other-Community Use

No Asbestos

B00I - R0003 - External Movement

No Asbestos

B00I - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority

	Sample No	Test Result

B00K - Pupil Facilities - 2002 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found	
Underfloor Voids	AC Fragments/Debris 3325/B00K/Underfloor Voids/S32	**No Asbestos Detected**

Interior

B00K - R0001 - Canteen

No Asbestos

B00K - R0002 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting 3325/B00K/R0002/Ceiling Structures/Linings/S22	**No Asbestos Detected**

B00K - R0003 - Canteen Covered Area

Ceiling Structures/Linings	Flat AC Sheeting 3325/B00K/R0003/Ceiling Structures/Linings/S23	**No Asbestos Detected**

B00K - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3325/B00K/R0003/Ceiling Structures/Linings/S23	**No Asbestos Detected**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority

Sample No	Test Result

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D12547 - Learning Unit - Standard With P.A.A. : Placement Date - 31/03/2016

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 535 - D12622 - Library/Group Study/Office/A V Store : Placement Date - 23/07/2012

Exterior

No Asbestos Found.

Interior

R1 - Clerical Office

No Asbestos Found.

R2 - Staff Room

No Asbestos Found.

R3 - Security Store

No Asbestos Found.

R4 - Principal

No Asbestos Found.

R5 - Staff Toilet

No Asbestos Found.

R6 - Staff Toilet

No Asbestos Found.

R7 - Reading Area

No Asbestos Found.

R8 - Entry

No Asbestos Found.

OS 602 - D12892 - Learning Unit - Standard With P.A.A. : Placement Date - 10/10/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15198 - Learning Unit - Standard With P.A.A. : Placement Date - 12/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority

Sample No	Test Result

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15749 - Learning Unit - Standard With P.A.A. : Placement Date - 11/12/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D16228 - Learning Unit - Standard With P.A.A. : Placement Date - 11/12/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority

	Sample No	Test Result

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3325_ASB_150514_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017