


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Administrative Office - Deniliquin (0211)
Region : Riverina
State Electorate : Murray
Local Government Area : Edward River

Initial Survey : Parsons Brinckerhoff : 20 - Jun - 2016
Reviewed By : Parsons Brinckerhoff : 20 - Jun - 2016

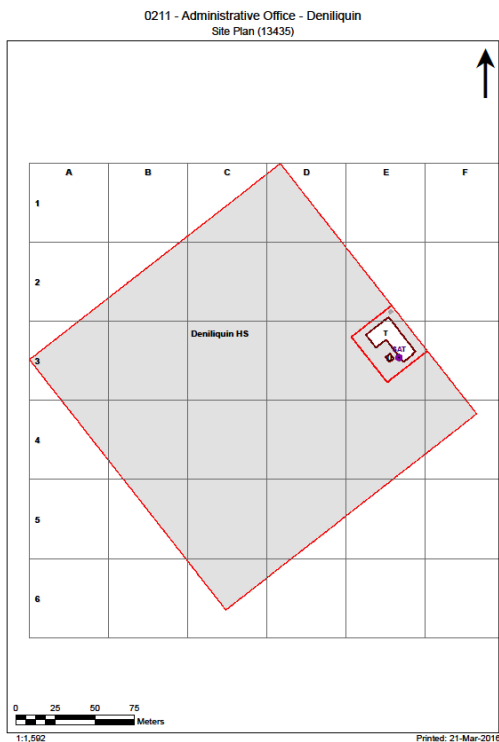

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00T - DoE Admin Office - 1971 - Timber (Timber)

Exterior

| | | | | | | |
|-----------------|------------------------------|------|--------------------|---------------------------------------|---------|---|
| Ceiling Void | No Asbestos Found | | | | | |
| Underfloor Void | AC Fragments/Debris | 1m2 | Variable positions | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) |
| | 0211/B00T/Underfloor Void/S8 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Eaves Linings | Flat AC Sheeting | 80m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 0211/B00T/Eaves Linings/S9 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

Interior

| | | | | | | |
|--|--|-----|------------|--------------------|---------|---|
| B00T - R0001 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0002 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0003 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0004 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0005 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0006 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0007 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0008 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0009 - Other - D.E.T. Admin | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | | | | | |
| | 0211/B00T/R0010/Floor Coverings Res/Textile/S7 | | | | | No Asbestos Detected |
| B00T - R0010 - Other - D.E.T. Admin | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | | | | | |
| | 0211/B00T/R0010/Floor Coverings Res/Textile/S7 | | | | | No Asbestos Detected |
| B00T - R0011 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0012 - Other - D.E.T. Admin | | | | | | |
| Wall Linings Internal | Plaster board | | | | | |
| | 0211/B00T/R0012/Wall Linings Internal/S4 | | | | | No Asbestos Detected |
| B00T - R0013 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0014 - Other - D.E.T. Admin | | | | | | |
| No Asbestos | | | | | | |
| B00T - R0015 - Other - D.E.T. Admin | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 5m2 | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 0211/B00T/R0015/Wall Linings Internal/S5 | | | | | Chrysotile (white asbestos) |
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 0211/B00T/R0018/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| B00T - R0016 - Other - D.E.T. Admin | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|----------------------|--------|--------------------|--------------------|---|--------------------|
| Sample No | | | | | Test Result | |
| Wall Linings Internal | Flat AC Sheeting | 5m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 0211/B00T/R0015/Wall Linings Internal/S5 | | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 0211/B00T/R0018/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |
| B00T - R0017 - Other - D.E.T. Admin | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 0211/B00T/R0018/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |
| B00T - R0018 - Other - D.E.T. Admin | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 29m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 0211/B00T/R0018/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |
| Electrical Backing Board | Resinous Board | | | | | |
| 0211/B00T/R0018/Electrical Backing Board/S6 | | | | | No Asbestos Detected | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00U - DoE Admin Office - 1971 - Metal Shed (Metal Shed)

Exterior

| | |
|-----------------|-------------------|
| Underfloor void | No Asbestos Found |
| Ceiling void | No Asbestos Found |

Interior

B00U - R0001 - Other - D.E.T. Admin

No Asbestos

B00U - R0002 - Workshop

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017