


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bombala Public School (1288)
Region : Illawarra and South East
State Electorate : Monaro
Local Government Area : Bombala

Initial Survey : Noel Arnold & Associates : 14 - May - 2008
Reviewed By : Greencap-NAA : 17 - Jun - 2016

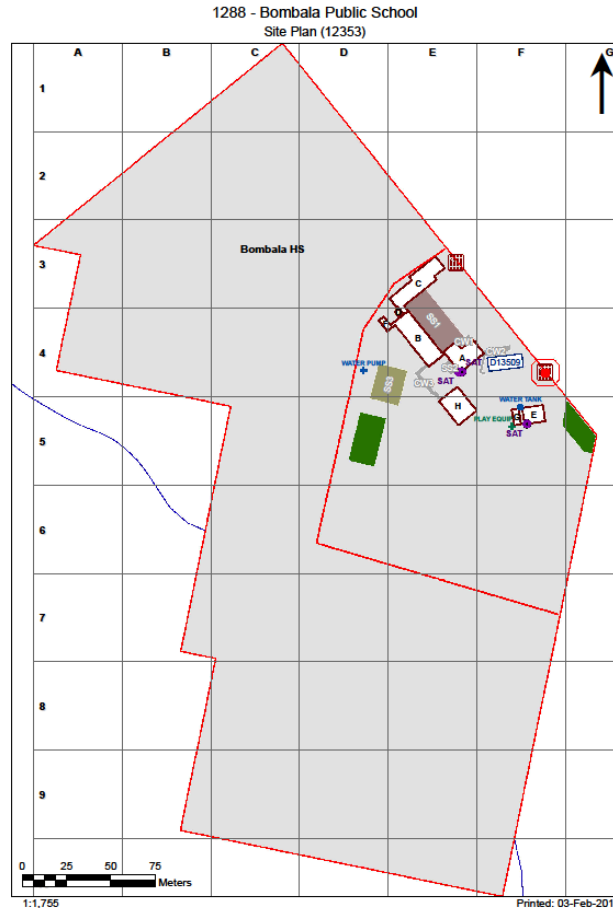

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library - 1960 - Timber (Timber)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	Rear of building and adjacent to Room 0005	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Eaves Linings/S3					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	1288/B00A/In-fill-panel/S9					
Ceiling Voids	AC Fragments/Debris	140m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1288/B00A/Ceiling Voids/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior**B00A - R0001 - Reading Area**

Ceiling Structures/Linings	Flat AC Sheeting	105.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Ceiling Voids/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	105.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/R0001/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	1288/B00A/R0001/Floor Coverings Res/Textile/S12					

B00A - R0002 - K.L.A. Store

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1288/B00A/R0002/Wall Linings Internal/S4					
Ceiling Structures/Linings	Flat AC Sheeting	4.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Ceiling Voids/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00A - R0003 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	11.87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Ceiling Voids/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00A - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Ceiling Voids/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	1288/B00A/In-fill-panel/S9					

B00A - R0005 - Library Office/Workroom

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Ceiling Voids/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00A - R0006 - External Movement

No Asbestos

B00A - R0007 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1963 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	Front and back of Building	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00B/Eaves Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior**B00B - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00B/R0001/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		

B00B - R0002 - General Storeroom

No Asbestos

B00B - R0003 - General Storeroom

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Staff Room Annexe

No Asbestos

B00B - R0006 - General Storeroom

No Asbestos

B00B - R0007 - Staff Toilet

No Asbestos

B00B - R0008 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	1288/B00B/R0008/Floor Coverings Res/Textile/S14					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	1288/B00B/R0008/Floor Coverings Res/Textile/S15					

B00B - R0009 - Home Base Store

No Asbestos

B00B - R0010 - Personal Effects Storage

No Asbestos

B00B - R0011 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	1288/B00B/R0008/Floor Coverings Res/Textile/S14					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	1288/B00B/R0008/Floor Coverings Res/Textile/S15					

B00B - R0012 - Home Base Store

No Asbestos

B00B - R0013 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	1288/B00B/R0014/Floor Coverings Res/Textile/S17					

B00B - R0014 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	1288/B00B/R0014/Floor Coverings Res/Textile/S17					

B00B - R0015 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R0017 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting		1288/B00B/R0017/Ceiling Structures/Linings/S2			No Asbestos Detected
----------------------------	------------------	--	---	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning/Pupil Facilities - 1963 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1288/B00B/Eaves Linings/S13	40m2	Front and back of Building	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Eaves Linings	Flat AC Sheeting 1288/B00B/Eaves Linings/S13	40m2	Front and back of Building	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior**B00C - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 1288/B00C/R0001/Ceiling Structures/Linings/S5	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 1288/B00C/R0001/Partition Walls (Cubicles)/S6	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 1288/B00C/R0001/Ceiling Structures/Linings/S5	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	------------	--------------------	---------	---

B00C - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 1288/B00C/R0001/Ceiling Structures/Linings/S5	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	------------	--------------------	---------	---

B00C - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 1288/B00C/R0001/Ceiling Structures/Linings/S5	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	------------	--------------------	---------	---

B00C - R0007 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1288/B00C/R0007/Floor Coverings Res/Textile/S18					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1288/B00C/R0007/Floor Coverings Res/Textile/S19					No Asbestos Detected

B00C - R0008 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles 1288/B00C/R0008/Floor Coverings Res/Textile/S8					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00C - R0009 - Movement

No Asbestos

B00C - R0010 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1288/B00C/R0007/Floor Coverings Res/Textile/S18					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1288/B00C/R0007/Floor Coverings Res/Textile/S19					No Asbestos Detected

B00C - R0011 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	1288/B00C/R0008/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00C - R0012 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
	1288/B00B/R0017/Ceiling Structures/Linings/S2					No Asbestos Detected
B00C - R0013 - Disabled Toilet						
Wall Linings Internal	Flat AC Sheeting					
	1288/B00C/R0014/Wall Linings Internal/S7					No Asbestos Detected
B00C - R0014 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00C/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00C/R0001/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					
	1288/B00C/R0014/Wall Linings Internal/S7					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Shed - 1960 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00D - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1960 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	Flat AC Sheeting					
	1288/B00E/Underfloor Voids/S22					No Asbestos Detected

Interior**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Eaves Linings/S3					Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00E/R0001/Electrical Mounting Board/S23					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00E/R0003/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1288/B00E/R0003/Floor Coverings Res/Textile/S21					No Asbestos Detected

B00E - R0002 - Interview

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00E/R0003/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1288/B00E/R0003/Floor Coverings Res/Textile/S21					No Asbestos Detected

B00E - R0003 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00E/R0003/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1288/B00E/R0003/Floor Coverings Res/Textile/S21					No Asbestos Detected

B00E - R0004 - Special Programs Store

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Eaves Linings/S3					Chrysotile (white asbestos)

B00E - R0005 - Special Programs Store

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1288/B00A/Eaves Linings/S3					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1996 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - General Assistant/Bulk Store

No Asbestos

B00F - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 2002 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - Sports Store

No Asbestos

B00G - R0002 - Sports Store

No Asbestos

B00G - R0003 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - Movement

No Asbestos

B00H - R0002 - Practical Activities - 1hb

No Asbestos

B00H - R0003 - Home Base Store

No Asbestos

B00H - R0004 - Home Base

No Asbestos

B00H - R0005 - Withdrawal Space - 2hb

No Asbestos

B00H - R0006 - Home Base

No Asbestos

B00H - R0007 - Home Base Store

No Asbestos

B00H - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 502 - D13509 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2

R10 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
---------	---------------	------------------	--	--	--	-------

R2 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
---------	---------------	------------------	--	--	--	------

R3 - Duplicating Wookroom

Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
---------	---------------	------------------	--	--	--	-------

R4 - Clinic-Waiting

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R5 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
---------	---------------	------------------	--	--	--	-------

R6 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R8 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R9 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017