


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bowraville Central School (1336)
Region : North Coast
State Electorate : Oxley
Local Government Area : Nambucca

Initial Survey : Noel Arnold & Associates : 14 - Jan - 2010
Reviewed By : Parsons Brinckerhoff : 08 - Oct - 2015

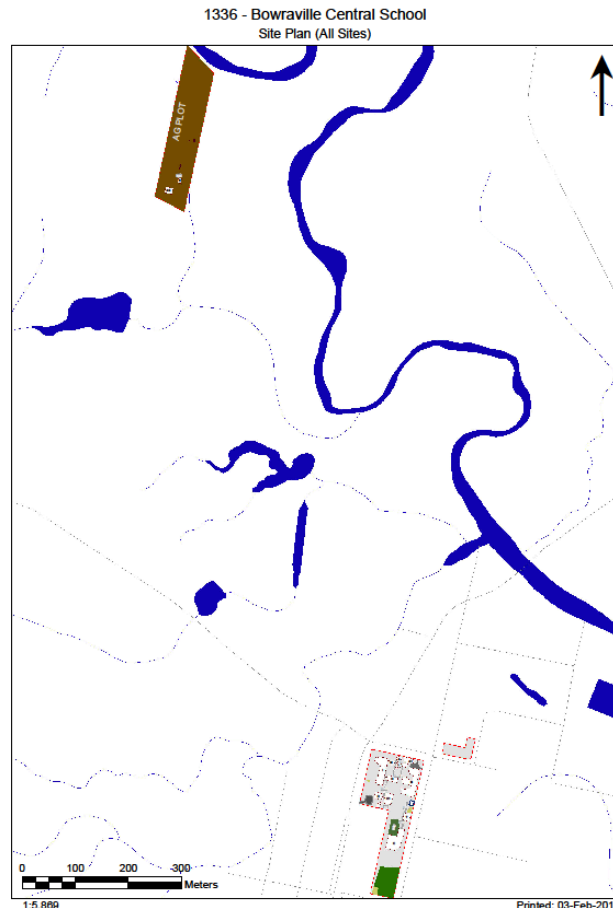

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	15m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1336/B00A/Eaves Linings/S13					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0003 - Home Base

No Asbestos

B00A - R0004 - Practical Activities - 1hb

No Asbestos

B00A - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1966 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1336/B00B/Eaves Linings/S14					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	1336/B00B/Underfloor Voids - Packing to Floor Joists/S15					No Asbestos Detected

Interior**B00B - R0009 - Main Switch Board**

Wall Linings Internal	Flat AC Sheeting	6m2	North, South & West	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1336/B00B/R0009/Wall Linings Internal/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0019 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1336/B00B/R0019/Ceiling Structures/Linings/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0020 - Home Base

No Asbestos

B00B - R0021 - Home Base

No Asbestos

B00B - R0022 - Withdrawal Space - 2hb

No Asbestos

B00B - R0023 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1336/B00B/R0023/Ceiling Structures/Linings/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0024 - Senior Learning Centre

No Asbestos

B00B - R0025 - General Learning Space - Type 11

No Asbestos

B00B - R0026 - Shared Learning Space

No Asbestos

B00B - R0027 - General Learning Space

No Asbestos

B00B - R0029 - Apparatus Store

No Asbestos

B00B - R0030 - Chemical Store

No Asbestos

B00B - R0031 - Preparation - Science

No Asbestos

B00B - R0032 - Science Laboratory

No Asbestos

B00B - R0033 - General Learning Space - Type 10

No Asbestos

B00B - R0034 - General Learning Space

No Asbestos

B00B - R0035 - Toilets-Boys

No Asbestos

B00B - R0036 - Toilets-Girls

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0037 - Study Space						
No Asbestos						
B00B - R0038 - Laundry						
No Asbestos						
B00B - R0039 - Preparation - Materials						
No Asbestos						
B00B - R0040 - Kitchen - Type 2						
No Asbestos						
B00B - R0041 - Pantry						
No Asbestos						
B00B - R0042 - Secure Storeroom						
No Asbestos						
B00B - R0043 - Movement						
No Asbestos						
B00B - R0044 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R0045 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles					
		1336/B00B/R0045/Floor Coverings Res/Textile/S29				No Asbestos Detected
B00B - R0046 - General Learning Space - Type 1						
No Asbestos						
B00B - R0047 - General Learning Space - Type 1						
No Asbestos						
B00B - R0048 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
		1336/B00B/R0048/Ceiling Structures/Linings/S26				No Asbestos Detected
B00B - R9002 - General Storeroom						
No Asbestos						
B00B - R9003 - General Storeroom						
No Asbestos						
B00B - R9004 - General Storeroom						
Floor	AC Fragments/Debris					
		1336/B00B/R9004/Floor/S25				No Asbestos Detected
B00B - R9005 - Toilets-Girls						
Ceiling Structures/Linings	Flat AC Sheeting					
		1336/B00I/R0037/Wall Linings Internal/S27				No Asbestos Detected
B00B - R9006 - Toilets-Girls						
Ceiling Structures/Linings	Flat AC Sheeting					
		1336/B00I/R0037/Wall Linings Internal/S27				No Asbestos Detected
B00B - R9007 - Toilets-Girls						
Ceiling Structures/Linings	Flat AC Sheeting					
		1336/B00I/R0037/Wall Linings Internal/S27				No Asbestos Detected
B00B - R9008 - Toilets-Girls						
Ceiling Structures/Linings	Flat AC Sheeting					
		1336/B00I/R0037/Wall Linings Internal/S27				No Asbestos Detected
B00B - R9009 - Toilets-Boys						
Ceiling Structures/Linings	Flat AC Sheeting					
		1336/B00I/R0037/Wall Linings Internal/S27				No Asbestos Detected
B00B - R9010 - Toilets-Boys						
Ceiling Structures/Linings	Flat AC Sheeting					
		1336/B00I/R0037/Wall Linings Internal/S27				No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R9011 - Toilets-Boys						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
		1336/B001/R0037/Wall Linings Internal/S27				
B00B - Room+1 - Added Room						
No Asbestos						
B00B - Room+10 - Added Room						
No Asbestos						
B00B - Room+11 - Added Room						
No Asbestos						
B00B - Room+12 - Added Room						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
		1336/B00B/Room+12/Ceiling Structures/Linings/S22				
B00B - Room+2 - Added Room						
No Asbestos						
B00B - Room+3 - Added Room						
No Asbestos						
B00B - Room+4 - Added Room						
No Asbestos						
B00B - Room+5 - Added Room						
No Asbestos						
B00B - Room+6 - Added Room						
No Asbestos						
B00B - Room+7 - Added Room						
No Asbestos						
B00B - Room+8 - Added Room						
No Asbestos						
B00B - Room+9 - Added Room						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Physical Education - 2009 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00C - R0001 - Gymnasium

No Asbestos

B00C - R0002 - Chair Store

No Asbestos

B00C - R0003 - Large Equipment Store

No Asbestos

B00C - R0004 - Change

No Asbestos

B00C - R0005 - Change

No Asbestos

B00C - R0006 - Cleaning Supplies

No Asbestos

B00C - R0007 - Access Shower/Toilet/Change

No Asbestos

B00C - R0008 - Sport Equipment Store

No Asbestos

B00C - R0009 - Canteen

No Asbestos

B00C - R0010 - Canteen Office/Store

No Asbestos

B00C - R0011 - External Movement

No Asbestos

B00C - R0012 - External Movement

No Asbestos

B00C - R0013 - Other

No Asbestos

B00C - R0014 - Other

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1966 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1336/B00I/Eaves Linings/S16					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00I - R0019 - Home Base**

No Asbestos

B00I - R0020 - Practical Activities - 1hb

No Asbestos

B00I - R0021 - Withdrawal Space - 2hb

No Asbestos

B00I - R0022 - Practical Activities - 1hb

No Asbestos

B00I - R0023 - Home Base

No Asbestos

B00I - R0024 - Home Base Store

No Asbestos

B00I - R0025 - Home Base Store

No Asbestos

B00I - R0026 - Other

No Asbestos

B00I - R0027 - Cleaning Store - Distributed

No Asbestos

B00I - R0028 - Staff Toilet

No Asbestos

B00I - R0029 - Staff Toilet

No Asbestos

B00I - R0030 - Movement

No Asbestos

B00I - R0031 - Home Base

No Asbestos

B00I - R0032 - Withdrawal Space - 2hb

No Asbestos

B00I - R0033 - Home Base Store

No Asbestos

B00I - R0034 - Home Base Store

No Asbestos

B00I - R0035 - Home Base

No Asbestos

B00I - R0036 - Movement

No Asbestos

B00I - R0037 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 1336/B00I/R0037/Wall Linings Internal/S27					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

Ceiling Structures/Linings	Flat AC Sheeting 1336/B00I/R0037/Wall Linings Internal/S27					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00I - R0038 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 1336/B00I/R0037/Wall Linings Internal/S27					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
B001 - R0039 - Toilets - Boys						
Wall Linings Internal	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
B001 - R0040 - Toilets - Girls						
Wall Linings Internal	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
B001 - R0041 - Toilets - Girls						
Wall Linings Internal	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
B001 - R0042 - Toilets - Girls						
Wall Linings Internal	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
B001 - R0043 - Toilets - Girls						
Wall Linings Internal	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	1336/B001/R0037/Wall Linings Internal/S27				No Asbestos Detected
B001 - R0044 - External Movement						
No Asbestos						
B001 - R9003 - Special Programs Room						
No Asbestos						
B001 - R9005 - K.L.A. Store						
No Asbestos						
B001 - R9007 - Reading Area						
No Asbestos						
B001 - R9008 - Toilet - Lobby						
No Asbestos						
B001 - R9009 - Library Office/Workroom						
No Asbestos						
B001 - R9010 - Staff - Toilet						
No Asbestos						
B001 - R9011 - External Movement						
No Asbestos						
B001 - Room+1 - Added Room						
No Asbestos						
B001 - Room+2 - Added Room						
No Asbestos						
B001 - Room+3 - Added Room						
No Asbestos						
B001 - Room+4 - Added Room						
No Asbestos						
B001 - Room+5 - Added Room						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B001 - Room+6 - Added Room

No Asbestos

B001 - Room+7 - Added Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1950 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1336/B00L/Eaves Linings/S17					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00L - R0001 - Art Learning Space**

Wall Linings Internal	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1336/B00L/R0002/Wall Linings Internal/S3					Chrysotile (white asbestos)

B00L - R0002 - Kiln Room

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1336/B00L/R0002/Wall Linings Internal/S3					Chrysotile (white asbestos)

B00L - R0003 - Resources Store

Infill Panel	Flat AC Sheeting					
	1336/B00L/R0003/Infill Panel/S23					No Asbestos Detected

B00L - R0004 - External Movement

No Asbestos

B00L - R0005 - Kiln Room

Wall Linings Internal	Flat AC Sheeting					
	1336/B00L/R0005/Wall Linings Internal/S28					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 1965 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1336/B00M/Eaves Linings/S26					Chrysotile (white asbestos)

Interior

B00M - R0001 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1336/B00M/R0002/Wall Linings Internal/S4					

B00M - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1336/B00M/R0002/Wall Linings Internal/S4					

B00M - R0003 - General Storeroom

No Asbestos

B00M - R0004 - No Access

No Asbestos

B00M - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 1913 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - Movement

No Asbestos

B00N - R0002 - General Storeroom

Wall Linings Internal	Flat AC Sheeting					
	1336/B00M/R0002/Wall Linings Internal/S4					No Asbestos Detected

B00N - R0003 - General Learning Space

No Asbestos

B00N - R0004 - Special Programs Room

No Asbestos

B00N - R0005 - General Learning Space

No Asbestos

B00N - R0006 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B000 - Administration - 1999 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B000 - R0001 - Movement

No Asbestos

B000 - R0004 - Clerical Office

No Asbestos

B000 - R0007 - Community Clinic

No Asbestos

B000 - R0008 - Movement

No Asbestos

B000 - R0009 - General Storeroom

No Asbestos

B000 - R0010 - Movement

No Asbestos

B000 - R0011 - Movement

No Asbestos

B000 - R0012 - General Storeroom

No Asbestos

B000 - R0013 - Staff Shower/Change

No Asbestos

B000 - R0014 - Staff Toilet

No Asbestos

B000 - R0015 - Clerical Office

No Asbestos

B000 - R0016 - Principal

No Asbestos

B000 - R0017 - Interview

No Asbestos

B000 - R0018 - General Storeroom

No Asbestos

B000 - R0019 - Movement

No Asbestos

B000 - R0020 - Entry Vestibule

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Communal Facilities - 1999 - Timber Shed (Timber Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00P - R0001 - Sports Store

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1336/B00P/R0001/Wall Linings Internal/S24					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Communal Facilities - 2003 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00Q - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - Agricultural Science - 1999 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00R - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Computer Learning/General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00T - R0001 - Computer Learning Space

No Asbestos

B00T - R0002 - Seminar - Type 2

No Asbestos

B00T - R0003 - Resources Store

No Asbestos

B00T - R0004 - Computer Store

No Asbestos

B00T - R0005 - External Movement

No Asbestos

B00T - R0006 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A1 - Technological & Applied Studies - 2009 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0A1 - R0001 - Materials Workshop - Type 2

No Asbestos

B0A1 - R0002 - Welding/Hot Metals Area

No Asbestos

B0A1 - R0003 - Materials Store

No Asbestos

B0A1 - R0004 - Other

No Asbestos

B0A1 - R0005 - Dust Extraction Space

No Asbestos

B0A1 - R0006 - Other

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0AG - Agricultural Science - 2010 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0AG - R0001 - Class Tools Storage

No Asbestos

B0AG - R0002 - Toilets-Disabled

No Asbestos

B0AG - R0003 - Agriculture Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Administration - 2009 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B001 - R0001 - Staff Study

No Asbestos

B001 - R0002 - Staff Lounge

No Asbestos

B001 - R0003 - Staff Kitchen

No Asbestos

B001 - R0004 - Movement

No Asbestos

B001 - R0005 - Communications Cupboard

No Asbestos

B001 - R0006 - Other

No Asbestos

B001 - R0007 - Preparation/Printing

No Asbestos

B001 - R0008 - Access Shower/Toilet

No Asbestos

B001 - R0009 - Staff Toilet

No Asbestos

B001 - R0010 - Cleaning Store - Distributed

No Asbestos

B001 - R0011 - Interview/Meeting

No Asbestos

B001 - R0012 - Interview/Meeting

No Asbestos

B001 - R0013 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10600 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017