


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Brewarrina Central School (1350)
Region : Western NSW
State Electorate : Barwon
Local Government Area : Brewarrina

Initial Survey : Noel Arnold & Associates : 03 - May - 2008
Reviewed By : Parsons Brinckerhoff : 09 - Nov - 2016

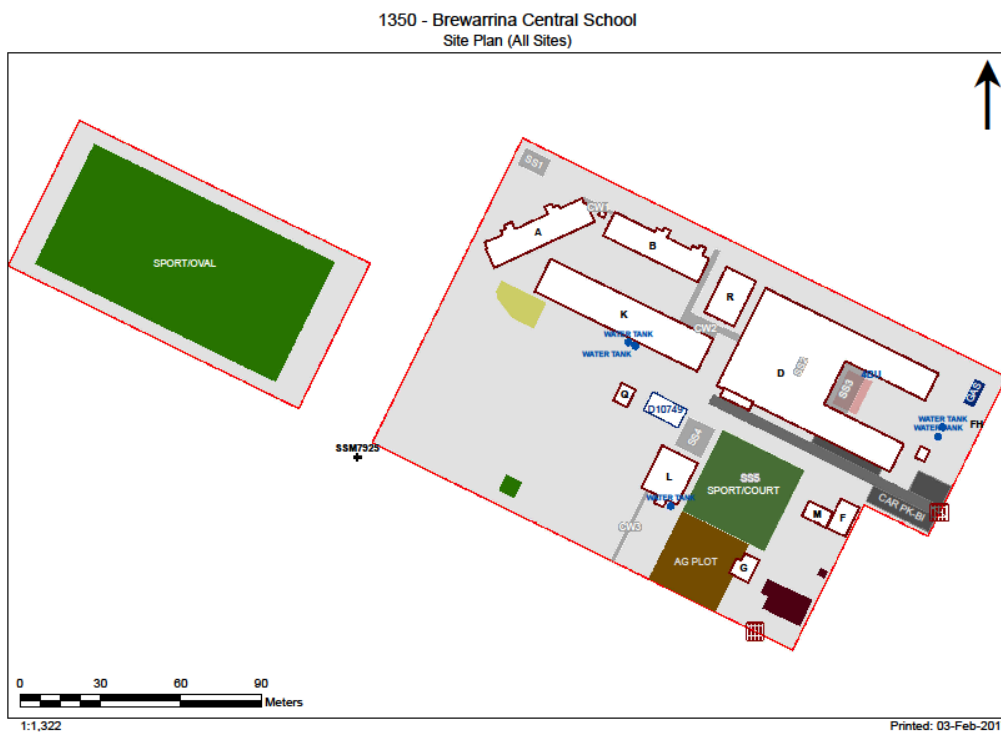

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Pupil Facilities - 1950 - Timber (Timber)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/Eaves Linings/S26			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	1350/B00A/Wall Cladding/S24					
Ceiling Void	No Asbestos Found					

Interior**B00A - R0001 - External Movement**

No Asbestos

B00A - R0002 - Canteen

Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00A/R0002/Wall Linings Internal/S20			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00A/R0002/Ceiling Structures/Linings/S21			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0003 - Plant

No Asbestos

B00A - R0004 - Drinking Facilities

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1350/B00A/R0004/Wall Linings Internal/S22					

B00A - R0005 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Wall Linings Internal/S17			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16			Chrysotile (white asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Partition Walls (Cubicles)/S18			Chrysotile (white asbestos)		

B00A - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1350/B00B/R0006/Wall Linings Internal/S19					

B00A - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1350/B00B/R0006/Wall Linings Internal/S19					

B00A - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1350/B00B/R0006/Wall Linings Internal/S19					

B00A - R0010 - Toilets - Boys

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)
B00A - R0011 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00A/R0002/Ceiling Structures/Linings/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0012 - Home Base						
Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00A/R0002/Ceiling Structures/Linings/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0013 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00A/R0002/Ceiling Structures/Linings/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0014 - External Stairs						
No Asbestos						
B00A - R0015 - External Stairs						
No Asbestos						
B00A - R1001 - External Movement						
Floor Coverings Res/Textile	Compressed AC Sheet					
	1350/B00B/R1001/Floor Coverings Res/Textile/S10					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R1001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B00A - R1002 - General Storeroom						
No Asbestos						
B00A - R1003 - Staff Room Annexe						
Wall Linings Internal	Flat AC Sheeting					
	1350/B00A/R1003/Wall Linings Internal/S25					No Asbestos Detected
B00A - R1004 - Home Base						
No Asbestos						
B00A - R1005 - Home Base						
Board behind heaters	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R1004/Board behind heaters/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1008 - Home Base						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Heater Surround	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00B/R1004/Board behind heaters/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1009 - Home Base						
Board behind heaters	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00B/R1004/Board behind heaters/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1010 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R1011 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00B/R1008/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)		
B00A - R1012 - External Stairs						
No Asbestos						
B00A - R1013 - External Stairs						
No Asbestos						
B00A - R1014 - Withdrawal Space - 2hb						
Recently Modified Space	Requires Inspection					
B00A - R1015 - Practical Activities - 2hb						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1950 - Timber (Timber)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/Eaves Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					

Interior**B00B - R0001 - External Movement**

Wall Linings Internal	Flat AC Sheeting					
	1350/B00B/R0001/Wall Linings Internal/S15					No Asbestos Detected

B00B - R0002 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)

B00B - R0003 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00B - R0006 - Toilets-Disabled

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1350/B00B/R0006/Wall Linings Internal/S19					

B00B - R0007 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R0002/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)

B00B - R0008 - External Stairs

No Asbestos

B00B - R0009 - External Stairs

No Asbestos

B00B - R1001 - External Movement

Floor Coverings Res/Textile	Compressed AC Sheet					
	1350/B00B/R1001/Floor Coverings Res/Textile/S10					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R1001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1002 - Staff Room Annexe						
Wall Linings Internal	Flat AC Sheeting					
	1350/B00B/R1002/Wall Linings Internal/S12					No Asbestos Detected
B00B - R1003 - Staff Room Annexe						
Splashback lining	Flat AC Sheeting	1m2	Behind sink	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R1004/Board behind heaters/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1004 - Home Base						
Wall Linings Internal	Flat AC Sheeting					
	1350/B00B/R1002/Wall Linings Internal/S12					No Asbestos Detected
Board behind heaters	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R1004/Board behind heaters/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1005 - Home Base						
Wall Linings Internal	Flat AC Sheeting					
	1350/B00B/R1002/Wall Linings Internal/S12					No Asbestos Detected
Heater Surround	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R1004/Board behind heaters/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1006 - Home Base						
Board behind heaters	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R1004/Board behind heaters/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1009 - Home Base						
Heater Surround	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00B/R1004/Board behind heaters/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1010 - Movement						
No Asbestos						
B00B - R1011 - Home Base Store						
No Asbestos						
B00B - R1012 - Withdrawal Space - 1hb						
No Asbestos						
B00B - R1013 - External Stairs						
No Asbestos						
B00B - R1014 - External Stairs						
No Asbestos						
B00B - R1015 - Withdrawal Space - 2hb						
Recently Modified Space	Requires Inspection					
B00B - R1016 - Practical Activities - 2hb						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Senior Learning/Pupil Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Wall Cladding	Galbestos	200m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/Wall Cladding/S27					Chrysotile (white asbestos)

Interior**B00D - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00D - R0002 - Staff Study

No Asbestos

B00D - R0003 - Staff Room Annexe

No Asbestos

B00D - R0004 - Cleaning Distributed Store

No Asbestos

B00D - R0005 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00D - R0006 - General Learning Space

No Asbestos

B00D - R0007 - Darkroom Space

Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00D - R0008 - Movement

No Asbestos

B00D - R0009 - Staff Room Annexe

No Asbestos

B00D - R0010 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00D - R0011 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/R0011/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00D - R0012 - Main Switch Board

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/R0012/Electrical Backing Board/S30					Chrysotile (white asbestos)

B00D - R0013 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00D - R0014 - Computer Learning Space

No Asbestos

B00D - R0015 - Pantry

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00D - R0016 - Staff Room Annexe						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00D - R0017 - Food Technology L.S.						
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00D - R0018 - Resource/Project Store						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00D - R0019 - Resource/Project Store						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00D - R0020 - Shower/Change						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0011/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
B00D - R0021 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0011/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
B00D - R0022 - Distribution Board						
No Asbestos						Note: No inspection of live electrical installation.
B00D - R0023 - Staff Toilet						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1350/B00D/R0023/Partition Walls (Cubicles)/S28					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
1350/B00D/R0023/Floor Coverings Res/Textile/S29					No Asbestos Detected	
Incinerette	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	High Priority (6-8)
Assumed Asbestos - Encapsulated material within unit						
B00D - R0024 - Staff Toilet						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1350/B00D/R0023/Partition Walls (Cubicles)/S28					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
1350/B00D/R0023/Floor Coverings Res/Textile/S29					No Asbestos Detected	
B00D - R0025 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00D - R0032 - General Learning Space						
No Asbestos						
B00D - R0035 - Distribution Board						
No Asbestos						Note: No inspection of live electrical installation.
Door Lining	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1350/B00D/R0035/Door Linings/S5					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - No Access to Room - Access via

B00D - R0036 - Chemical Store

Shelving unit	Compressed AC Sheet 1350/B00D/R0036/Shelving/S6					No Asbestos Detected
---------------	--	--	--	--	--	----------------------

B00D - R0037 - Apparatus Store

No Asbestos

B00D - R0038 - Preparation

No Asbestos

B00D - R0039 - Laboratory L.S.

No Asbestos

B00D - R0040 - Withdrawal Space - 1hb

No Asbestos

B00D - R0046 - External Movement

No Asbestos

B00D - R0053 - Workshop Area

No Asbestos

B00D - R0054 - Plant

No Asbestos

B00D - R0055 - Welding Area

No Asbestos

B00D - R0056 - Welding Area

No Asbestos

B00D - R0057 - Project Store - Type 1

No Asbestos

B00D - R0058 - Materials Store

No Asbestos

B00D - R0060 - Toilets-Boys

No Asbestos

B00D - R0062 - General Learning Space

Recently Modified Space Requires Inspection

B00D - R0063 - Study Space

Recently Modified Space Requires Inspection

B00D - R0064 - Study Space

Recently Modified Space Requires Inspection

B00D - R0065 - Art Learning Space

Recently Modified Space Requires Inspection

B00D - R0066 - Kiln Room

Recently Modified Space Requires Inspection

B00D - R0067 - General Storeroom

Recently Modified Space Requires Inspection

B00D - R0068 - P.E. Store

Recently Modified Space Requires Inspection

B00D - R0070 - Kitchen - Type 2

Recently Modified Space Requires Inspection

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Shed - 1920 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00F - R0001 - Sports Store

No Asbestos

B00F - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Agricultural Science - 1950 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior

B00G - R0002 - Class Tools Storage

No Asbestos

B00G - R0003 - Machine Storage

No Asbestos

B00G - R0004 - Agriculture Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 2006 - Concrete (Concrete)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00J - R0001 - Lift

No Asbestos

B00J - R1001 - Lift

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00K - Administration/General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00K - R0001 - Entry Vestibule

No Asbestos

B00K - R0002 - Clerical Office

No Asbestos

B00K - R0003 - Principal Office

No Asbestos

B00K - R0004 - Staff Room

No Asbestos

B00K - R0005 - Staff Room

No Asbestos

B00K - R0006 - Store

No Asbestos

B00K - R0007 - Staff - Toilet

No Asbestos

B00K - R0008 - Staff - Toilet

No Asbestos

B00K - R0009 - Staff - Toilet

No Asbestos

B00K - R0010 - Cleaning Store - Distributed

No Asbestos

B00K - R0011 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0012 - Access Shower/Toilet/Change

No Asbestos

B00K - R0013 - Sick Bay

No Asbestos

B00K - R0014 - Sick Bay

No Asbestos

B00K - R0015 - Movement

No Asbestos

B00K - R0016 - Deputy Principal Office

No Asbestos

B00K - R0017 - Deputy Principal

No Asbestos

B00K - R0018 - Reading Area

No Asbestos

B00K - R0019 - K.L.A. Store

No Asbestos

B00K - R0020 - Staff - Toilet

No Asbestos

B00K - R0021 - Library Administration

No Asbestos

B00K - R0022 - General Learning Space

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00K - R0023 - General Learning Space						
No Asbestos						
B00K - R0024 - Cleaning Distributed Store						
No Asbestos						
B00K - R0025 - Communication Space						
No Asbestos						
B00K - R0026 - K.L.A. Store						
No Asbestos						
B00K - R0027 - Distribution Board				Note: No inspection of live electrical installation.		
No Asbestos						
B00K - R0028 - General Learning Space						
No Asbestos						
B00K - R0029 - General Storeroom						
No Asbestos						
B00K - R0030 - Class Tools Storage						
No Asbestos						
B00K - R0031 - Deputy Principal Office						
No Asbestos						
B00K - R0032 - Duplicating Workroom						
No Asbestos						
B00K - R0033 - Movement						
No Asbestos						
B00K - R0034 - Distribution Board				Note: No inspection of live electrical installation.		
No Asbestos						
B00K - R0035 - Movement						
No Asbestos						
B00K - R0036 - Movement						
No Asbestos						
B00K - R0037 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Multi Purpose Facilities/General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - External Movement

No Asbestos

B00L - R0002 - Communal Space

No Asbestos

B00L - R0003 - Chair Store

No Asbestos

B00L - R0004 - Communications Cupboard

No Asbestos

B00L - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0006 - Plant

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Building Services - 2005 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Administration - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Building Services - 2011 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00P - R0001 - Other

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Pupil Facilities - 2015 - Brick/Block (Brick/Block)

Exterior

- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos

Interior

B00Q - R0001 - External Movement

- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos

B00Q - R0002 - Handwashing Facilities

- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos

B00Q - R0003 - Movement

- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos

B00Q - R0004 - Handwashing Facilities

- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos

B00Q - R0005 - Toilets-Girls

- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos

B00Q - R0006 - Toilets-Disabled

- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos

B00Q - R0007 - Toilets-Boys

- No Asbestos
- No Asbestos
- No Asbestos
- No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - New Building

Exterior

No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos

Interior

B00R - R0001 - Other-Community Use

No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos

B00R - R0002 - Interview/Office - Type 3

No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos

B00R - R0003 - Interview/Office - Type 3

No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos

B00R - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos

B00R - R0005 - Disabled Toilet

No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos

B00R - R0006 - Toilets-Girls

No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos

B00R - R0007 - Toilets-Boys

No Asbestos
 No Asbestos
 No Asbestos
 No Asbestos

B00R - R0008 - Store

No Asbestos
 No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

No Asbestos

B00R - R0009 - Other-Community Use

No Asbestos

No Asbestos

No Asbestos

No Asbestos

B00R - R0010 - Movement

No Asbestos

No Asbestos

No Asbestos

No Asbestos

B00R - R0011 - External Movement

No Asbestos

No Asbestos

No Asbestos

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 510 - D10749 - Staff Common Room : Placement Date - 7/11/2001

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				17.28 m2

Interior

R1 - Commonroom/staff room

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				90 m2

R2 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2

R3 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2

R4 - Lobby

Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
---------	---------------	------------------	--	--	--	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017