


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Burringbar Public School (1449)
Region : North Coast
State Electorate : Tweed
Local Government Area : Tweed

Initial Survey : Noel Arnold & Associates : 27 - May - 2008
Reviewed By : Greencap-NAA : 04 - May - 2016

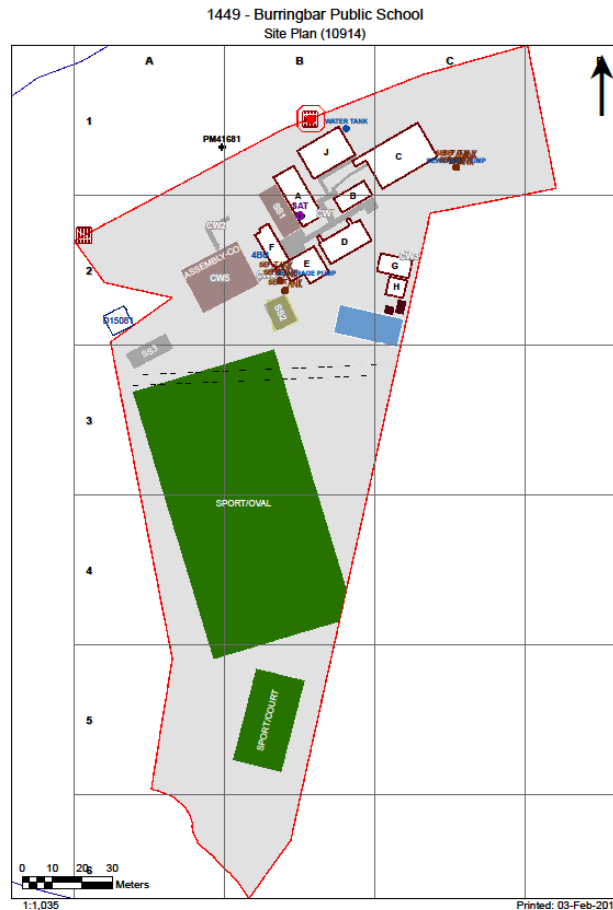

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1951 - Timber (Timber)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restricted, greater 4m					
Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00A/Eaves Linings/S16					Chrysotile (white asbestos)

Interior**B00A - R0004 - Principal**

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00A/R0006/Wall Linings Internal/S15					

B00A - R0005 - Entry Vestibule

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00A/R0006/Wall Linings Internal/S15					

B00A - R0006 - Interview

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00A/R0006/Wall Linings Internal/S15					

B00A - R0007 - External Movement

No Asbestos

B00A - R0008 - Sick Bay

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00A/R0008/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0009 - Clerical Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00A/R0008/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0010 - Special Programs Store

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00A/R0006/Wall Linings Internal/S15					

B00A - R0011 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00A/R0006/Wall Linings Internal/S15					

B00A - R0012 - Interview

No Asbestos

B00A - R0013 - Movement

No Asbestos

B00A - R0014 - Entry Vestibule

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	1449/B00D/R0001/Floor Coverings Res/Textile/S7					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00A/R0006/Wall Linings Internal/S15					

B00A - R0015 - Clerical Office

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00A/R0006/Wall Linings Internal/S15					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00B - General Learning - 1956 - Timber (Timber)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting					
	1449/B00B/R0004/Ceiling Structures/Linings/S3					No Asbestos Detected

Interior**B00B - R0003 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
	1449/B00B/R0003/Floor Coverings Res/Textile/S14					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	1449/B00B/R0003/Wall Linings Internal/S2					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	1449/B00B/R0003/Floor Coverings Res/Textile/S18					No Asbestos Detected

B00B - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	1449/B00B/R0004/Ceiling Structures/Linings/S3					No Asbestos Detected

B00B - R0005 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting					
	1449/B00B/R0003/Wall Linings Internal/S2					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1994 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00C - R0001 - Toilets - Boys**

No Asbestos

B00C - R0002 - Staff Room Annexe

No Asbestos

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Home Base Store

No Asbestos

B00C - R0005 - Practical Activities - 1hb

No Asbestos

B00C - R0006 - Toilets - Girls

No Asbestos

B00C - R0007 - External Movement

No Asbestos

B00C - R0008 - Home Base

No Asbestos

B00C - R0009 - Personal Effects Storage

No Asbestos

B00C - R0010 - Practical Activities - 1hb

No Asbestos

B00C - R0011 - Withdrawal Space - 1hb

No Asbestos

B00C - R0012 - Home Base Store

No Asbestos

B00C - R0013 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Staff Facilities/General Learning - 1951 - Timber (Timber)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restricted, greater 4m					
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00D/Eaves Linings/S8					Chrysotile (white asbestos)

Interior**B00D - R0001 - Withdrawal Space - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1449/B00B/R0004/Ceiling Structures/Linings/S3					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00B/R0003/Wall Linings Internal/S2					
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1449/B00D/R0001/Floor Coverings Res/Textile/S7					
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Kitchenette, beneath pink tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00A/R0008/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	1449/B00D/R0001/Floor Coverings Res/Textile/S17					

B00D - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00B/R0003/Wall Linings Internal/S2					

B00D - R0003 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1449/B00B/R0003/Wall Linings Internal/S2					
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00A/R0008/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00D - R0004 - Security Store

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00A/R0008/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00D/R0004/Wall Linings Internal/S5					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00D/R0004/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00D - R0005 - External Movement

No Asbestos

B00D - R0006 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1951 - Timber (Timber)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00E/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)

Interior**B00E - R0001 - Home Base**

Wall Linings Internal	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00E/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00E/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)

B00E - R0002 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00E/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00E/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles					
	1449/B00D/R0001/Floor Coverings Res/Textile/S7					No Asbestos Detected

B00E - R0003 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00E/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00E/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)

B00E - R0004 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting					
	1449/B00E/R0004/Wall Linings Internal/S9					No Asbestos Detected
Partition Walls (Cubicles)	Flat AC Sheeting					
	1449/B00E/R0004/Partition Walls (Cubicles)/S10					No Asbestos Detected

B00E - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00E/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1951 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1449/B00D/R0001/Floor Coverings Res/Textile/S7					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 1449/B00D/R0001/Floor Coverings Res/Textile/S7					No Asbestos Detected

Interior**B00F - R0001 - External Movement**

No Asbestos

B00F - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00F/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00F - R0004 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00F/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00F - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00F/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00F - R0007 - Toilet - Lobby

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00F/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00F - R0008 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00F/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00F - R0009 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00F/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00F - R0010 - Toilet - Lobby

Ceiling Structures/Linings	Flat AC Sheeting	1.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1449/B00F/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1956 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1449/B00G/Eaves Linings/S13					No Asbestos Detected

Interior

B00G - R0001 - Craft Store

Ceiling Structures/Linings	Flat AC Sheeting 1449/B00G/R0001/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00G - R0003 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Mechanical Services - 1993 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00H - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00J - R0001 - External Movement

No Asbestos

B00J - R0002 - Reading Area

No Asbestos

B00J - R0003 - Library Office/Workroom

No Asbestos

B00J - R0004 - Communications Room

No Asbestos

B00J - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 801 - D15081 - FSU : Placement Date - 23/07/1998

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		8.64 m2

Interior

R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		45 m2

R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017