


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bundeena Public School (3765)
Region : Sydney
State Electorate : Heathcote
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 21 - Mar - 2008
Reviewed By : AECOM : 26 - May - 2015

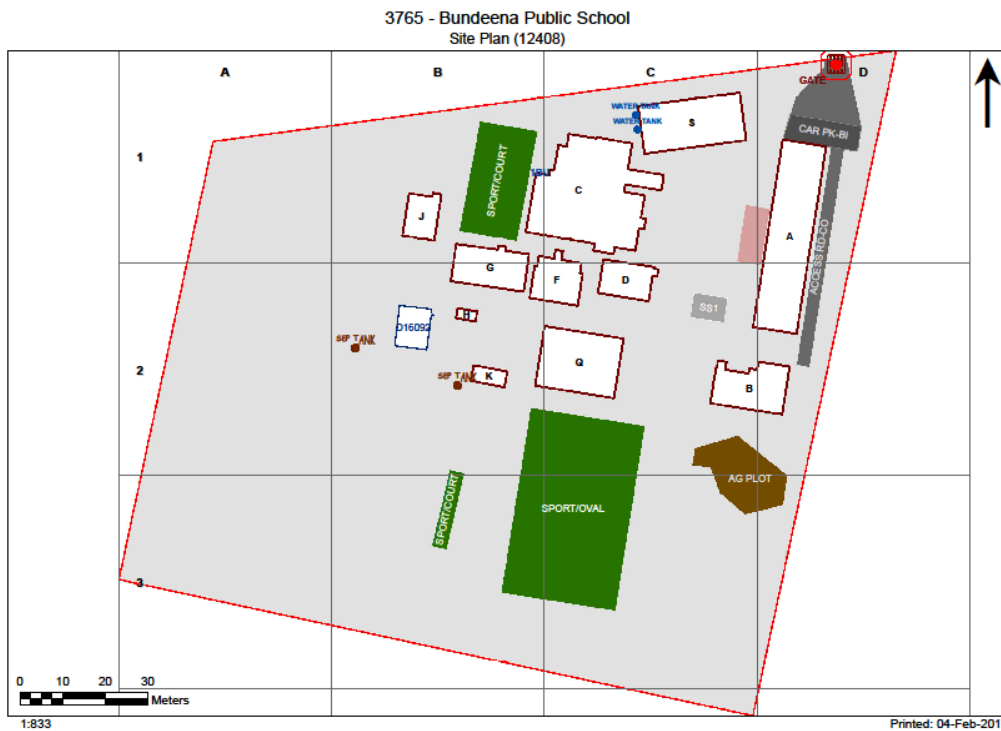

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - Administration/General Learning - 1954 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|----------------------------|--|------|-------------------------------|--------------------|------------------------------------|--------------------|
| Eaves Linings | Flat AC Sheeting | 40m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00A/R0012/Ceiling Structures/Linings/S15 | | | | Chrysotile (white asbestos) | |
| Gable verge lining | Flat AC Sheeting | 10m | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00A/R9002/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) | |
| In-fill panel below window | Flat AC Sheeting | 15m2 | Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00A/In-fill panel below window/S16 | | | | Chrysotile (white asbestos) | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | Non Accessible Area - Area inaccessible | | | | | |

Interior**B00A - R0004 - Movement**

No Asbestos

B00A - R0009 - Distribution Board

Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------|---|-----|--------------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00A/R0008/Wall Linings Internal/S17 | | | | Chrysotile (white asbestos) | |

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - External Movement

| | | | | | | |
|----------------------------|--|------|--------------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 75m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00A/R0012/Ceiling Structures/Linings/S15 | | | | Chrysotile (white asbestos) | |
| In-fill panel below Window | Flat AC Sheeting | 11m2 | Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00A/In-fill panel below window/S16 | | | | Chrysotile (white asbestos) | |

B00A - R0013 - Personal Effects Storage

No Asbestos

B00A - R0014 - Home Base Store

No Asbestos

B00A - R0015 - Home Base

No Asbestos

B00A - R0016 - Special Programs Room

No Asbestos

B00A - R0017 - Home Base Store

No Asbestos

B00A - R0018 - Personal Effects Storage

No Asbestos

B00A - R0019 - Toilets - Girls

| | | | | | | |
|----------------------------|--|------|--------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 35m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00A/R0020/Ceiling Structures/Linings/S10 | | | | Chrysotile (white asbestos) | |
| Partition Walls (Cubicles) | Compressed AC Sheet | | | | | |
| | 3765/B00A/R0020/Partition Walls (Cubicles)/S11 | | | | No Asbestos Detected | |

B00A - R0020 - Toilets - Boys

| | | | | | | |
|----------------------------|--|------|--------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 35m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00A/R0020/Ceiling Structures/Linings/S10 | | | | Chrysotile (white asbestos) | |
| Partition Walls (Cubicles) | Compressed AC Sheet | | | | | |
| | 3765/B00A/R0020/Partition Walls (Cubicles)/S11 | | | | No Asbestos Detected | |

B00A - R0024 - General Storeroom

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|--|--------|--------------------|--------------------|-------------|--|
| Sample No | | | | | Test Result | |
| No Asbestos | | | | | | |
| B00A - R0025 - Sick Bay | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0026 - Entry Vestibule | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) 3765/B00A/R0026/Floor Coverings Res/Textile/S18 | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0027 - Toilet - Lobby | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0028 - Staff Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0029 - Staff Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0030 - Principal | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) 3765/B00A/R0026/Floor Coverings Res/Textile/S18 | 18m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0031 - General Storeroom | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) 3765/B00A/R0026/Floor Coverings Res/Textile/S18 | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0032 - Clerical Office/Workroom | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) 3765/B00A/R0026/Floor Coverings Res/Textile/S18 | 24m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0033 - Clerical/Printing | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) 3765/B00A/R0026/Floor Coverings Res/Textile/S18 | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R9001 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 3765/B00A/R9002/Ceiling Structures/Linings/S12 | 60m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting 3765/B00A/R9003/Wall Linings Internal/S13 | | | | | No Asbestos Detected |
| Floor Coverings Res/Textile | Vinyl Tiles 3765/B00A/R9001/Floor Coverings Res/Textile/S14 | | | | | No Asbestos Detected |
| B00A - R9002 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 3765/B00A/R9002/Ceiling Structures/Linings/S12 | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R9003 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 3765/B00A/R9002/Ceiling Structures/Linings/S12 | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting 3765/B00A/R9003/Wall Linings Internal/S13 | | | | | No Asbestos Detected |
| B00A - R9004 - Cleaning Distributed Store | | | | | | |
| No Asbestos | | | | | | |
| B00A - R9005 - Sports Store | | | | | | |
| No Asbestos | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00B - Library - 1956 - Timber (Timber)**Exterior**

| | | | | | | |
|------------------|--|--|--|--|--|-----------------------------|
| Eaves Linings | Flat AC Sheeting 3765/B00B/Eaves Linings/S8 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior**B00B - R0001 - External Movement**

No Asbestos

B00B - R0005 - External Movement

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 3765/B00B/Eaves Linings/S8 | | | | | No Asbestos Detected |
|----------------------------|--|--|--|--|--|-----------------------------|

B00B - R0007 - Staff Toilet

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting 3765/B00B/R0007/Wall Linings Internal/S9 | | | | | No Asbestos Detected |
|-----------------------|--|--|--|--|--|-----------------------------|

B00B - R0008 - Reading Area

No Asbestos

B00B - R0009 - Movement

No Asbestos

B00B - R0010 - Toilet - Lobby

No Asbestos

B00B - R0011 - Staff Room

No Asbestos

B00B - R0012 - Staff Kitchen

No Asbestos

B00B - R0013 - General Storeroom

No Asbestos

B00B - R0014 - Movement

No Asbestos

B00B - R0015 - Interview

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - Communal Facilities/Pupil Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior**B00C - R0001 - External Movement**

No Asbestos

B00C - R0002 - Canteen

No Asbestos

B00C - R0003 - Canteen Office/Store

No Asbestos

B00C - R0004 - Canteen Office/Store

No Asbestos

B00C - R0005 - Disabled Toilet

No Asbestos

B00C - R0006 - Hall Chair Store

No Asbestos

B00C - R0007 - Plant

No Asbestos

B00C - R0008 - External Movement

No Asbestos

B00C - R0009 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0010 - Communal Space

No Asbestos

B00C - R0011 - External Movement

No Asbestos

B00C - R0012 - Movement

No Asbestos

B00C - R0013 - Toilets - Girls

No Asbestos

B00C - R0015 - External Movement

No Asbestos

B00C - R0017 - Movement

No Asbestos

B00C - R0020 - Distribution Board

No Asbestos

Note: No inspection of live electrical installation.

B00C - R0021 - Raised Platform

No Asbestos

B00C - R0022 - Toilets - Boys

No Asbestos

B00C - R0023 - Covered Outdoor Learning Area

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning - 1956 - Timber (Timber)**Exterior**

| | | | | | | |
|--------------------|-----------------------------|-----|-----------------------------|--------------------|---|--------------------|
| Eaves Linings | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00D/Eaves Linings/S19 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | |
| Gable verge lining | Flat AC Sheeting | 10m | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00D/Eaves Linings/S19 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior**B00D - R0001 - External Movement**

| | | | | | | |
|----------------------------|---|--|--|--|-----------------------------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | 3765/B00D/R0001/Ceiling Structures/Linings/S7 | | | | No Asbestos Detected | |

B00D - R0002 - Home Base

No Asbestos

B00D - R0004 - Home Base Store

| | | | | | | |
|-----------------------|--|--|--|--|-----------------------------|--|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | No Asbestos Detected | |

B00D - R0005 - Home Base Store

| | | | | | | |
|-----------------------|--|--|--|--|-----------------------------|--|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | No Asbestos Detected | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00F - General Learning - 1954 - Timber (Timber)**Exterior**

| | | | | | | |
|--|-----------------------------|-----|--------------|---|------------|--------------------|
| Eaves Linings | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00F/Eaves Linings/S20 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids - Packing to Floor Joists | Packing | NA | Throughout | Good Condition (1) | Medium (2) | Low Priority (2-3) |
| | 3765/B00F/Eaves Linings/S20 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

Interior**B00F - R0001 - External Movement**

| | | | | | | |
|----------------------------|-----------------------------|-----|--------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00F/Eaves Linings/S20 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00F - R0002 - Personal Effects Storage

| | | | | | | |
|----------------------------|-----------------------------|------|--------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 12m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00F/Eaves Linings/S20 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00F - R0003 - Home Base

No Asbestos

B00F - R0004 - Special Programs Room

No Asbestos

B00F - R0005 - Home Base Store

No Asbestos

B00F - R0006 - Withdrawal Space - 1hb

| | | | | | | |
|----------------------------|-----------------------------|------|--------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00F/Eaves Linings/S20 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00G - General Learning - 1954 - Timber (Timber)**Exterior**

| | | | | | | |
|------------------|---|-----|--------------|--------------------|------------------------------------|-----------------------------|
| Eaves Linings | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00G/R0001/Ceiling Structures/Linings/S4 | | | | Chrysotile (white asbestos) | |
| Wall Cladding | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior**B00G - R0001 - External Movement**

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00G/R0001/Ceiling Structures/Linings/S4 | | | | Chrysotile (white asbestos) | |

B00G - R0003 - Home Base Store

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|------------------------------------|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00G/R0008/Ceiling Structures/Linings/S3 | | | | Chrysotile (white asbestos) | |

B00G - R0006 - Home Base Store

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|------------------------------------|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00G/R0008/Ceiling Structures/Linings/S3 | | | | Chrysotile (white asbestos) | |

B00G - R0007 - General Assistant/Bulk Store

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | | |
| Ceiling Structures/Linings | No Asbestos Found | | | | | |

B00G - R0008 - Movement

| | | | | | | |
|----------------------------|---|------|--------------|--------------------|------------------------------------|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 27m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00G/R0008/Ceiling Structures/Linings/S3 | | | | Chrysotile (white asbestos) | |

B00G - R0009 - Home Base

| | | | | | | |
|----------------------------|---|------|--------------|--------------------|---|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 50m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00G/R0009/Wall Linings Internal/S2 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |
| Ceiling Structures/Linings | Flat AC Sheeting | 90m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00G/R0008/Ceiling Structures/Linings/S3 | | | | Chrysotile (white asbestos) | |

B00G - R0010 - Home Base Store

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|------------------------------------|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00G/R0008/Ceiling Structures/Linings/S3 | | | | Chrysotile (white asbestos) | |

B00G - R0011 - Distribution Board

Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 3765/B00G/R0008/Wall Linings Internal/S1 | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00H - Pupil Facilities - 1954 - Brick/Block (Brick/Block)

Exterior

| | |
|-----------------------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

Interior

B00H - R0001 - Drinking Facilities

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00J - General Learning - 1954 - Timber (Timber)**Exterior**

| | | | | | | |
|------------------|---|-----|--------------|--------------------|---------|------------------------------------|
| Eaves Linings | Flat AC Sheeting | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00J/R0001/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | Non Accessible Area - Area inaccessible | | | | | |

Interior**B00J - R0001 - External Movement**

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 3765/B00J/R0001/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) |

B00J - R0003 - Home Base

No Asbestos

B00J - R0004 - Withdrawal Space - 1hb

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 3765/B00J/R0004/Wall Linings Internal/S6 | | | | | No Asbestos Detected |

B00J - R0005 - Home Base Store

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 3765/B00J/R0004/Wall Linings Internal/S6 | | | | | No Asbestos Detected |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00K - Special Purpose - 1985 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling Non Accessible Area
 - Area inaccessible

Underfloor Voids No Asbestos Found

Interior

B00K - R0001 - Bulk Store

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00Q - General Learning - 1954 - Brick/Veneer (Brick/Veneer)**Exterior**

| | |
|-------------------------------|--|
| Ceiling Voids - Raked Ceiling | Non Accessible Area - Area inaccessible |
| Underfloor Voids | No Asbestos Found |

Interior**B00Q - R0001 - External Movement**

No Asbestos

B00Q - R0002 - Practical Activities - 1hb

No Asbestos

B00Q - R0003 - Home Base

No Asbestos

B00Q - R0004 - Home Base Store

No Asbestos

B00Q - R0005 - Withdrawal Space - 1hb

No Asbestos

B00Q - R0006 - Withdrawal Space - 1hb

No Asbestos

B00Q - R0007 - Withdrawal Space - 1hb

No Asbestos

B00Q - R0008 - Home Base Store

No Asbestos

B00Q - R0009 - Home Base

No Asbestos

B00Q - R0010 - Practical Activities - 1hb

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00S - Library - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Area inaccessible

Underfloor Voids - Slab on Ground
No Asbestos Found

Interior**B00S - R0001 - Toilet - Lobby**

No Asbestos

B00S - R0002 - Staff Toilet

No Asbestos

B00S - R0003 - No Access

No Asbestos

B00S - R0004 - Cleaning Distributed Store

No Asbestos

B00S - R0005 - K.L.A. Store

No Asbestos

B00S - R0006 - Communications Room

No Asbestos

B00S - R0007 - Library Office/Workroom

No Asbestos

B00S - R0008 - Reading Area

No Asbestos

B00S - R0009 - External Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D16092 - Learning Unit - Standard With P.A.A. : Placement Date - 9/02/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3765_ASB_080814_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017