


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** Brewongle Environmental Education Centre (5694)  
**Region :** Western Sydney  
**State Electorate :** Hawkesbury  
**Local Government Area :** The Hills

**Initial Survey :** Noel Arnold & Associates : 30 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 14 - Feb - 2017

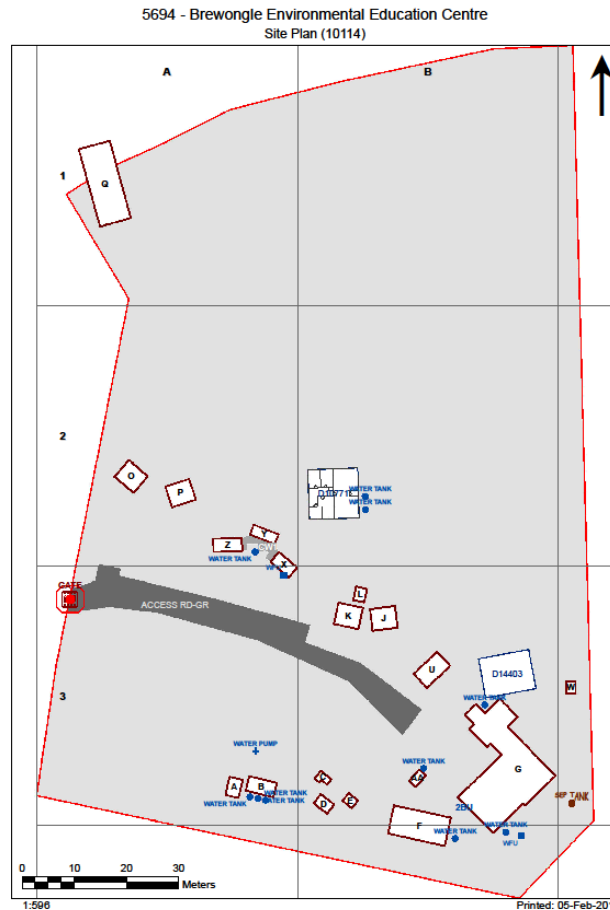

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - Shed - 1878 - Sandstone (Sandstone)**

**Exterior**

|                 |                   |
|-----------------|-------------------|
| Underfloor void | No Asbestos Found |
| Ceiling lining  | No Asbestos Found |

**Interior**

**B00A - R0001 - Cleaning Supplies**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - Shed - 1989 - Timber (Timber)**

**Exterior**

|                 |                   |
|-----------------|-------------------|
| Ceiling Voids   | No Asbestos Found |
| Underfloor void | No Asbestos Found |

**Interior**

**B00B - R0001 - General Storeroom**

No Asbestos

**B00B - R0002 - General Assistants**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00C - Pupil Facilities - 1960 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                 |                   |
|-----------------|-------------------|
| Ceiling lining  | No Asbestos Found |
| Underfloor void | No Asbestos Found |

**Interior**

**B00C - R0001 - Toilets-Boys**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - Shed - 1989 - Timber Shed (Timber Shed)**

**Exterior**

|                  |   |     |            |                    |                                    |                    |
|------------------|---|-----|------------|--------------------|------------------------------------|--------------------|
| Underfloor Voids | No Asbestos Found                             |     |            |                    |                                    |                    |
| Eaves Linings    | Flat AC Sheeting                              | 2m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|                  | 5694/B00W/R0001/Ceiling Structures/Linings/S4 |     |            |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Ceiling Voids    | No Asbestos Found                             |     |            |                    |                                    |                    |

**Interior**

**B00D - R0001 - General Storeroom**

|                            |   |      |            |                    |                                    |                    |
|----------------------------|---|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 6m2  | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|                            | 5694/B00W/R0001/Ceiling Structures/Linings/S4 |      |            |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Wall Linings Internal      | Flat AC Sheeting                              | 16m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|                            | 5694/B00D/R0001/Wall Linings Internal/S5      |      |            |                    | <b>Chrysotile (white asbestos)</b> |                    |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00E - Pupil Facilities - 1960 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                 |                   |
|-----------------|-------------------|
| Ceiling lining  | No Asbestos Found |
| Underfloor void | No Asbestos Found |

**Interior**

**B00E - R0001 - Toilets-Girls**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00F - General Learning/Staff Facilities - 1950 - Timber (Timber)**

**Exterior**

|                 |                   |  |  |  |  |  |
|-----------------|-------------------|--|--|--|--|--|
| Ceiling lining  | No Asbestos Found |  |  |  |  |  |
| Underfloor void | No Asbestos Found |  |  |  |  |  |

**Interior**

**B00F - R0001 - Staff Kitchen**

|  |                  |      |            |   |         |                    |
|--|------------------|------|------------|---|---------|--------------------|
| Wall Linings Internal                    | Flat AC Sheeting | 34m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 5694/B00F/R0002/Wall Linings Internal/S6 |                  |      |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00F - R0002 - Movement**

|  |                  |      |            |   |         |                    |
|--|------------------|------|------------|---|---------|--------------------|
| Wall Linings Internal                    | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 5694/B00F/R0002/Wall Linings Internal/S6 |                  |      |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00F - R0003 - Covered Outdoor Learning Area**

|  |                  |      |            |   |         |                    |
|--|------------------|------|------------|---|---------|--------------------|
| Wall Linings Internal                    | Flat AC Sheeting | 40m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 5694/B00F/R0002/Wall Linings Internal/S6 |                  |      |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00G - General Learning/Administration - 1878 - Sandstone (Sandstone)**

**Exterior**

|                 |                   |
|-----------------|-------------------|
| Ceiling voids   | No Asbestos Found |
| Underfloor void | No Asbestos Found |

**Interior**

**B00G - R0001 - Movement**

|  |                  |      |            |  |         |                    |
|--|------------------|------|------------|--|---------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 13m2 | Throughout | Good Condition (1)                                     | Low (1) | Low Priority (2-3) |
| 5694/B00G/Room+6/Ceiling Structures/Linings/S3 |                  |      |            | Chrysotile (white asbestos) , Amosite (brown asbestos) |         |                    |

**B00G - R0002 - Clerical Office**

|  |                  |     |            |  |         |                    |
|--|------------------|-----|------------|--|---------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 9m2 | Throughout | Good Condition (1)                                     | Low (1) | Low Priority (2-3) |
| 5694/B00G/Room+6/Ceiling Structures/Linings/S3 |                  |     |            | Chrysotile (white asbestos) , Amosite (brown asbestos) |         |                    |

**B00G - R0003 - Home Base**

No Asbestos

**B00G - R0004 - Staff Room Annexe**

No Asbestos

**B00G - R0005 - Principal**

No Asbestos

**B00G - R0006 - Clerical/Printing**

No Asbestos

**B00G - R0007 - Clerical Office**

No Asbestos

**B00G - R0008 - Movement**

No Asbestos

**B00G - R0009 - Staff Toilet**

|  |                  |     |            |  |         |                    |
|--|------------------|-----|------------|--|---------|--------------------|
| Ceiling Structures/Linings                 | Flat AC Sheeting | 5m2 | Throughout | Good Condition (1)   | Low (1) | Low Priority (2-3) |
| 5694/B00G/R0012/Recently Modified Space/S9 |                  |     |            | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |         |                    |

**B00G - R0010 - Staff Kitchen**

No Asbestos

**B00G - R0011 - General Storeroom**

No Asbestos

**B00G - R0012 - Residential Laundry**


|             |  |     |            |                    |         |                    |
|-------------|--|-----|------------|--------------------|---------|--------------------|
| No Asbestos |  | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|-------------|--|-----|------------|--------------------|---------|--------------------|

**B00G - R0013 - External Movement**

No Asbestos

**B00G - R0014 - Movement**

No Asbestos

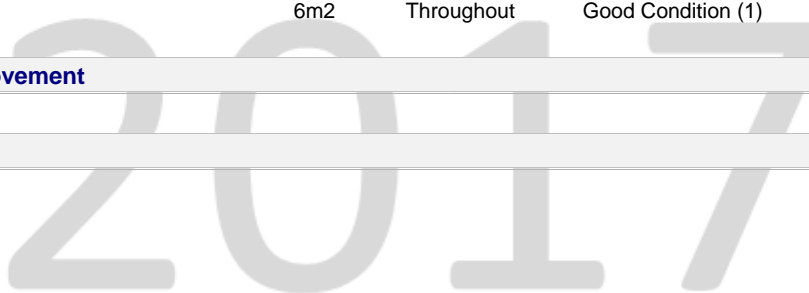



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00J - Dormitory - 1989 - Timber (Timber)**

**Exterior**

|                  |                             |      |            |                    |                                    |                    |
|------------------|-----------------------------|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Voids    | No Asbestos Found           |      |            |                    |                                    |                    |
| Underfloor voids | No Asbestos Found           |      |            |                    |                                    |                    |
| Wall Cladding    | Flat AC Sheeting            | 12m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|                  | 5694/B00J/Wall Cladding/S10 |      |            |                    | <b>Chrysotile (white asbestos)</b> |                    |

**Interior**

**B00J - R0001 - Dormitory**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00K - Dormitory - 1989 - Timber (Timber)**

**Exterior**

|                  |                             |      |            |                    |                                    |                    |
|------------------|-----------------------------|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Voids    | No Asbestos Found           |      |            |                    |                                    |                    |
| Underfloor Voids | No Asbestos Found           |      |            |                    |                                    |                    |
| Wall Cladding    | Flat AC Sheeting            | 12m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|                  | 5694/B00K/Wall Cladding/S11 |      |            |                    | <b>Chrysotile (white asbestos)</b> |                    |

**Interior**

**B00K - R0001 - Dormitory**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00L - Pupil Facilities - 1989 - Timber (Timber)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00L - R0001 - Disabled Toilet**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B000 - Dormitory - 1989 - Timber (Timber)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B000 - R0001 - Dormitory**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00P - Dormitory - 1989 - Timber (Timber)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00P - R0001 - Dormitory**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00Q - Communal Facilities - 1914 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

|                  |                                |       |            |                    |         |   |
|------------------|--------------------------------|-------|------------|--------------------|---------|---|
| Wall Cladding    | Flat AC Sheeting               | 200m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                  | 5694/B00Q/Wall Cladding/S7     |       |            |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Ceiling Voids    | No Asbestos Found              |       |            |                    |         |   |
| Underfloor Voids | AC Fragments/Debris            | 2m2   | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                  | 5694/B00Q/Underfloor Voids/S12 |       |            |                    |         | <b>Chrysotile (white asbestos)</b>                            |

**Interior**

**B00Q - R0001 - Communal Space**

|                       |  |       |            |                    |         |                                    |
|-----------------------|--|-------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting                         | 120m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                       | 5694/B00Q/R0001/Wall Linings Internal/S8 |       |            |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00Q - R0002 - Stage**

|                       |  |      |            |                    |         |                                    |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting                         | 22m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                       | 5694/B00Q/R0001/Wall Linings Internal/S8 |      |            |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00Q - R0003 - Hall Chair Store**

|                       |  |      |            |                    |         |                                    |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting                         | 34m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                       | 5694/B00Q/R0001/Wall Linings Internal/S8 |      |            |                    |         | <b>Chrysotile (white asbestos)</b> |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00U - Shed - 1950 - Fibre Clad Shed (Fibre Clad Shed)**

**Exterior**

|                  |                            |      |            |                    |   |                    |
|------------------|----------------------------|------|------------|--------------------|---|--------------------|
| Wall Cladding    | Flat AC Sheeting           | 40m2 | Throughout | Good Condition (1) | Low (1)   | Low Priority (2-3) |
|                  | 5694/B00U/Wall Cladding/S1 |      |            |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |                    |
| Ceiling Voids    | No Asbestos Found          |      |            |                    |   |                    |
| Underfloor Voids | No Asbestos Found          |      |            |                    |   |                    |

**Interior**

**B00U - R0001 - General Storeroom**

|                       |                            |      |            |                    |   |                    |
|-----------------------|----------------------------|------|------------|--------------------|---|--------------------|
| Wall Linings Internal | Flat AC Sheeting           | 40m2 | Throughout | Good Condition (1) | Low (1)   | Low Priority (2-3) |
|                       | 5694/B00U/Wall Cladding/S1 |      |            |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |                    |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00W - Staff Facilities - 1960 - Brick/Block (Brick/Block)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00W - R0002 - Staff Toilet**

No Asbestos

**B00W - R0003 - Staff Toilet**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00X - Pupil Facilities - 1989 - Timber (Timber)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00X - R0001 - Toilets-Girls**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00Y - Pupil Facilities - 1989 - Timber (Timber)**

**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids

**Interior**

**B00Y - R0001 - Student Shower**

No Asbestos

**B00Y - R0002 - Student Shower**

No Asbestos

**B00Y - R0003 - Cleaning Distributed Store**

No Asbestos

**B00Y - R0004 - Student Shower**

No Asbestos

**B00Y - R0005 - Student Shower**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00Z - Pupil Facilities - 1989 - Timber (Timber)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00Z - R0001 - Toilets-Boys**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B0AA - Staff Facilities - 2011 - Steel (Steel)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B0AA - R0001 - Other**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

**NS 350 - D10771 - Dormitory Toilet/Shower : Placement Date - 14/02/2011**

### Exterior

No Asbestos Found.

### Interior

#### R1 - Entry

No Asbestos Found.

#### R2 - Senior Dormitory

No Asbestos Found.

#### R3 - Senior Dormitory

No Asbestos Found.

#### R4 - Shower/Toilet

No Asbestos Found.

#### R5 - Store

No Asbestos Found.

**OS 601 - D14403 - Learning Unit - Standard/Withdrawal : Placement Date - 22/10/1996**

### Exterior

|             |                     |                  |          |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2  |
| Landing     | Compressed AC Sheet | Assumed Asbestos | 1.2 m2   |
| Eave Lining | Flat AC Sheet       | Assumed Asbestos | 11.52 m2 |

### Interior

#### R1 - Entry

|                |               |                  |       |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos | 8 m2  |

#### R2 - General Learning Space

|                |               |                  |       |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos | 55 m2 |

#### R3 - Store

|         |               |                  |       |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 10 m2 |
|---------|---------------|------------------|-------|

# 2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

5694\_ASB\_231112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017