


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Garah Public School (1956)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Moree Plains

Initial Survey : Noel Arnold & Associates : 15 - May - 2008
Reviewed By : Grencap-NAA : 04 - May - 2016

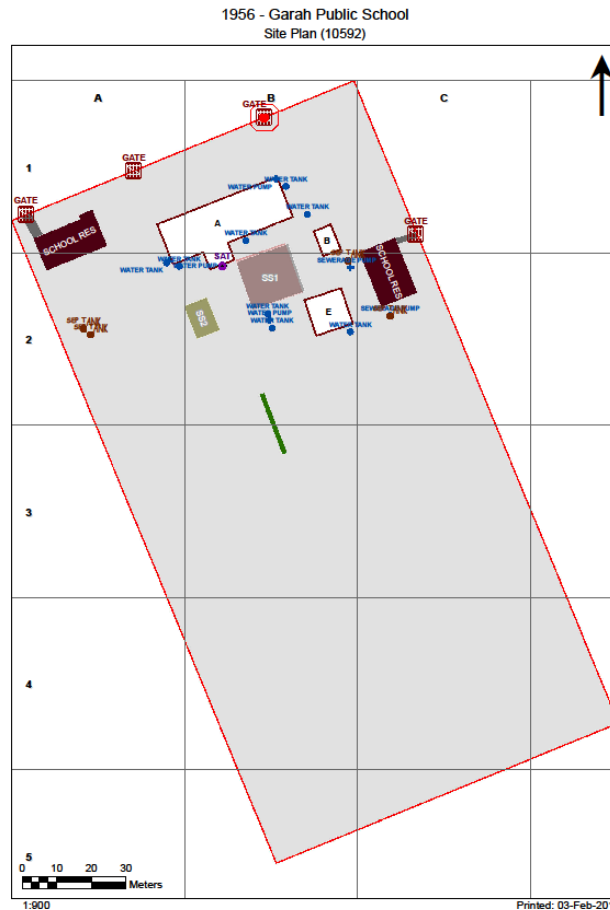

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1983 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting 1956/B00A/Wall Cladding/S1					No Asbestos Detected
Electrical Backing Board	Resinous Board 1956/B00A/Electrical Backing Board/S5					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - height - 3.6 meters					

Interior**B00A - M0001 - Reading Area**

No Asbestos

B00A - R0001 - Clerical Office/Workroom

Floor Coverings Res/Textile	Vinyl Sheet 1956/B00A/R0016/Floor Coverings Res/Textile/S3					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

B00A - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet 1956/B00A/R0016/Floor Coverings Res/Textile/S3					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

B00A - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1956/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1956/B00A/Wall Cladding/S1					No Asbestos Detected

B00A - R0005 - Cleaning Supplies

Floor Coverings Res/Textile	Vinyl Sheet 1956/B00A/R0016/Floor Coverings Res/Textile/S3					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

B00A - R0006 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1956/B00A/R0016/Wall Linings Internal/S2	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (White asbestos)

B00A - R0007 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting 1956/B00A/R0016/Wall Linings Internal/S2	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (White asbestos)

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Staff Room

No Asbestos

B00A - R0010 - Principal

No Asbestos

B00A - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1956/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1956/B00A/Wall Cladding/S1					No Asbestos Detected

B00A - R0012 - Practical Activities - 1hb

No Asbestos

B00A - R0013 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00A/R0016/Wall Linings Internal/S2					Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	1956/B00A/R0016/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00A - R0014 - Sick Bay						
No Asbestos						
B00A - R0015 - Home Base						
No Asbestos						
B00A - R0016 - Reading Area						
Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00A/R0016/Wall Linings Internal/S2					Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	1956/B00A/R0016/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00A - R0017 - Home Base						
No Asbestos						
B00A - R0018 - Practical Activities - 1hb						
No Asbestos						
B00A - R0019 - Home Base Store						
No Asbestos						
B00A - R0020 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
	1956/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	1956/B00A/Wall Cladding/S1					No Asbestos Detected
B00A - R0021 - Canteen						
Floor Coverings Res/Textile	Vinyl Sheet					
	1956/B00A/R0016/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00A/R0021/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
B00A - R0022 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
	1956/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	1956/B00A/Wall Cladding/S1					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00B/Eaves Linings/S6					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00B - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00B/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00B/R0003/Partition Walls (Cubicles)/S4					Chrysotile (White asbestos)

B00B - R0002 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00B/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00B - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00B/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1956/B00B/R0003/Partition Walls (Cubicles)/S4					Chrysotile (White asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities/Building Services - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - Garden Store

No Asbestos

B00E - R0002 - Sports Store

No Asbestos

B00E - R0003 - General Storeroom

No Asbestos

B00E - R0004 - Covered Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017