


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Goulburn North Public School (2055)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Goulburn Mulwaree

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Grencap-NAA : 25 - Aug - 2016

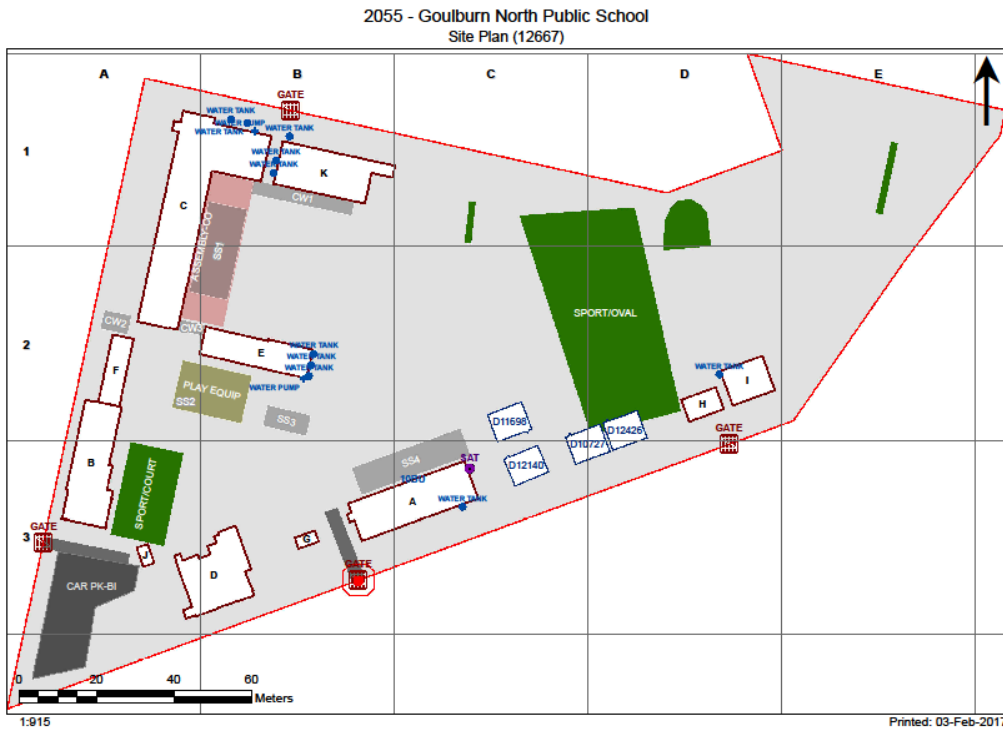

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Communal Facilities/Staff Facilities - 1886 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2055/B00E/R0005/Ceiling Structures/Linings/S7	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Wall Cladding	Flat AC Sheeting 2055/B00G/Wall Cladding/S1	6m2	Adjacent to Room 0007 external door	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Underfloor Voids	Flat AC Sheeting 2055/B00A/Underfloor Voids/S9					No Asbestos Detected

Interior

B00A - R0001 - P.E. Store						
No Asbestos						
B00A - R0002 - General Storeroom						
No Asbestos						
B00A - R0003 - Hall Chair Store						
No Asbestos						
B00A - R0004 - Music Store						
No Asbestos						
B00A - R0005 - Communal Space						
No Asbestos						
B00A - R0006 - Raised Platform						
No Asbestos						
B00A - R0007 - Movement						
No Asbestos						
B00A - R0008 - Distribution Board					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting 2055/B00A/R0008/Wall Linings Internal/S8					No Asbestos Detected
B00A - R0009 - General Storeroom						
No Asbestos						
B00A - R0011 - Cleaning Distributed Store						
No Asbestos						
B00A - R0014 - Staff Room Annexe						
No Asbestos						
B00A - R0015 - Movement						
No Asbestos						
B00A - R0016 - Toilet - Lobby						
No Asbestos						
B00A - R0017 - Staff Toilet						
No Asbestos						
B00A - R0018 - Staff Toilet						
No Asbestos						
B00A - R0019 - Toilet - Lobby						
No Asbestos						
B00A - R0020 - Staff Room						
No Asbestos						
B00A - R0021 - Staff Kitchen						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1889 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible

Interior

B00B - R0001 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2055/B00B/R0005/Floor Coverings Res/Textile/S3	No Asbestos Detected
-----------------------------	---	-----------------------------

B00B - R0002 - Personal Effects Storage

No Asbestos

B00B - R0003 - Deputy Principal

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 2055/B00B/R0005/Floor Coverings Res/Textile/S3	No Asbestos Detected
-----------------------------	---	-----------------------------

B00B - R0006 - Home Base

No Asbestos

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - General Storeroom

No Asbestos

B00B - R0009 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1962 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
In-fill-panel	Compressed AC Sheet	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00C/In-fill-panel/S6					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 2055/B00D/R0001/Wall Linings Internal/S2					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting	16m	South & East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00C/Gable Verge Lining/S12					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior

B00C - R0002 - Withdrawal Space - 1hb

No Asbestos

B00C - R0004 - Personal Effects Storage

No Asbestos

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - Personal Effects Storage

No Asbestos

B00C - R0008 - Movement

No Asbestos

B00C - R0009 - Cleaning Distributed Store

No Asbestos

B00C - R0010 - General Storeroom

No Asbestos

B00C - R0011 - Personal Effects Storage

No Asbestos

B00C - R0012 - Home Base

No Asbestos

B00C - R0013 - Home Base

No Asbestos

B00C - R0014 - Personal Effects Storage

No Asbestos

B00C - R0015 - Toilets - Boys/Girls

No Asbestos

B00C - R0016 - Sports Store

No Asbestos

B00C - R0017 - General Storeroom

No Asbestos

B00C - R0018 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00E/R0005/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0019 - Staff Room Annexe

No Asbestos

B00C - R0020 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R0021 - General Storeroom

No Asbestos

B00C - R0022 - Movement

No Asbestos

B00C - R0023 - General Storeroom

No Asbestos

B00C - R0024 - Movement

No Asbestos

B00C - R0025 - Personal Effects Storage

No Asbestos

B00C - R0026 - Home Base

No Asbestos

B00C - R0027 - Staff Toilet

No Asbestos

B00C - R0028 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	2055/B00C/R0028/Floor Coverings Res/Textile/S10	No Asbestos Detected			
-----------------------------	---	---	-----------------------------	--	--	--

Floor Coverings Res/Textile	felt underlay	2055/B00C/R0028/Floor Coverings Res/Textile/S11	No Asbestos Detected			
-----------------------------	---------------	---	-----------------------------	--	--	--

Floor Coverings Res/Textile	Adhesive	2055/B00C/R0028/Floor Coverings Res/Textile/S16	No Asbestos Detected			
-----------------------------	----------	---	-----------------------------	--	--	--

B00C - R0029 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	2055/B00C/R0028/Floor Coverings Res/Textile/S10	No Asbestos Detected			
-----------------------------	---	---	-----------------------------	--	--	--

Floor Coverings Res/Textile	Felt underlay	2055/B00C/R0028/Floor Coverings Res/Textile/S11	No Asbestos Detected			
-----------------------------	---------------	---	-----------------------------	--	--	--

Floor Coverings Res/Textile	Adhesive	2055/B00C/R0028/Floor Coverings Res/Textile/S16	No Asbestos Detected			
-----------------------------	----------	---	-----------------------------	--	--	--

B00C - R0030 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00G/Wall Cladding/S1	Chrysotile (white asbestos) , Amosite (brown asbestos)				

B00C - R0031 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00E/R0005/Ceiling Structures/Linings/S7	Chrysotile (white asbestos) , Amosite (brown asbestos)				

In-fill-panel	Flat AC Sheeting	2m	Adjacent to Room0008	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00C/In-fill-panel/S6	Chrysotile (white asbestos)				

B00C - R0032 - Disabled Shower/Toilet

No Asbestos

B00C - R0033 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Administration - 1876 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	No Asbestos Found

Interior

B00D - R0001 - Movement

Wall Linings Internal	Flat AC Sheeting 2055/B00D/R0001/Wall Linings Internal/S2	No Asbestos Detected
-----------------------	--	-----------------------------

B00D - R0003 - Home Base

No Asbestos

B00D - R0004 - Home Base Store

No Asbestos

B00D - R0005 - Movement

No Asbestos

B00D - R0007 - Clerical Office

No Asbestos

B00D - R0008 - Sick Bay

No Asbestos

B00D - R0009 - Staff Shower/Change

No Asbestos

B00D - R0010 - Sick Bay - Shower/Toilet

No Asbestos

B00D - R0011 - General Storeroom

No Asbestos

B00D - R0012 - Security Store

No Asbestos

B00D - R0013 - Duplicating Workroom

No Asbestos

B00D - R0014 - Uniform Shop

No Asbestos

B00D - R0015 - Staff Toilet

No Asbestos

B00D - R0016 - Movement

No Asbestos

B00D - R0017 - Movement

No Asbestos

B00D - R0018 - Staff Kitchen

No Asbestos

B00D - R0019 - Movement

No Asbestos

B00D - R0020 - Movement

No Asbestos

B00D - R0021 - Principal

No Asbestos

B00D - R0023 - Movement

No Asbestos

B00D - R0024 - Interview

No Asbestos

B00D - R0025 - Interview

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00D - R0026 - Security Store

No Asbestos

B00D - R0027 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00E/R0005/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00E - R0001 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	4.08m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00E/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00E - R0002 - Canteen

No Asbestos

B00E - R0003 - Canteen Office/Store

No Asbestos

B00E - R0004 - Movement

No Asbestos

B00E - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00E/R0005/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0006 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	27.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2055/B00E/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00E - R0007 - Sports Store

No Asbestos

B00E - R0008 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2055/B00E/R0008/Partition Walls (Cubicles)/S14					

B00E - R0009 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2055/B00E/R0008/Partition Walls (Cubicles)/S14					

B00E - R0010 - Staff Toilet

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1917 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists
 Non Accessible Area
 - Area inaccessible

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Area inaccessible

Interior

B00F - R0001 - Cleaning Distributed Store

No Asbestos

B00F - R0002 - Kiln Room

No Asbestos

B00F - R0003 - Toilets - Girls

Partition Walls (Cubicles) Compressed AC Sheet
 2055/B00F/R0003/Partition Walls (Cubicles)/S4 **No Asbestos Detected**

B00F - R0004 - Staff Toilet

No Asbestos

B00F - R0005 - General Storeroom

No Asbestos

B00F - R0006 - Toilets - Boys

Partition Walls (Cubicles) Compressed AC Sheet
 2055/B00F/R0003/Partition Walls (Cubicles)/S4 **No Asbestos Detected**

B00F - R0007 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Shed - 1967 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Wall Cladding	Flat AC Sheeting	50m2	Throughout	Minimal Damage (2)	Medium (2)	Low Priority (2-3)
	2055/B00G/Wall Cladding/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00G - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2055/B00G/R0001/Wall Linings Internal/S15					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other-Regional Use - 1987 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00H - R0001 - Other - Regional Use

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Other-Community Use/Other-D.E.C. Admin - 1962 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

Interior

B00I - R0001 - Movement

No Asbestos

B00I - R0002 - Special Programs Room

No Asbestos

B00I - R0003 - Other - Regional Use

No Asbestos

B00I - R0004 - Other-Community Use

No Asbestos

B00I - R0005 - Other-Community Use

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Gable Ends	Flat AC Sheeting 2055/B00G/Wall Cladding/S1	5m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00J - R0001 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2055/B00G/Wall Cladding/S1	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0002 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2055/B00G/Wall Cladding/S1	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Library/Other - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00K - R0001 - External Movement

No Asbestos

B00K - R0002 - Reading Area

No Asbestos

B00K - R0003 - Library Office/Workroom

No Asbestos

B00K - R0004 - Communications Room

No Asbestos

B00K - R0005 - K.L.A. Store

No Asbestos

B00K - R0006 - Main Switch Board

No Asbestos

B00K - R0007 - Toilet - Lobby

No Asbestos

B00K - R0008 - Cleaning Distributed Store

No Asbestos

B00K - R0009 - Staff Toilet

No Asbestos

B00K - R0010 - Canteen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10727 - Learning Unit - Standard/Withdrawal : Placement Date - 25/07/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D11698 - Learning Unit - Standard With P.A.A. : Placement Date - 30/06/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12140 - Learning Unit - Standard With P.A.A. : Placement Date - 30/10/2014

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 602 - D12426 - Learning Unit - Standard With P.A.A. : Placement Date - 31/05/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017