


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gloucester Public School (7303)
Region : North Coast
State Electorate : Upper Hunter
Local Government Area : Gloucester

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Oct - 2015

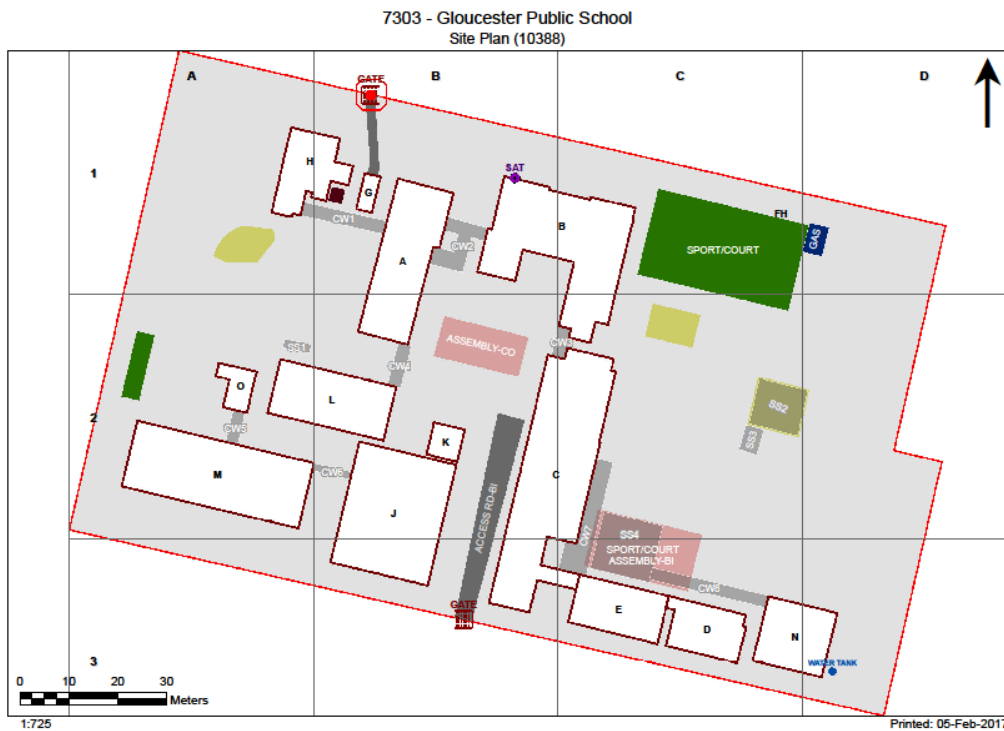

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00A/Eaves Linings/S17					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00A - R0001 - Principal**

No Asbestos

B00A - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00A/R0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0004 - Entry Vestibule

No Asbestos

B00A - R0006 - Deputy Principal

No Asbestos

B00A - R0007 - Duplicating Workroom

No Asbestos

B00A - R0008 - Disabled Toilet

No Asbestos

B00A - R0009 - Staff Toilet

No Asbestos

B00A - R0017 - Home Base Store

No Asbestos

B00A - R0019 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00A/R0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0020 - Home Base

No Asbestos

B00A - R0021 - Duplicating Workroom

No Asbestos

B00A - R0022 - General Storeroom

No Asbestos

B00A - R0023 - Movement

Wall Linings Internal	Flat AC Sheeting	2m2	Behind electrical doors	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00A/R0023/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
Door backing	Flat AC Sheeting	4m2	Behind electrical doors	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00A/R0023/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0024 - Toilets-Disabled

No Asbestos

B00A - R0025 - Sick Bay

Ceiling Hatch Infill Panel	Flat AC Sheeting					
	7303/B00A/R0025/Ceiling Hatch Infill Panel/S21					No Asbestos Detected

B00A - R0026 - Clerical Office

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R0027 - Communications Room

No Asbestos

B00A - R0028 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1908 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00B - R0001 - Craft Store

No Asbestos

B00B - R0002 - Craft Store

No Asbestos

B00B - R0003 - External Movement

No Asbestos

B00B - R0004 - Personal Effects Storage

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7303/B00B/R0006/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Withdrawal Space - 2hb

Wall Linings Internal	Compressed AC Sheet	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7303/B00B/R0009/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Ceiling Structures/Linings	Compressed AC Sheet	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7303/B00B/R0009/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0010 - Withdrawal Space - 2hb

No Asbestos

B00B - R0011 - Home Base

No Asbestos

B00B - R0012 - Personal Effects Storage

No Asbestos

B00B - R0013 - Movement

No Asbestos

B00B - R0014 - Home Base

No Asbestos

B00B - R0015 - Movement

No Asbestos

B00B - R0016 - Home Base

No Asbestos

B00B - R0017 - General Storeroom

No Asbestos

B00B - R0018 - General Storeroom

No Asbestos

B00B - R0019 - Practical Activities - 2hb

No Asbestos

B00B - R0020 - Withdrawal Space - 2hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning/Pupil Facilities - 1956 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/Eaves Linings/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00C - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0004/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0005/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Compressed AC Sheet					No Asbestos Detected
	7303/B00C/R0001/Wall Linings Internal/S10					

B00C - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0004/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0005/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Compressed AC Sheet					No Asbestos Detected
	7303/B00C/R0001/Wall Linings Internal/S10					

B00C - R0003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0004/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0004/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0004/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0005/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0006 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0004/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00C/R0005/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0007 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R0008 - Personal Effects Storage

No Asbestos

B00C - R0009 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

7303/B00C/R0004/Ceiling Structures/Linings/S7

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0010 - Home Base Store

No Asbestos

B00C - R0011 - Practical Activities - 1hb

No Asbestos

B00C - R0021 - External Movement

No Asbestos

B00C - R0022 - Home Base

No Asbestos

B00C - R0023 - Practical Activities - 2hb

No Asbestos

B00C - R0024 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0025 - Home Base

No Asbestos

B00C - R0026 - Withdrawal Space - 1hb

No Asbestos

B00C - R0027 - Home Base Store

No Asbestos

B00C - R0028 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	
	7303/B00C/R0028/Wall Linings Internal/S9	

No Asbestos Detected

B00C - R0029 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Administration - 1956 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00D/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00D/Eaves Linings/S19				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

Interior**B00D - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00D/R0005/Ceiling Structures/Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Home Base

No Asbestos

B00D - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00D/R0005/Ceiling Structures/Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Administration - 1934 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7303/B00E/Eaves Linings/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00E - R0001 - External Movement

No Asbestos

B00E - R0008 - Withdrawal Space - 2hb

No Asbestos

B00E - R0009 - Home Base Store

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	7303/B00E/R0009/Wall Linings Internal/S11					

B00E - R0010 - Home Base

No Asbestos

B00E - R0011 - Practical Activities - 4hb

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	7303/B00E/R0009/Wall Linings Internal/S11					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - Administration - 1956 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00G - R0001 - General Assistant/Bulk Store

No Asbestos

B00G - R0002 - Garden Store

No Asbestos

B00G - R0003 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Staff Facilities/General Learning - 1908 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00H - R0001 - External Movement**

No Asbestos

B00H - R0002 - Seminar/Study

No Asbestos

B00H - R0003 - Movement

No Asbestos

B00H - R0004 - Seminar/Study

No Asbestos

B00H - R0005 - Seminar/Study

No Asbestos

B00H - R0006 - Staff Room

No Asbestos

B00H - R0007 - Shower/Change

Wall Linings Internal	Flat AC Sheeting					
	7303/B00H/R0007/Wall Linings Internal/S14					No Asbestos Detected

B00H - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	7303/B00H/R0008/Ceiling Structures/Linings/S15					No Asbestos Detected

B00H - R0009 - Staff Kitchen

No Asbestos

B00H - R0010 - Laundry - Type 2

Ceiling Structures/Linings	Flat AC Sheeting					
	7303/B00H/R0008/Ceiling Structures/Linings/S15					No Asbestos Detected

B00H - R0011 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting					
	7303/B00H/R0008/Ceiling Structures/Linings/S15					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00J - Communal Facilities/Pupil Facilities - 1999 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - External Movement

No Asbestos

B00J - R0002 - Toilets - Girls

No Asbestos

B00J - R0003 - Plant

No Asbestos

B00J - R0004 - Cleaning Distributed Store

No Asbestos

B00J - R0005 - General Assistant/Bulk Store

No Asbestos

B00J - R0006 - P.E. Store

No Asbestos

B00J - R0007 - Garden Store

No Asbestos

B00J - R0008 - Cleaning Supplies

No Asbestos

B00J - R0009 - External Movement

No Asbestos

B00J - R0010 - Movement

No Asbestos

B00J - R0011 - Lift

No Asbestos

B00J - R0012 - Raised Platform

No Asbestos

B00J - R0013 - Movement

No Asbestos

B00J - R0014 - Communal Space

No Asbestos

B00J - R0015 - Sports Store

No Asbestos

B00J - R0016 - Hall Chair Store

No Asbestos

B00J - R0017 - Toilets - Boys

No Asbestos

B00J - R0018 - Disabled Toilet

No Asbestos

B00J - R0019 - Main Switch Board

No Asbestos

B00J - R0020 - Sports Store

No Asbestos

B00J - R0021 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Canteen Office/Store

No Asbestos

B00K - R0002 - Canteen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 1999 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00L - R0001 - External Movement**

No Asbestos

B00L - R0002 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0003 - Communications Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0004 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 1999 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00M - R0001 - External Movement**

No Asbestos

B00M - R0002 - Personal Effects Storage

No Asbestos

B00M - R0003 - Practical Activities - 1hb

No Asbestos

B00M - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0005 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0006 - Outdoor Learning Area

No Asbestos

B00M - R0007 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0008 - Outdoor Learning Area

No Asbestos

B00M - R0009 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0010 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0011 - Practical Activities - 1hb

No Asbestos

B00M - R0012 - Personal Effects Storage

No Asbestos

B00M - R0013 - Personal Effects Storage

No Asbestos

B00M - R0014 - Practical Activities - 1hb

No Asbestos

B00M - R0015 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0016 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0017 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0018 - Outdoor Learning Area

No Asbestos

B00M - R0019 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0020 - Outdoor Learning Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00M - R0021 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R0022 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R0023 - Practical Activities - 1hb						
No Asbestos						
B00M - R0024 - Personal Effects Storage						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - General Learning/Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00N - R0001 - External Movement

No Asbestos

B00N - R0002 - No Access

No Asbestos

B00N - R0003 - Special Programs Store

No Asbestos

B00N - R0004 - Special Programs Room

No Asbestos

B00N - R0005 - Withdrawal Space - 1hb

No Asbestos

B00N - R0006 - Home Base Store

No Asbestos

B00N - R0007 - Home Base

No Asbestos

B00N - R0008 - Practical Activities/Movement - 1hb

No Asbestos

B00N - R0009 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning/Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B000 - R0001 - External Movement

No Asbestos

B000 - R0002 - Special Programs Room

No Asbestos

B000 - R0003 - Special Programs Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Walkway between buildings A and B

Exterior

No Asbestos

Interior

Build+1 - Room+1 - Walkway

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

7303/Build+1/Room+1/Ceiling Structures/Linings/S1

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+2 - Added Building

Exterior

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+3 - Added Building

Exterior

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017