


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kincumber Public School (2304)
Region : Hunter/Central Coast
State Electorate : Terrigal
Local Government Area : Gosford

Initial Survey : Noel Arnold & Associates : 21 - Mar - 2008
Reviewed By : AECOM : 29 - Jun - 2016

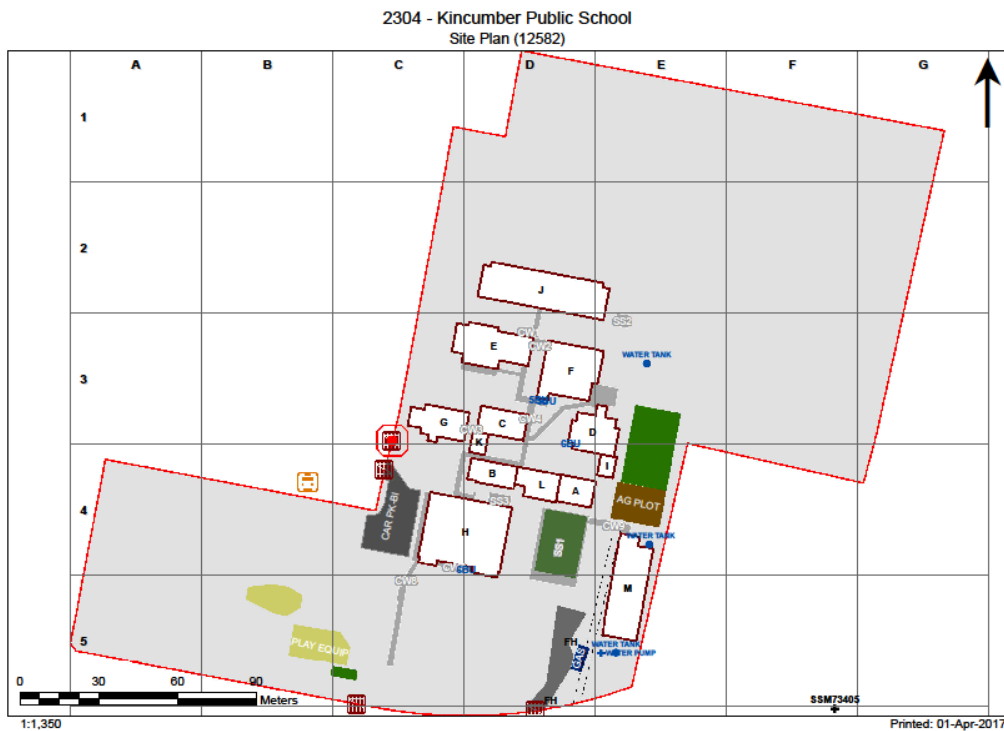

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1975 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void entrance located.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00A/R0007/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Gable verge lining	Compressed AC Sheet	20m	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00C/Gable verge lining/S34				Chrysotile (white asbestos)	
In-fill panels below windows	Flat AC Sheeting 2304/B00A/R0007/In-fill panels below windows/S13 No Asbestos Detected					
In-fill panels above windows	Flat AC Sheeting	4m2	South facing, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00A/R0007/In-fill panels above windows/S14				Chrysotile (white asbestos)	

Interior**B00A - R0001 - Home Base (56.99 m2)**

No Asbestos

B00A - R0002 - Home Base Store (7.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00A/R0004/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)	

B00A - R0003 - Distribution Board (0.25 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

Wall Linings Internal	Flat AC Sheeting	6m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00A/R0003/Wall Linings Internal/S16				Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00A/R0003/Wall Linings Internal/S16				Chrysotile (white asbestos)	

B00A - R0004 - Personal Effects Storage (6.24 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00A/R0004/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)	

B00A - R0005 - Staff Room Annexe (14.77 m2)

No Asbestos

B00A - R0006 - Staff Room Annexe (13.18 m2)

No Asbestos

B00A - R0007 - Movement (22.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00A/R0007/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
In-fill panels below windows	Flat AC Sheeting 2304/B00A/R0007/In-fill panels below windows/S13 No Asbestos Detected					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
In-fill panels above windows	Flat AC Sheeting	12m2	South facing, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00A/R0007/In-fill panels above windows/S14				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration - 1870 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Flat Roof Non Accessible Area
- Height Restriction 4m.

Interior

B00B - R0001 - Staff Toilet (3.71 m2)

Wall Linings Internal Flat AC Sheeting
2304/B00B/R0001/Wall Linings Internal/S20 **No Asbestos Detected**

B00B - R0002 - Staff Kitchen (10.31 m2)

No Asbestos

B00B - R0003 - Staff Room (56.17 m2)

No Asbestos

B00B - R0004 - Movement (24.51 m2)

No Asbestos

B00B - R0005 - General Storeroom (11.15 m2)

No Asbestos

B00B - R0006 - Staff Room Annexe (15.64 m2)

No Asbestos

B00B - R0007 - Staff Room Annexe (24.39 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1975 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2304/B00C/Eaves Linings/S35	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Compressed AC Sheet 2304/B00C/Gable verge lining/S34	20m	East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Encapsulated Insulation material within unit 2304/B00C/Ceiling Voids/S36					No Asbestos Detected

Interior

B00C - R0001 - Practical Activities - 1hb (18.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles 2304/B00C/R0001/Floor Coverings Res/Textile/S22	19m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	---------------	--------------------	---------	--

B00C - R0002 - Home Base (50.32 m2)

No Asbestos

B00C - R0003 - Home Base (50.8 m2)

No Asbestos

B00C - R0004 - Practical Activities - 1hb (19.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles 2304/B00C/R0001/Floor Coverings Res/Textile/S22	20m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	---------------	--------------------	---------	--

B00C - R0005 - Movement (35.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2304/B00C/R0005/Ceiling Structures/Linings/S23	36m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	---------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2304/B00C/Eaves Linings/S35	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Compressed AC Sheet 2304/B00C/Gable verge lining/S34	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Encapsulated Insulation material within unit 2304/B00C/Ceiling Voids/S36					No Asbestos Detected

Interior**B00D - R0001 - Practical Activities - 1hb (13.36 m2)**

Ceiling Structures/Linings	Vermiculite 2304/B00D/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0002 - Home Base (56 m2)

Ceiling Structures/Linings	Vermiculite 2304/B00D/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0003 - Home Base (56.16 m2)

Ceiling Structures/Linings	Vermiculite 2304/B00D/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0004 - Practical Activities - 1hb (13.36 m2)

Floor Coverings Res/Textile	Vinyl Sheet 2304/B00D/R0004/Floor Coverings Res/Textile/S8					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00D - R0005 - Movement (31.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2304/B00D/R0005/Ceiling Structures/Linings/S9	32m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	------	---------------	--------------------	---------	---

B00D - R0006 - Movement (44.32 m2)

No Asbestos

B00D - R0007 - Sports Store (3.51 m2)

No Asbestos

B00D - R1001 - Practical Activities - 1hb (18.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles 2304/B00D/R1001/Floor Coverings Res/Textile/S6	19m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	---------------	--------------------	---------	--

B00D - R1002 - Home Base (50.32 m2)

No Asbestos

B00D - R1003 - Home Base (50.4 m2)

No Asbestos

B00D - R1004 - Practical Activities - 1hb (18.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles 2304/B00D/R1001/Floor Coverings Res/Textile/S6	19m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	---------------	--------------------	---------	--

B00D - R1005 - Movement (45.34 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2304/B00D/R1005/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void entrance located.					
Eaves Linings	Flat AC Sheeting 2304/B00E/Eaves Linings/S33					No Asbestos Detected
Gable verge lining	Compressed AC Sheet 2304/B00E/Gable verge lining/S32					No Asbestos Detected

Interior**B00E - R0001 - Toilets - Boys (11.92 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 2304/B00E/R0001/Partition Walls (Cubicles)/S3					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00E - R0002 - Distribution Board (0.96 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0003 - Toilets - Girls (12.81 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 2304/B00E/R0001/Partition Walls (Cubicles)/S3					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00E - R0004 - Home Base Store (3.74 m2)

No Asbestos

B00E - R0005 - Cleaning Distributed Store (1.67 m2)

No Asbestos

B00E - R0006 - Home Base (61.49 m2)

No Asbestos

B00E - R0007 - Withdrawal Space - 1hb (8.45 m2)

No Asbestos

B00E - R0008 - Movement (47.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2304/B00E/R0008/Ceiling Structures/Linings/S1					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

Wall cladding	Compressed AC Sheet 2304/B00E/R0008/Wall Linings Internal/S2					No Asbestos Detected
---------------	---	--	--	--	--	-----------------------------

B00E - R0009 - Practical Activities - 1hb (54.43 m2)

No Asbestos

B00E - R0010 - Security Store (4.7 m2)

No Asbestos

B00E - R0011 - Home Base Store (4 m2)

No Asbestos

B00E - R0012 - Movement (8.18 m2)

No Asbestos

B00E - R0013 - Home Base (60.25 m2)

No Asbestos

B00E - R0014 - Home Base Store (3.46 m2)

No Asbestos

B00E - R0015 - Withdrawal Space - 1hb (8.37 m2)

No Asbestos

B00E - R0016 - Home Base (60.18 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 1985 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible no void entrance located.
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00F - R0001 - Library Office/Workroom (25.31 m2)

No Asbestos

B00F - R0002 - K.L.A. Store (10.72 m2)

No Asbestos

B00F - R0003 - Special Programs Room (40.2 m2)

No Asbestos

B00F - R0004 - Movement (2.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2304/B00F/R0004/Ceiling Structures/Linings/S25					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00F - R0005 - Distribution Board (1.73 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00D/R0005/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0006 - General Storeroom (2.6 m2)

No Asbestos

B00F - R0007 - Movement (10 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2304/B00F/R0007/Ceiling Structures/Linings/S24					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00F - R0009 - Movement (43.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2304/B00F/R0009/Ceiling Structures/Linings/S26					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00F - R0010 - Special Programs Room (44.94 m2)

No Asbestos

B00F - R0011 - External Movement (26.75 m2)

No Asbestos

B00F - R0012 - Reading Area (182.87 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Administration - 1986 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2304/B00G/Eaves Linings/S31					No Asbestos Detected

Interior

B00G - R0001 - Deputy Principal (12.82 m2)						
No Asbestos						
B00G - R0002 - Security Store (12.69 m2)						
No Asbestos						
B00G - R0003 - Principal (18.27 m2)						
No Asbestos						
B00G - R0004 - Security Store (10.32 m2)						
No Asbestos						
B00G - R0005 - Sick Bay (8.7 m2)						
No Asbestos						
B00G - R0006 - Distribution Board (0.44 m2)						Note: No inspection of live electrical installation.
No Asbestos						
B00G - R0007 - Duplicating Workroom (33.36 m2)						
No Asbestos						
B00G - R0008 - Clerical Office (12.54 m2)						
No Asbestos						
B00G - R0009 - Entry Vestibule (10.69 m2)						
No Asbestos						
B00G - R0010 - Movement (8.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2304/B00G/R0010/Ceiling Structures/Linings/S30					No Asbestos Detected
B00G - R0011 - Clerical Office/Workroom (12.66 m2)						
No Asbestos						
B00G - R0012 - Staff Toilet (6.22 m2)						
No Asbestos						
B00G - R0013 - Cleaning Distributed Store (2.27 m2)						
No Asbestos						
B00G - R0014 - Staff Toilet (6.24 m2)						
No Asbestos						
B00G - R0015 - Deputy Principal (12.66 m2)						
No Asbestos						
B00G - R0016 - Movement (35.19 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Communal Facilities - 1986 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction 5m
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00H - R0001 - Disabled Shower/Toilet (5.25 m2)**

No Asbestos

B00H - R0002 - Toilets - Boys (7.77 m2)

No Asbestos

B00H - R0003 - Movement (7.59 m2)

No Asbestos

B00H - R0004 - Shower/Change (2.44 m2)

No Asbestos

B00H - R0005 - Cleaning Supplies (1.92 m2)

No Asbestos

B00H - R0006 - Toilets - Girls (6.59 m2)

No Asbestos

B00H - R0007 - Movement (7.87 m2)

No Asbestos

B00H - R0008 - Shower/Change (2.4 m2)

No Asbestos

B00H - R0009 - Movement (18.62 m2)

Ceiling Structures/Linings Flat AC Sheeting
2304/B00H/R0009/Ceiling Structures/Linings/S29

No Asbestos Detected**B00H - R0010 - Movement (15.88 m2)**

No Asbestos

B00H - R0011 - Sports Store (16.94 m2)

No Asbestos

B00H - R0012 - Movement (26.72 m2)

Ceiling Structures/Linings Flat AC Sheeting
2304/B00H/R0012/Ceiling Structures/Linings/S28

No Asbestos Detected**B00H - R0013 - Garden Store (13.66 m2)**

No Asbestos

B00H - R0014 - Cleaning Supplies (12.78 m2)

No Asbestos

B00H - R0015 - Movement (12.35 m2)

Ceiling Structures/Linings Flat AC Sheeting
2304/B00H/R0009/Ceiling Structures/Linings/S29

No Asbestos Detected**B00H - R0016 - General Storeroom (9.44 m2)**

No Asbestos

B00H - R0017 - Movement (13.67 m2)

Ceiling Structures/Linings Flat AC Sheeting
2304/B00H/R0012/Ceiling Structures/Linings/S28

No Asbestos Detected**B00H - R0018 - Hall Chair Store (5.02 m2)**

No Asbestos

B00H - R0019 - Movement (4.9 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00H - R0020 - P.E. Store (4.97 m2)

No Asbestos

B00H - R0021 - General Storeroom (17.5 m2)

No Asbestos

B00H - R0022 - Distribution Board (1.28 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0023 - General Assistant/Bulk Store (19.28 m2)

No Asbestos

B00H - R0024 - Movement (17.02 m2)

No Asbestos

B00H - R0025 - Plant (0.63 m2)

No Asbestos

B00H - R0026 - Plant (0.68 m2)

No Asbestos

B00H - R0027 - Communal Space (200.13 m2)

No Asbestos

B00H - R0028 - Raised Platform (48.27 m2)

No Asbestos

B00H - R0029 - Movement (1.65 m2)

No Asbestos

B00H - R0030 - Canteen Office/Store (7.14 m2)

No Asbestos

B00H - R0031 - Canteen Office/Store (4.64 m2)

No Asbestos

B00H - R0032 - Canteen (49.05 m2)

No Asbestos

B00H - R0033 - Movement (194.99 m2)

Ceiling Structures/Linings Flat AC Sheeting
2304/B00H/R0033/Ceiling Structures/Linings/S27

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B001 - Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2304/B00C/Eaves Linings/S35	15m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Gable verge lining	Compressed AC Sheet 2304/B00C/Gable verge lining/S34	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Interior**B001 - R0001 - Toilets - Boys (12.46 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 2304/B001/R0003/Partition Walls (Cubicles)/S10	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2304/B001/R0003/Ceiling Structures/Linings/S11	13m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B001 - R0002 - Staff Toilet (6.21 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 2304/B001/R0003/Partition Walls (Cubicles)/S10	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2304/B001/R0003/Ceiling Structures/Linings/S11	7m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B001 - R0003 - Staff Toilet (6.21 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 2304/B001/R0003/Partition Walls (Cubicles)/S10	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2304/B001/R0003/Ceiling Structures/Linings/S11	7m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B001 - R0004 - Movement (15.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2304/B00D/R0005/Ceiling Structures/Linings/S9	16m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Height Restriction 4m

Underfloor Voids - Slab on Ground
Non Accessible Area
- Area inaccessible

Interior**B00J - R0001 - Cleaning Distributed Store (2.81 m2)**

Wall Linings Internal Flat AC Sheeting
2304/B00J/R0023/Wall Linings Internal/S4
No Asbestos Detected

B00J - R0002 - Kiln Room (5.98 m2)

Wall Linings Internal Flat AC Sheeting
2304/B00J/R0023/Wall Linings Internal/S4
No Asbestos Detected

B00J - R0003 - Staff Shower/Change (9 m2)

Wall Linings Internal Flat AC Sheeting
2304/B00J/R0023/Wall Linings Internal/S4
No Asbestos Detected

B00J - R0004 - Home Base Store (6.39 m2)

No Asbestos

B00J - R0005 - Withdrawal Space - 1hb (5.38 m2)

No Asbestos

B00J - R0006 - Movement (5.04 m2)

No Asbestos

B00J - R0007 - Home Base (57.56 m2)

No Asbestos

B00J - R0008 - Practical Activities - 1hb (21.4 m2)

No Asbestos

B00J - R0009 - Practical Activities - 1hb (21.4 m2)

No Asbestos

B00J - R0010 - Home Base (57.57 m2)

No Asbestos

B00J - R0011 - Movement (4.69 m2)

No Asbestos

B00J - R0012 - Withdrawal Space - 1hb (11.13 m2)

No Asbestos

B00J - R0013 - Home Base Store (5.92 m2)

No Asbestos

B00J - R0014 - Distribution Board (0.65 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0015 - Home Base Store (5.85 m2)

No Asbestos

B00J - R0016 - Practical Activities - 1hb (21.4 m2)

No Asbestos

B00J - R0017 - Home Base (57.56 m2)

No Asbestos

B00J - R0018 - Practical Activities - 1hb (21.4 m2)

No Asbestos

B00J - R0019 - Home Base (57.57 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R0020 - Movement (6.18 m2)						
No Asbestos						
B00J - R0021 - Withdrawal Space - 1hb (5.44 m2)						
No Asbestos						
B00J - R0022 - Home Base Store (6.27 m2)						
No Asbestos						
B00J - R0023 - Toilets - Girls (10.79 m2)						
Wall Linings Internal	Flat AC Sheeting					
			2304/B00J/R0023/Wall Linings Internal/S4			No Asbestos Detected
B00J - R0024 - Toilets - Boys (9.4 m2)						
Wall Linings Internal	Flat AC Sheeting					
			2304/B00J/R0023/Wall Linings Internal/S4			No Asbestos Detected
B00J - R0025 - Movement (198.75 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2304/B00C/Eaves Linings/S35	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior

B00K - R0001 - Toilets - Boys (11.49 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 2304/B00E/R0001/Partition Walls (Cubicles)/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2304/B00C/Eaves Linings/S35	12m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00K - R0002 - Toilets - Girls (13.66 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 2304/B00E/R0001/Partition Walls (Cubicles)/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2304/B00C/Eaves Linings/S35	14m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00K - R0003 - Movement (15.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2304/B00K/R0003/Ceiling Structures/Linings/S21	16m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	---------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00L/R0004/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	
Gable verge lining	Compressed AC Sheet	15m	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00C/Gable verge lining/S34				Chrysotile (white asbestos)	

Interior

B00L - R0001 - Movement (29.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00L/R0005/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

B00L - R0002 - Main Switch Board (9.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00L/R0005/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	-------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00L - R0003 - Toilets - Girls (30.33 m2)

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00L/R0004/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00L/R0004/Partition Walls (Cubicles)/S18				Chrysotile (white asbestos)	


B00L - R0004 - Toilets - Boys (30.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00L/R0004/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00L/R0004/Partition Walls (Cubicles)/S18				Chrysotile (white asbestos)	

B00L - R0005 - Movement (47.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2304/B00L/R0005/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

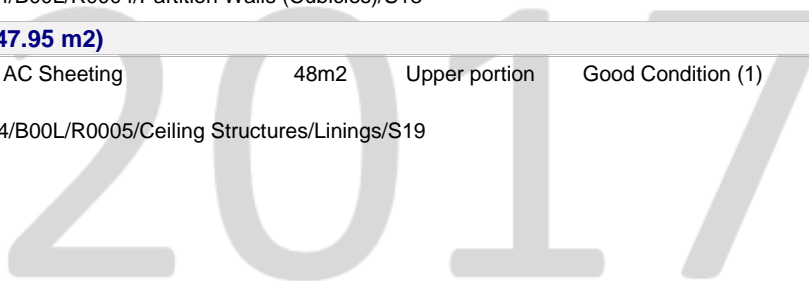

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Practical Activities - 1hb (14.24 m2)	No Asbestos
B00M - R0002 - Personal Effects Storage (4.73 m2)	No Asbestos
B00M - R0003 - Home Base Store (6.16 m2)	No Asbestos
B00M - R0004 - Home Base (60.37 m2)	No Asbestos
B00M - R0005 - Withdrawal Space - 2hb (11.7 m2)	No Asbestos
B00M - R0006 - Practical Activities - 1hb (14.2 m2)	No Asbestos
B00M - R0007 - Personal Effects Storage (3.96 m2)	No Asbestos
B00M - R0008 - Home Base Store (6.16 m2)	No Asbestos
B00M - R0009 - Home Base (60.37 m2)	No Asbestos
B00M - R0010 - Practical Activities - 1hb (15.5 m2)	No Asbestos
B00M - R0011 - Personal Effects Storage (3.54 m2)	No Asbestos
B00M - R0012 - Home Base Store (6.04 m2)	No Asbestos
B00M - R0013 - Withdrawal Space - 1hb (9.27 m2)	No Asbestos
B00M - R0014 - Home Base (58.68 m2)	No Asbestos
B00M - R0015 - Movement (6.91 m2)	No Asbestos
B00M - R0016 - Special Programs Store (12.81 m2)	No Asbestos
B00M - R0017 - Special Programs Room (42.34 m2)	No Asbestos
B00M - R0018 - General Storeroom (9.64 m2)	No Asbestos
B00M - R0019 - General Storeroom (9.39 m2)	No Asbestos
B00M - R0020 - Distribution Board (0.33 m2)	No Asbestos
B00M - R0021 - External Movement (84.38 m2)	No Asbestos

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	B00M - R0022 - Stairs (5.77 m2)					
	No Asbestos					
	B00M - R0023 - Stairs (5.64 m2)					
	No Asbestos					
	B00M - R1001 - Practical Activities - 1hb (14.16 m2)					
	No Asbestos					
	B00M - R1002 - Personal Effects Storage (4.68 m2)					
	No Asbestos					
	B00M - R1003 - Home Base Store (6.08 m2)					
	No Asbestos					
	B00M - R1004 - Home Base (60.13 m2)					
	No Asbestos					
	B00M - R1005 - Withdrawal Space - 2hb (11.54 m2)					
	No Asbestos					
	B00M - R1006 - Practical Activities - 1hb (14.16 m2)					
	No Asbestos					
	B00M - R1007 - Personal Effects Storage (4.06 m2)					
	No Asbestos					
	B00M - R1008 - Home Base Store (6.08 m2)					
	No Asbestos					
	B00M - R1009 - Home Base (60.13 m2)					
	No Asbestos					
	B00M - R1010 - Practical Activities - 1hb (17.32 m2)					
	No Asbestos					
	B00M - R1011 - Personal Effects Storage (3.31 m2)					
	No Asbestos					
	B00M - R1012 - Withdrawal Space - 1hb (9.14 m2)					
	No Asbestos					
	B00M - R1013 - Home Base Store (5.92 m2)					
	No Asbestos					
	B00M - R1014 - Home Base (58.02 m2)					
	No Asbestos					
	B00M - R1015 - Distribution Board (0.38 m2)					Note: No inspection of live electrical installation.
	No Asbestos					
	B00M - R1016 - External Movement (77.93 m2)					
	No Asbestos					
	B00M - R1017 - External Stairs (18.81 m2)					
	No Asbestos					
	B00M - R1018 - External Stairs (17.77 m2)					
	No Asbestos					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2304_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017