


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kirrawee Public School (4075)
Region : Sydney
State Electorate : Miranda
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

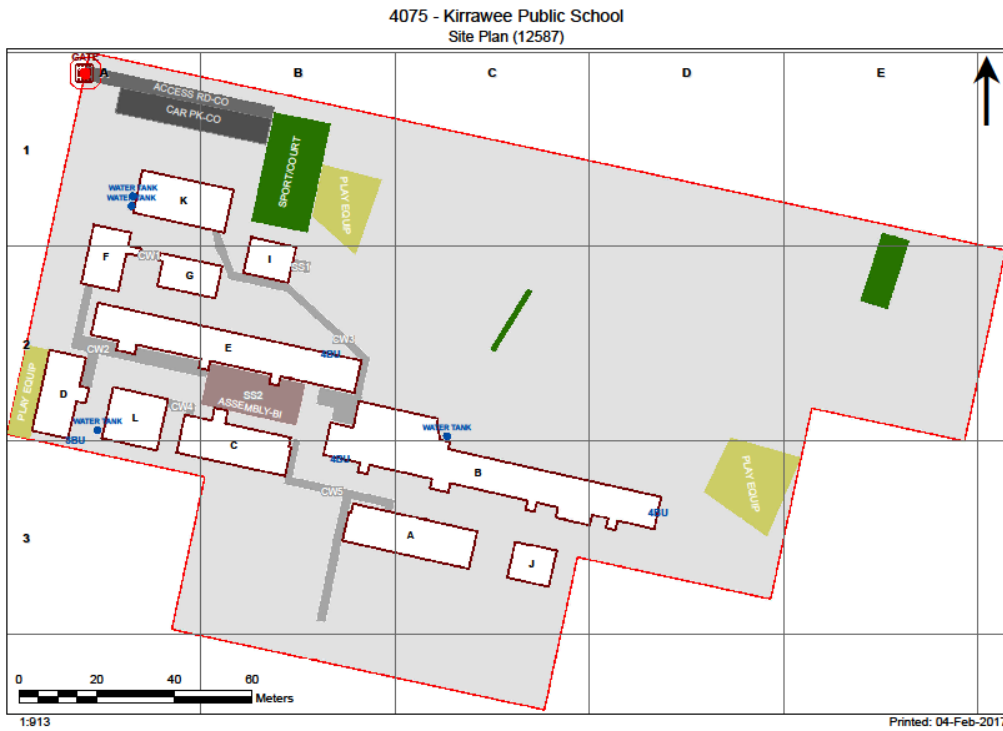

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1955 - Timber (Timber)**Exterior**

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4075/B00A/Underfloor Voids/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4075/B00A/Underfloor Voids/S24			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior**B00A - R0001 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces, Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4075/B00A/R0001/Floor Coverings Res/Textile/S8					

B00A - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0003 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces, Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0004 - Home Base

Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces, Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0006 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R0007 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	4075/B00A/R0001/Floor Coverings Res/Textile/S8			No Asbestos Detected		
B00A - R0008 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0010 - Toilets - Boys/Girls						
Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces, Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0011 - Shower/Change						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0012 - Access Shower/Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0013 - Staff Kitchen						
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable verge linings	Flat AC Sheeting 4075/B00B/Gable verge linings/S16					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 4075/B00B/Eaves Linings/S11					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior

B00B - R0001 - Toilets - Boys

No Asbestos

B00B - R0002 - Toilets - Girls

No Asbestos

B00B - R0003 - Home Base Store

No Asbestos

B00B - R0004 - Personal Effects Storage

No Asbestos

B00B - R0005 - Movement

No Asbestos

B00B - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00B/R0029/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Home Base Store

No Asbestos

B00B - R0010 - Personal Effects Storage

No Asbestos

B00B - R0011 - Movement

No Asbestos

B00B - R0012 - Withdrawal Space - 1hb

No Asbestos

B00B - R0013 - Personal Effects Storage

No Asbestos

B00B - R0014 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00B/R0029/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0015 - Home Base

No Asbestos

B00B - R0016 - Home Base

No Asbestos

B00B - R0017 - Personal Effects Storage

No Asbestos

B00B - R0018 - Cleaning Distributed Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0019 - Staff Room Annexe						
No Asbestos						
B00B - R0020 - General Storeroom						
No Asbestos						
B00B - R0021 - Movement						
No Asbestos						
B00B - R0022 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B00B/R0029/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0023 - Movement						
No Asbestos						
B00B - R0024 - General Storeroom						
No Asbestos						
B00B - R0025 - Movement						
No Asbestos						
B00B - R0026 - Hall Chair Store						
No Asbestos						
B00B - R0027 - Raised Platform						
No Asbestos						
B00B - R0028 - Communal Space						
No Asbestos						
B00B - R0029 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B00B/R0029/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0030 - Distribution Board						
No Asbestos						
Note: No inspection of live electrical installation.						
B00B - R0031 - P.E. Store						
No Asbestos						
B00B - R0032 - Staff Kitchen						
No Asbestos						
B00B - R0034 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
4075/B00B/R0034/Ceiling Structures/Linings/S27				No Asbestos Detected		
B00B - R0035 - Plant						
No Asbestos						
B00B - R0036 - General Assistant/Bulk Store						
No Asbestos						
B00B - R0037 - General Assistant/Bulk Store						
No Asbestos						
B00B - R9001 - Staff Shower/Change						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B00B/R0029/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9002 - Staff Room						
Ceiling Structures/Linings	Flat AC Sheeting	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B00B/R0029/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9003 - Movement						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

No Asbestos

B00B - R9004 - Plant

Ceiling Structures/Linings	Flat AC Sheeting	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B00B/R0029/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R9005 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B00B/R0029/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R9006 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B00B/R0029/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1955 - Timber (Timber)

Exterior

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4075/B00C/Underfloor Voids/S21			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00C - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	88m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0002 - Reading Area

Wall Linings Internal	Flat AC Sheeting	8m2	South west corner middle and lower portion by heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00A/R0003/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0003 - Library Office/Workroom

No Asbestos

B00C - R0008 - General Storeroom

No Asbestos

B00C - R0009 - External Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1959 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4075/B00D/Eaves Linings/S12	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable verge linings	Flat AC Sheeting 4075/B00D/Gable verge linings/S17					No Asbestos Detected
Ceiling Void	AC Fragments/Debris 4075/B00D/Ceiling Void/S22	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Vinyl Tiles Debris 4075/B00D/Underfloor Voids/S26					No Asbestos Detected

Interior

B00D - R0001 - Home Base

No Asbestos

B00D - R0002 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles 4075/B00D/R0002/Floor Coverings Res/Textile/S9					No Asbestos Detected
--------------------------------	---	--	--	--	--	-----------------------------

B00D - R0003 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles 4075/B00D/R0002/Floor Coverings Res/Textile/S9					No Asbestos Detected
--------------------------------	---	--	--	--	--	-----------------------------

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4075/B00B/R0029/Ceiling Structures/Linings/S4	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0006 - Home Base


No Asbestos

B00D - R0008 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 4075/B00D/R0008/Ceiling Structures/Linings/S28	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0009 - Disabled Shower/Toilet

Ceiling Structures/Linings	Flat AC Sheeting 4075/B00D/R0008/Ceiling Structures/Linings/S28	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

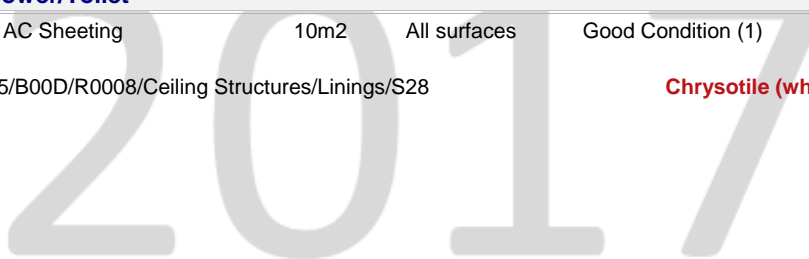

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Pupil Facilities - 1959 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4075/B00E/Eaves Linings/S13	100m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable verge linings	Flat AC Sheeting 4075/B00E/Gable verge linings/S18					No Asbestos Detected
Underfloor Voids	AC Fragments/Debris 4075/B00E/Underfloor Voids/S23	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base Store

No Asbestos

B00E - R0003 - Personal Effects Storage

No Asbestos

B00E - R0004 - Movement

No Asbestos

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - General Storeroom

No Asbestos

B00E - R0007 - Personal Effects Storage

No Asbestos

B00E - R0008 - Home Base

No Asbestos

B00E - R0009 - Home Base Store

No Asbestos

B00E - R0010 - Home Base

No Asbestos

B00E - R0011 - Home Base Store

No Asbestos

B00E - R0012 - Movement

No Asbestos

B00E - R0013 - Movement

No Asbestos

B00E - R0014 - General Storeroom

No Asbestos

B00E - R0015 - Communal Space

No Asbestos

B00E - R0016 - Home Base

No Asbestos

B00E - R0017 - Home Base Store

No Asbestos

B00E - R0018 - Movement

No Asbestos

B00E - R0019 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R0020 - Home Base Store

No Asbestos

B00E - R0021 - Home Base

No Asbestos

B00E - R0022 - Toilets - Girls

No Asbestos

B00E - R0023 - Toilets - Boys

No Asbestos

B00E - R0024 - Staff Toilet

No Asbestos

B00E - R0025 - Staff Toilet

No Asbestos

B00E - R9001 - General Assistant/Bulk Store

No Asbestos

B00E - R9002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00B/R0029/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00B/Room+1/Partition Walls (Cubicles)/S5			Chrysotile (white asbestos)		

B00E - R9003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00B/R0029/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00B/Room+1/Partition Walls (Cubicles)/S5			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Administration - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00F/Eaves Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	Vinyl Tiles Debris				No Asbestos Detected	
	4075/B00F/Underfloor Voids/S25					
Ceiling Void	No Asbestos Found					

Interior

B00F - R0001 - Principal

No Asbestos

B00F - R0002 - Movement

No Asbestos

B00F - R0003 - Staff Toilet

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00F/R0003/Partition Walls (Cubicles)/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0004 - Cleaning Distributed Store

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00F/R0003/Partition Walls (Cubicles)/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0005 - Staff Toilet

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00F/R0003/Partition Walls (Cubicles)/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0006 - General Storeroom

No Asbestos

B00F - R0007 - Sick Bay

No Asbestos

B00F - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00F/R0008/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0009 - Clerical Office/Workroom

No Asbestos

B00F - R0010 - General Storeroom

No Asbestos

B00F - R0011 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	8m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4075/B00F/R0003/Partition Walls (Cubicles)/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0012 - Uniform Shop

No Asbestos

B00F - R0013 - Interview

No Asbestos

B00F - R0014 - Deputy Principal

No Asbestos

B00F - R0015 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Staff Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4075/B00G/Eaves Linings/S15	52m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable verge linings	Flat AC Sheeting 4075/B00G/Gable verge linings/S19					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles 4075/B00G/R0001/Floor Coverings Res/Textile/S3					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00G - R0002 - Staff Room Annexe

No Asbestos

B00G - R0003 - General Storeroom

No Asbestos

B00G - R0004 - Movement

No Asbestos

B00G - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior**B001 - R0001 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B001/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0002 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B001/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0003 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B001/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0004 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B001/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0005 - Distribution Board

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B001/R0005/Ceiling Structures/Linings/S29				Chrysotile (white asbestos)		

Note: No inspection of live electrical installation.

B001 - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B001/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4075/B001/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0011 - Sports Store

No Asbestos

B001 - R0012 - General Storeroom

No Asbestos

B001 - R0013 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Communal Facilities - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00J - R0001 - Hall Chair Store

No Asbestos

B00J - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Library/General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00K - R0001 - Movement

No Asbestos

B00K - R0002 - Staff Toilet

No Asbestos

B00K - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0004 - Cleaning Distributed Store

No Asbestos

B00K - R0005 - Resource/Toy Space

No Asbestos

B00K - R0006 - Communications Room

No Asbestos

B00K - R0007 - Library Office/Workroom

No Asbestos

B00K - R0008 - Reading Area

No Asbestos

B00K - R0009 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning/Multi Purpose Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00L - R0001 - Home Base

No Asbestos

B00L - R0002 - Home Base Store

No Asbestos

B00L - R0003 - Practical Activities

No Asbestos

B00L - R0004 - Withdrawal Space - 1hb

No Asbestos

B00L - R0005 - External Movement

No Asbestos

B00L - R0006 - Special Programs Room

No Asbestos

B00L - R0007 - Home Base Store

No Asbestos

B00L - R0008 - Security Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4075_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017