


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lawrence Hargrave School (5632)
Region : South Western Sydney
State Electorate : Liverpool
Local Government Area : Liverpool

Initial Survey : Noel Arnold & Associates : 29 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

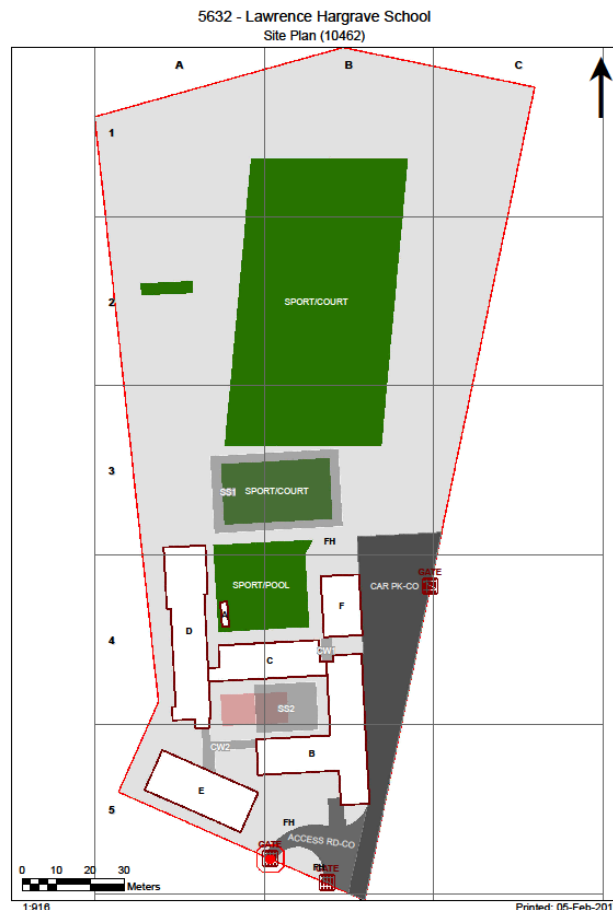

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Building Services - 1991 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
Eaves Linings	Flat AC Sheeting 5632/B00A/Eaves Linings/S12					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B00A - R0001 - Plant (4.64 m2)

No Asbestos

B00A - R0002 - General Storeroom (7.68 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration/Support Unit - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 5632/B00B/Eaves Linings/S13					No Asbestos Detected
Underfloor Voids	Non Accessible Area - No Access found to sub-floor					

Interior**B00B - R0001 - General Assistant/Bulk Store (8.56 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 5632/B00B/R0001/Ceiling Structures/Linings/S14	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0002 - Sports Store (18.95 m2)

No Asbestos

B00B - R0003 - Toilet - M (26.72 m2)

Ceiling Structures/Linings	Flat AC Sheeting 5632/B00B/R0003/Ceiling Structures/Linings/S8	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 5632/B00B/R0003/Wall Linings Internal/S9	5m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00B - R0004 - Shower/Change (24.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting 5632/B00B/R0003/Ceiling Structures/Linings/S8	4m2	Shower section	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 5632/B00B/R0003/Wall Linings Internal/S9	3m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00B - R0005 - Staff Room Annexe (7.09 m2)

Wall Linings Internal	Flat AC Sheeting 5632/B00B/R0003/Wall Linings Internal/S9	1m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 5632/B00B/R0005/Wall Linings Internal/S10	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00B - R0006 - Shower/Change (22.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting 5632/B00B/R0003/Ceiling Structures/Linings/S8	2m2	Shower Section	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 5632/B00B/R0006/Partition Walls (Cubicles)/S11					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 5632/B00B/R0003/Wall Linings Internal/S9	3m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00B - R0007 - Cleaning Supplies (6.95 m2)

Wall Linings Internal	Flat AC Sheeting 5632/B00B/R0003/Wall Linings Internal/S9	1m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00B - R0008 - Canteen (25.44 m2)

Wall Linings Internal	Flat AC Sheeting 5632/B00B/R0003/Wall Linings Internal/S9	3m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00B - R0009 - Canteen Office/Store (3.12 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R0010 - Canteen Office/Store (3.4 m2)

No Asbestos

B00B - R0011 - Distribution Board (0.82 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00B/R0003/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00B - R0012 - General Storeroom (19.15 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00B/R0003/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00B - R0014 - Movement (16.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00B/R0003/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00B - R0032 - Movement (96.39 m2)

Ceiling Structures/Linings	Flat AC Sheeting	97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00B/R0003/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00B - R0033 - Cleaning Distributed Store (2.11 m2)

Wall Linings Internal	Flat AC Sheeting	3m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00B/R0003/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00B - R0034 - Plant (1.64 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00B/R0003/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00B - R0035 - General Storeroom (11.6 m2)

No Asbestos

B00B - R0036 - Home Base (57.05 m2)

No Asbestos

B00B - R0037 - Withdrawal - M (26.87 m2)

No Asbestos

B00B - R0038 - General Storeroom (10.29 m2)

No Asbestos

B00B - R0039 - Home Base/Practical Activities (58.42 m2)

No Asbestos

B00B - R0040 - Distribution Board (0.91 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0041 - Practical Activities (100.35 m2)

No Asbestos

B00B - R0042 - General Storeroom (33.24 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library/Support Unit - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 5632/B00C/Eaves Linings/S15	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	AC Fragments/Debris 5632/B00C/Underfloor Voids/S16	15m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

Interior**B00C - R0001 - Movement (74.7 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 5632/B00C/R0001/Ceiling Structures/Linings/S4	75m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting 5632/B00C/R0006/Wall Linings Internal/S6	NA	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Clerical Error - No Sample Taken	
In-fill-panel	Flat AC Sheeting 5632/B00C/R0001/In-fill-panel/S7	22m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00C - R0002 - Staff Kitchen (15.01 m2)

No Asbestos

B00C - R0003 - Laundry (12.71 m2)

No Asbestos

B00C - R0004 - Food/Research Space (79.56 m2)

No Asbestos

B00C - R0005 - Toilet - M (5.69 m2)

No Asbestos

B00C - R0006 - Toilet - M (26.92 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 5632/B00C/R0006/Partition Walls (Cubicles)/S5	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting 5632/B00C/R0001/Ceiling Structures/Linings/S4	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting 5632/B00C/R0006/Wall Linings Internal/S6	2m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Clerical Error - No Sample Taken	

B00C - R0007 - Distribution Board (0.75 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 5632/B00C/R0001/Ceiling Structures/Linings/S4	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00C - R0011 - Reading Area (66.09 m2)

No Asbestos

B00C - R0012 - K.L.A. Store (18.06 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Support Unit/Communal Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Awnings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5632/B00D/Awnings/S17					Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area - No Access found to Sub-floor					

Interior**B00D - R0001 - Communal Space (169.73 m2)**

No Asbestos

B00D - R0002 - General Storeroom (6.93 m2)

No Asbestos

B00D - R0003 - Movement (79.67 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	5632/B00D/R0008/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0004 - Home Base - M (56.65 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	5632/B00D/R0008/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0005 - Home Base - M (56.81 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	5632/B00D/R0008/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0006 - Home Base - M (56.49 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	5632/B00D/R0008/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0007 - Home Base - M (55.41 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	5632/B00D/R0008/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0008 - Distribution Board (0.44 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	5632/B00D/R0008/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0010 - Staff Room Annexe (18.77 m2)

No Asbestos

B00D - R0011 - General Storeroom (12.25 m2)

No Asbestos

B00D - R0012 - External Movement (11.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11.08m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	5632/B00D/R0012/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00D - R0013 - Stairs (5.52 m2)

No Asbestos

B00D - R0014 - Stairs (4.73 m2)

No Asbestos

B00D - R1001 - Security Store (10.92 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1002 - Movement (88.58 m2)						
Wall Linings Internal	Flat AC Sheeting	14m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00D/R1003/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00D - R1003 - Home Base - M (56.81 m2)						
Wall Linings Internal	Flat AC Sheeting	3m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00D/R1003/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00D - R1004 - Home Base - M (56.52 m2)						
Wall Linings Internal	Flat AC Sheeting	3m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00D/R1003/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00D - R1005 - Home Base - M (56.59 m2)						
Wall Linings Internal	Flat AC Sheeting	3m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00D/R1003/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00D - R1006 - Home Base - M (55.29 m2)						
Wall Linings Internal	Flat AC Sheeting	3m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5632/B00D/R1003/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00D - R1007 - Distribution Board (0.43 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00D - R1008 - Toilet - M (3.69 m2)						
No Asbestos						
B00D - R1009 - Cleaning Distributed Store (3.24 m2)						
No Asbestos						
B00D - R1010 - Cleaning Distributed Store (3.71 m2)						
No Asbestos						
B00D - R1011 - Stairs (6.06 m2)						
No Asbestos						
B00D - R1012 - Stairs (5.83 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00E - Administration - 2008 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00E - R0001 - Entry Vestibule (16.89 m2)**

No Asbestos

B00E - R0002 - Movement (40.08 m2)

No Asbestos

B00E - R0003 - Clerical Office (27.24 m2)

No Asbestos

B00E - R0004 - Clerical/Printing (23.83 m2)

No Asbestos

B00E - R0005 - Sick Bay (11.07 m2)

No Asbestos

B00E - R0006 - Cleaning Distributed Store (2.7 m2)

No Asbestos

B00E - R0007 - Access Shower/Toilet (5.21 m2)

No Asbestos

B00E - R0008 - Main Switch Board (2.15 m2)

No Asbestos

B00E - R0009 - Staff Toilet (4.89 m2)

No Asbestos

B00E - R0010 - Staff Toilet (4.93 m2)

No Asbestos

B00E - R0011 - Staff Toilet (4.89 m2)

No Asbestos

B00E - R0012 - Security Store (14.36 m2)

No Asbestos

B00E - R0013 - Staff Room Annexe (19.39 m2)

No Asbestos

B00E - R0014 - Staff Room (64.76 m2)

No Asbestos

B00E - R0015 - Deputy Principal (11.53 m2)

No Asbestos

B00E - R0016 - Principal (17.27 m2)

No Asbestos

B00E - R0017 - Interview/Office - Type 3 (16.97 m2)

No Asbestos

B00E - R0018 - Interview (13.23 m2)

No Asbestos

B00E - R0019 - External Stairs (5.99 m2)

No Asbestos

B00E - R0020 - External Movement (54.85 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Music/Special Purpose (Craft Art Science Tas) - 2008 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Practical Activities (60.3 m2)

No Asbestos

B00F - R0002 - Kiln Room (5.88 m2)

No Asbestos

B00F - R0003 - General Storeroom (9.1 m2)

No Asbestos

B00F - R0004 - General Storeroom (8.87 m2)

No Asbestos

B00F - R0005 - Practical Activities (61.04 m2)

No Asbestos

B00F - R0006 - Distribution Board (0.52 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0007 - External Movement (42.72 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017