


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Picnic Point Public School (4342)  
**Region :** South Western Sydney  
**State Electorate :** East Hills  
**Local Government Area :** Bankstown

**Initial Survey :** Noel Arnold & Associates : 29 - Apr - 2008  
**Register Issue Date :** 23 - Mar - 2017

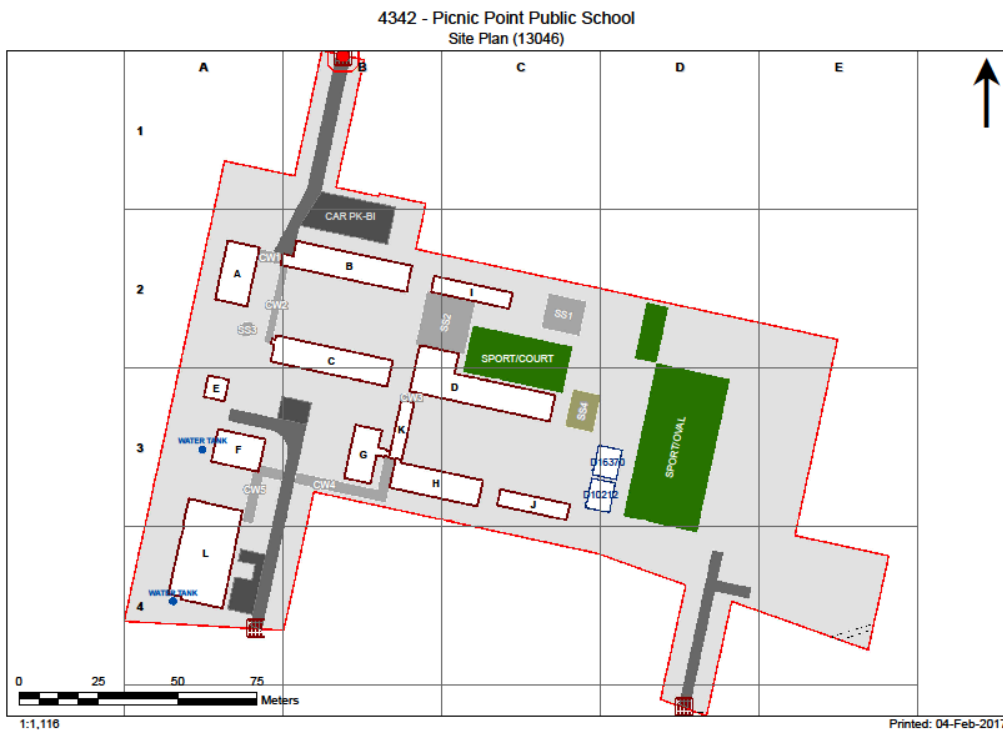

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1962 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior****B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00A/R0001/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>

**B00A - R0002 - Entry Vestibule**

No Asbestos

**B00A - R0003 - Clerical Office**

No Asbestos

**B00A - R0004 - General Storeroom**

No Asbestos

**B00A - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

Wall Linings Internal	Compressed AC Sheet	3m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00A/R0005/Wall Linings Internal/S6					<b>Chrysotile (white asbestos)</b>

**B00A - R0006 - Movement**

No Asbestos

**B00A - R0007 - Sick Bay**

Wall Linings Internal	Flat AC Sheeting	12m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00A/R0007/Wall Linings Internal/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0008 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	6m2	Cubicle wall panels	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00A/R0007/Wall Linings Internal/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0009 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	12m2	Cubicle wall panels	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00A/R0007/Wall Linings Internal/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0010 - Duplicating Workroom**

No Asbestos

**B00A - R0011 - Cleaning Distributed Store**

No Asbestos

**B00A - R0012 - Staff Room**

No Asbestos

**B00A - R0013 - Deputy Principal**

No Asbestos

**B00A - R0014 - General Storeroom**

No Asbestos

**B00A - R0015 - Movement**

No Asbestos

**B00A - R0016 - Principal**

No Asbestos

**B00A - R0017 - General Storeroom**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1962 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00B - R0001 - Special Programs Room**

No Asbestos

**B00B - R0002 - Home Base Store**

No Asbestos

**B00B - R0003 - Hall Chair Store**

No Asbestos

**B00B - R0004 - Movement**

No Asbestos

**B00B - R0005 - Cleaning Distributed Store**

No Asbestos

**B00B - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4342/B00B/R0019/Ceiling Structures/Linings/S16			<b>No Asbestos Detected</b>
----------------------------	------------------	--	--	--	-----------------------------

**B00B - R0007 - General Storeroom**

No Asbestos

**B00B - R0008 - Home Base**

No Asbestos

**B00B - R0009 - Home Base Store**

No Asbestos

**B00B - R0010 - Home Base**

No Asbestos

**B00B - R0011 - Home Base Store**

No Asbestos

**B00B - R0012 - Personal Effects Storage**

No Asbestos

**B00B - R0013 - Movement**

No Asbestos

**B00B - R0014 - General Storeroom**

No Asbestos

**B00B - R0015 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4342/B00B/R0019/Ceiling Structures/Linings/S16			<b>No Asbestos Detected</b>
----------------------------	------------------	--	--	--	-----------------------------

**B00B - R0016 - General Storeroom**

No Asbestos

**B00B - R0017 - Home Base**

No Asbestos

**B00B - R0018 - Home Base Store**

No Asbestos

**B00B - R0019 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4342/B00B/R0019/Ceiling Structures/Linings/S16			<b>No Asbestos Detected</b>
----------------------------	------------------	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1962 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00C - R0001 - Home Base**

No Asbestos

**B00C - R0002 - Home Base Store**

No Asbestos

**B00C - R0003 - Personal Effects Storage**

No Asbestos

**B00C - R0004 - Movement**

No Asbestos

**B00C - R0005 - General Storeroom**

No Asbestos

**B00C - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4342/B00C/R0015/Ceiling Structures/Linings/S10			<b>No Asbestos Detected</b>	
----------------------------	------------------	--	--	--	-----------------------------	--

**B00C - R0007 - General Storeroom**

No Asbestos

**B00C - R0008 - Home Base**

No Asbestos

**B00C - R0009 - Home Base Store**

No Asbestos

**B00C - R0010 - Home Base**

No Asbestos

**B00C - R0011 - Home Base Store**

No Asbestos

**B00C - R0012 - Personal Effects Storage**

No Asbestos

**B00C - R0013 - Movement**

No Asbestos

**B00C - R0014 - General Storeroom**

No Asbestos

**B00C - R0015 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4342/B00C/R0015/Ceiling Structures/Linings/S10			<b>No Asbestos Detected</b>	
----------------------------	------------------	--	--	--	-----------------------------	--

**B00C - R0016 - General Storeroom**

No Asbestos

**B00C - R0017 - Home Base**

No Asbestos

**B00C - R0018 - Home Base Store**

No Asbestos

**B00C - R0019 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1962 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00D - R0003 - Personal Effects Storage**

No Asbestos

**B00D - R0004 - Movement**

No Asbestos

**B00D - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00D/R0005/Ceiling Structures/Linings/S17					<b>No Asbestos Detected</b>

**B00D - R0006 - Home Base**

No Asbestos

**B00D - R0007 - Home Base**

No Asbestos

**B00D - R0009 - Movement**

No Asbestos

**B00D - R0010 - General Storeroom**

No Asbestos

**B00D - R0011 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00D/R0005/Ceiling Structures/Linings/S17					<b>No Asbestos Detected</b>

**B00D - R0012 - General Storeroom**

No Asbestos

**B00D - R0014 - Home Base**

No Asbestos

**B00D - R0015 - Practical Activities - 1hb**

No Asbestos

**B00D - R0016 - Home Base**

No Asbestos

**B00D - R0017 - Toilets - Boys/Girls**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00D/R0018/Floor Coverings Res/Textile/S18					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	8m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00D/R0018/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>

**B00D - R0018 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00D/R0018/Floor Coverings Res/Textile/S18					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	8m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00D/R0018/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>

**B00D - R0019 - Personal Effects Storage**

No Asbestos

**B00D - R0020 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00D/R0005/Ceiling Structures/Linings/S17					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0021 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00D/R0005/Ceiling Structures/Linings/S17					<b>No Asbestos Detected</b>
<b>B00D - R0022 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00D - R9001 - Garden Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00D/R9001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1962 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	16m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00E/R0001/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

**B00E - R0002 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00E/R0001/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

**B00E - R0003 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00E/R0001/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

**B00E - R0004 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00E/R0001/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library - 1962 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Awnings	Flat AC Sheeting	10m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00F/R0003/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	6m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00F/R0003/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00F - R0002 - Movement**

No Asbestos

**B00F - R0003 - Reading Area**

No Asbestos

**B00F - R0004 - Library Office/Workroom**

No Asbestos

**B00F - R0005 - Music Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Administration/Pupil Facilities - 1962 - Brick/Veneer (Brick/Veneer)****Exterior**

In-fill-panel	Compressed AC Sheet	16m2	North, South, East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00G/In-fill-panel/S14					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior****B00G - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00G/R0001/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>

**B00G - R0010 - Staff Room Annexe**

No Asbestos

**B00G - R0011 - General Storeroom**

Non Accessible

**B00G - R0012 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00G/R0012/Wall Linings Internal/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00G - R0013 - Uniform Shop**

Floor Coverings Res/Textile	Vinyl Tiles					
	4342/B00G/R0013/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>

**B00G - R0014 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00G/R0001/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>

**B00G - R0015 - Withdrawal Space - 2hb**

No Asbestos

**B00G - R0016 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00G/R0001/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 1962 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00H - R0001 - Home Base**

No Asbestos

**B00H - R0002 - Personal Effects Storage**

No Asbestos

**B00H - R0003 - Movement**

No Asbestos

**B00H - R0004 - General Storeroom**

No Asbestos

**B00H - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00H/R0013/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>

**B00H - R0006 - General Storeroom**

No Asbestos

**B00H - R0007 - Personal Effects Storage**

No Asbestos

**B00H - R0008 - Home Base**

No Asbestos

**B00H - R0009 - Home Base**

No Asbestos

**B00H - R0010 - Personal Effects Storage**

No Asbestos

**B00H - R0011 - Movement**

No Asbestos

**B00H - R0012 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00H/R0013/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>

**B00H - R0013 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00H/R0013/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 1962 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-----	-------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

**Interior**

**B001 - R0001 - Handwashing Facilities**

No Asbestos

**B001 - R0002 - Toilets - Boys**

No Asbestos

**B001 - R0003 - Sports Store**

No Asbestos

**B001 - R0004 - Toilets - Girls**

No Asbestos

**B001 - R0005 - Handwashing Facilities**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities - 1962 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	14m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos</b>					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00J - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00J/R0001/Partition Walls (Cubicles)/S21					<b>Chrysotile (white asbestos)</b>

**B00J - R0002 - Handwashing Facilities**

No Asbestos

**B00J - R0003 - Cleaning Distributed Store**

No Asbestos

**B00J - R0004 - Hall Chair Store**

No Asbestos

**B00J - R0005 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4342/B00J/R0001/Partition Walls (Cubicles)/S21					<b>Chrysotile (white asbestos)</b>

**B00J - R0006 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 1999 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	No Asbestos Found					
---------------	-------------------	--	--	--	--	--

Underfloor Voids	Requires Inspection					
------------------	---------------------	--	--	--	--	--

**Interior**

**B00K - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00K/R0002/Ceiling Structures/Linings/S15					<b>No Asbestos Detected</b>

**B00K - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	4342/B00K/R0002/Ceiling Structures/Linings/S15					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00L - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00L - R0001 - Communal Space**

No Asbestos

**B00L - R0002 - Raised Platform**

No Asbestos

**B00L - R0003 - Hall Chair Store**

No Asbestos

**B00L - R0004 - Communal/Performance Store**

No Asbestos

**B00L - R0005 - P.E. Store**

No Asbestos

**B00L - R0006 - Toilet - Lobby**

No Asbestos

**B00L - R0007 - Toilets - Girls**

No Asbestos

**B00L - R0008 - Sound Cupboard**

No Asbestos

**B00L - R0009 - Toilet - Lobby**

No Asbestos

**B00L - R0010 - Toilets - Boys**

No Asbestos

**B00L - R0011 - Cleaning Distributed Store**

No Asbestos

**B00L - R0012 - Other**

No Asbestos

**B00L - R0013 - Main Switch Board**

No Asbestos

**B00L - R0014 - Access Shower/Toilet/Change**

No Asbestos

**B00L - R0015 - Covered Outdoor Learning Area**

No Asbestos

**B00L - R0016 - Canteen**

No Asbestos

**B00L - R0017 - Canteen Office/Store**

No Asbestos

**B00L - R0018 - Movement**

No Asbestos

**B00L - R0019 - Ramp**

No Asbestos

**B00L - R0020 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10212 - Learning Unit - Standard With P.A.A. : Placement Date - 22/08/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D16370 - Learning Unit - Standard With P.A.A. : Placement Date - 27/09/2013**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**There are no asbestos related file attachment(s) for this school.**

2017