

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wyalong Public School (3518)


Region : Riverina

State Electorate : Cootamundra

Local Government Area : Bland

Initial Survey : Noel Arnold & Associates : 07 - May - 2008

Reviewed By : Grencap-NAA : 01 - Mar - 2017

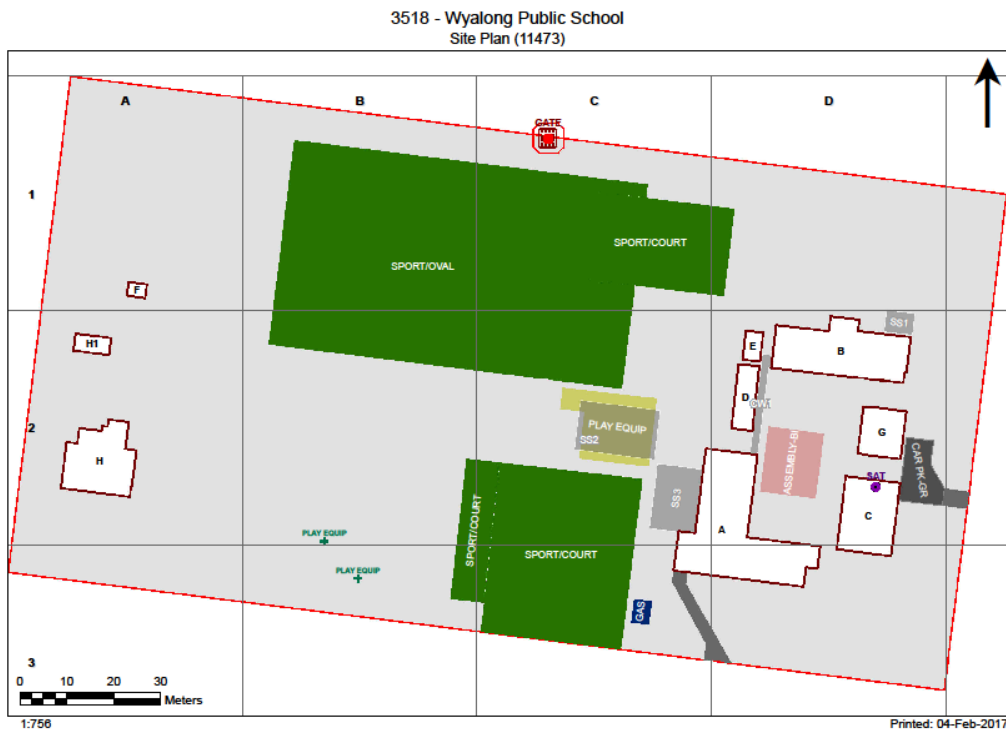

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1980 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3518/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3518/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	North facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3518/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00A - R0002 - Staff Room

No Asbestos

B00A - R0003 - Canteen

No Asbestos

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - General Storeroom

No Asbestos

B00A - R0006 - Disabled Toilet

No Asbestos

B00A - R0007 - Clerical Office

No Asbestos

B00A - R0008 - Sick Bay

No Asbestos

B00A - R0009 - Entry Vestibule

No Asbestos

B00A - R0010 - Principal

No Asbestos

B00A - R0011 - Security Store

No Asbestos

B00A - R0012 - Movement

No Asbestos

B00A - R0013 - Craft Store

No Asbestos

B00A - R0014 - Home Base Store

No Asbestos

B00A - R0015 - Withdrawal Space - 1hb

No Asbestos

B00A - R0016 - Home Base

No Asbestos

B00A - R0017 - Practical Activities - 1hb

No Asbestos

B00A - R0018 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0019 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R0020 - Home Base Store						
No Asbestos						
B00A - R0021 - Music Store						
No Asbestos						
B00A - R0022 - Movement						
Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1986 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3518/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Withdrawal Space - 1hb

No Asbestos

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Home Base

No Asbestos

B00B - R0004 - General Storeroom

No Asbestos

B00B - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3518/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00B - R0007 - Practical Activities - 1hb

No Asbestos

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Withdrawal Space - 1hb

No Asbestos

B00B - R0010 - Home Base Store

No Asbestos

B00B - R0011 - Cleaning Distributed Store

No Asbestos

B00B - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3518/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3518/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1950 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Reading Area

No Asbestos

B00C - R0003 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles					
	3518/B00C/R0003/Floor Coverings Res/Textile/S2					No Asbestos Detected

Floor Coverings Res/Textile	Adhesive					
	3518/B00C/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00C - R0004 - Security Store

No Asbestos

B00C - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	10m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3518/B00C/R0005/Wall Linings Internal/S1					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1980 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible

Interior

B00D - R0001 - Toilets - Boys

No Asbestos

B00D - R0002 - Drinking Facilities

No Asbestos

B00D - R0003 - Drinking Facilities

No Asbestos

B00D - R0004 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1980 - Timber Shed (Timber Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1980 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Multi Purpose Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - Communal Space

No Asbestos

B00G - R0002 - General Storeroom

No Asbestos

B00G - R0003 - Practical Activities

No Asbestos

B00G - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Residential Facilities - - Timber (Timber)**Exterior**

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior**B00H - R0001 - Residence - Movement**

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0002 - Residence - Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0003 - Residence - Bedroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0004 - Residence - Bedroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0005 - Residence - Lounge

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0006 - Residence - Living

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0007 - Residence - Other

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0008 - Residence - Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0009 - Residence - Bathroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0010 - Residence - Other

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0011 - Residence - Kitchen

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0012 - Residence - Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0013 - Residence - Toilet

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0014 - Residence - Laundry

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0015 - Residence - Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0H1 - Residential Facilities - - Fibre Clad Shed (Fibre Clad Shed)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B0H1 - R0001 - Residence - Garage

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017