


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Woollahra Public School (7442)
Region : Sydney
State Electorate : Vaucluse
Local Government Area : Woollahra

Initial Survey : Noel Arnold & Associates : 12 - Jun - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

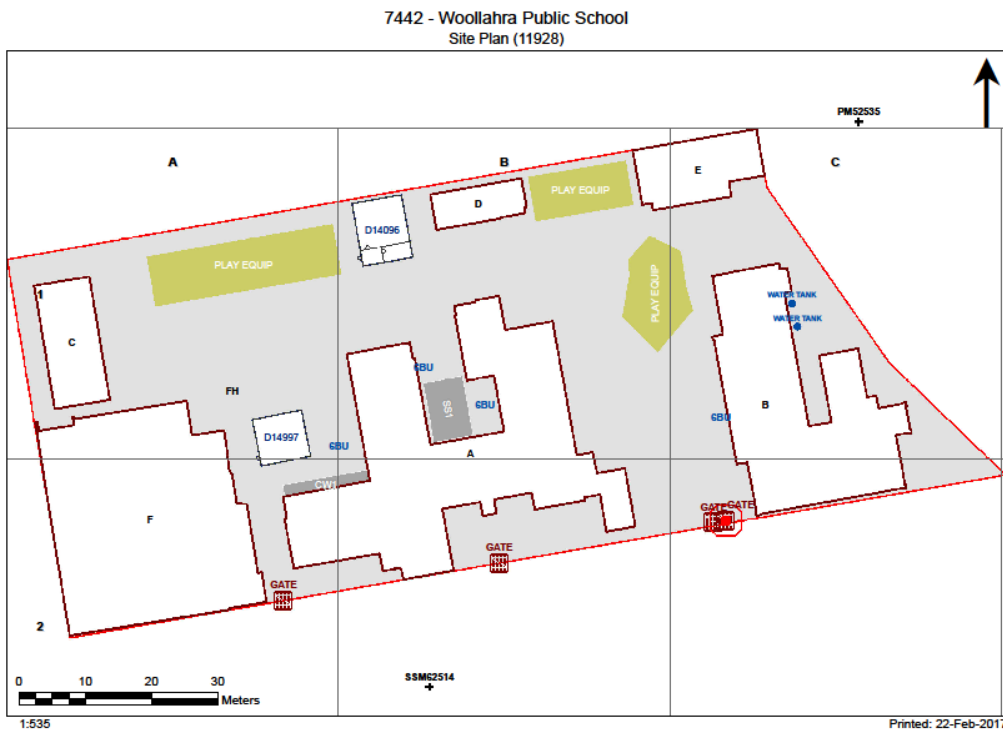

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - General Learning/Communal Facilities - 1877 - Brick/Block (Brick/Block)**Exterior**

| | |
|-----------------|-------------------|
| Ceiling Void | No Asbestos Found |
| Underfloor Void | No Asbestos Found |

Interior**B00A - M0001 - Movement**

No Asbestos

B00A - M0002 - Staff Room Annexe

No Asbestos

B00A - M0003 - Stairs

No Asbestos

B00A - M0004 - Stairs

No Asbestos

B00A - R0001 - External Movement

No Asbestos

B00A - R0002 - Staff Toilet

No Asbestos

B00A - R0003 - Staff Room Annexe

No Asbestos

B00A - R0004 - Craft Store

No Asbestos

B00A - R0005 - Practical Activities - 1hb

| | |
|---|-------------|
| Floor Coverings Res/Textile | Vinyl Tiles |
| 7442/B00A/R0012/Floor Coverings Res/Textile/S16 | |

No Asbestos Detected**B00A - R0006 - Home Base**

No Asbestos

B00A - R0007 - Home Base

No Asbestos

B00A - R0008 - Practical Activities - 1hb

| | |
|---|-------------|
| Floor Coverings Res/Textile | Vinyl Tiles |
| 7442/B00A/R0012/Floor Coverings Res/Textile/S16 | |

No Asbestos Detected**B00A - R0009 - Movement**

No Asbestos

B00A - R0010 - Clerical Office/Workroom

No Asbestos

B00A - R0011 - Cleaning Distributed Store

No Asbestos

B00A - R0012 - Movement

| | |
|---|-------------|
| Floor Coverings Res/Textile | Vinyl Tiles |
| 7442/B00A/R0012/Floor Coverings Res/Textile/S16 | |

No Asbestos Detected**B00A - R0013 - Home Base**

No Asbestos

B00A - R0014 - External Movement

No Asbestos

B00A - R0015 - Staff Room

| | |
|---|-------------|
| Floor Coverings Res/Textile | Vinyl Tiles |
| 7442/B00A/R0012/Floor Coverings Res/Textile/S16 | |

No Asbestos Detected**B00A - R0016 - External Movement**

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|---|--------|--------------------|--------------------|-------------|---|
| Sample No | | | | | Test Result | |
| No Asbestos | | | | | | |
| B00A - R0020 - Cleaning Distributed Store | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0021 - General Storeroom | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0022 - Staff Room Annexe | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0023 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0026 - P.E. Store | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 7442/B00A/R0012/Floor Coverings Res/Textile/S16 | | | | | No Asbestos Detected |
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00A/R0026/Ceiling Structures/Linings/S18 | | | | | Chrysotile (white asbestos) |
| B00A - R0029 - External Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 45m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00A/R0029/Ceiling Structures/Linings/S15 | | | | | Chrysotile (white asbestos) |
| B00A - R0030 - Canteen Covered Area | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0031 - External Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0032 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0033 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0034 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0035 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0036 - Withdrawal Space - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0037 - Toilet - Lobby | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00A/R0037/Ceiling Structures/Linings/S21 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| B00A - R0038 - Staff Toilet | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00A/R0037/Ceiling Structures/Linings/S21 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| B00A - R0039 - Special Programs Room | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0040 - General Storeroom | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00A - R0041 - Movement | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00A - R0042 - Duplicating Workroom | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00A - R0043 - Home Base | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |
| B00A - R0044 - Withdrawal Space - 1hb | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |
| B00A - R0045 - Movement | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |
| B00A - R1001 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1002 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1003 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1006 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1011 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1012 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1013 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1014 - Home Base | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |
| B00A - R1015 - Home Base | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |
| B00A - R1016 - Home Base | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |
| B00A - R1017 - Withdrawal Space - 1hb | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |
| B00A - R1018 - Movement | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |
| B00A - R1019 - Home Base | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |
| B00A - R1020 - Home Base | | | | | | |
| Recently Modified Space Requires Inspection | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00B - Administration/General Learning - 1887 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|------------------|---|------|------------------------------|--------------------|---------|---|
| Gable Ends | Flat AC Sheeting 7442/B00B/Gable Ends/S6 | 20m2 | North facing, East facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Void | Non Accessible Area - No access - Manhole over 5 metres high | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior**B00B - M1001 - Library Office/Workroom**

Recently Modified Space Requires Inspection

B00B - M1002 - Stairs

Recently Modified Space Requires Inspection

B00B - R0001 - Principal

| | | | | | | |
|-----------------------------|--|-----|--------------|--------------------|---------|------------------------------------|
| Ceiling air vent | Compressed AC Sheet 7442/B00B/R0001/Ceiling air vent/S9 | | | | | No Asbestos Detected |
| Floor Coverings Res/Textile | Vinyl Tiles 7442/B00B/R0001/Floor Coverings Res/Textile/S10 | 2m2 | South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00B - R0002 - Staff Toilet

No Asbestos

B00B - R0003 - Staff Toilet

No Asbestos

B00B - R0004 - Duplicating Workroom

No Asbestos

B00B - R0005 - Movement

No Asbestos

B00B - R0006 - Clerical Office

No Asbestos

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - Practical Activities - 1hb

No Asbestos

B00B - R0009 - Special Programs Room

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Home Base

No Asbestos

B00B - R0012 - Uniform Shop

No Asbestos

B00B - R0013 - Movement

No Asbestos

B00B - R0014 - Cleaning Distributed Store

No Asbestos

B00B - R0015 - External Movement

No Asbestos

B00B - R0016 - Toilets - Boys

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet 7442/B00B/R0016/Partition Walls (Cubicles)/S7 | | | | | No Asbestos Detected |
|----------------------------|--|--|--|--|--|-----------------------------|

B00B - R0017 - Toilets - Girls

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|---|--------------------|-------------|----------------------|
| Sample No | | | | | Test Result | |
| Partition Walls (Cubicles) | Compressed AC Sheet | | 7442/B00B/R0016/Partition Walls (Cubicles)/S7 | | | No Asbestos Detected |
| B00B - R0018 - Cleaning Distributed Store | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0019 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0020 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0021 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0022 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0023 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0024 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0025 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0026 - Main Switch Board | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1001 - Uniform Shop | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | 7442/B00B/R1006/Wall Linings Internal/S8 | | | No Asbestos Detected |
| B00B - R1002 - Staff Room Annexe | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1006 - Movement | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | 7442/B00B/R1006/Wall Linings Internal/S8 | | | No Asbestos Detected |
| B00B - R1008 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1010 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1011 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1012 - Practical Activities - 1hb | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1013 - Home Base | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1014 - Home Base | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1015 - Home Base | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1016 - Stairs | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1017 - Personal Effects Storage | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1018 - Communications Cupboard | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1019 - Staff Room | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1020 - Home Base | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|---|-------------|--------------------|
| Sample No | | | | | Test Result | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1021 - Duplicating Workroom | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1022 - General Storeroom | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R1023 - Stairs | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00B - R9001 - General Assistant/Bulk Store | | | | | | |
| No Asbestos | | | | | | |
| B00B - R9002 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 29m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 7442/B00B/R9002/Ceiling Structures/Linings/S11 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00B - R9003 - General Assistant/Bulk Store | | | | | | |
| No Asbestos | | | | | | |
| B00B - R9004 - Garden Store | | | | | | |
| No Asbestos | | | | | | |
| B00B - R9005 - Stairs | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 7442/B00B/R9005/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - General Learning - 1964 - Brick/Veneer (Brick/Veneer)**Exterior**

| | | | | | | |
|------------------|-----------------------------|------|-------------------------------|--------------------|---------|---|
| Eaves Linings | Flat AC Sheeting | 10m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00C/Eaves Linings/S19 | | | | | Chrysotile (white asbestos) |
| Gable Ends | Flat AC Sheeting | 10m2 | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00C/Gable Ends/S20 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| Ceiling Void | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior**B00C - R0001 - Home Base**

No Asbestos

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0003 - Cleaning Distributed Store

No Asbestos

B00C - R0004 - External Movement

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00C/R0004/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

B00C - R0005 - Craft Store

No Asbestos

B00C - R0006 - Movement

| | | | | | | |
|--------------------------------|--|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 7442/B00C/R0006/Floor Coverings Res/Textile/S2 | | | | | No Asbestos Detected |

B00C - R0007 - Personal Effects Storage

| | | | | | | |
|--------------------------------|--|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 7442/B00C/R0006/Floor Coverings Res/Textile/S2 | | | | | No Asbestos Detected |

B00C - R0008 - Home Base

No Asbestos

B00C - R0009 - Home Base Store

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - Pupil Facilities - 1990 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|-----------------------------------|----------------------------|------|---|--------------------|---------|------------------------------------|
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | 15m2 | North facing, South facing, East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00D/Eaves Linings/S1 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior**B00D - R0001 - Toilets - Boys**

| | | | | | | |
|----------------------------|---|------|-------------------------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting | 20m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00D/R0003/Ceiling Structures/Linings/S4 | | | | | Chrysotile (white asbestos) |
| Partition Walls (Cubicles) | Compressed AC Sheet | 6m2 | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00D/R0003/Partition Walls (Cubicles)/S5 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

B00D - R0002 - Drinking Facilities

| | | | | | | |
|----------------------------|----------------------------|-----|--------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00D/Eaves Linings/S1 | | | | | Chrysotile (white asbestos) |

B00D - R0003 - Toilets - Girls

| | | | | | | |
|----------------------------|---|------|-------------------------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting | 41m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00D/R0003/Ceiling Structures/Linings/S4 | | | | | Chrysotile (white asbestos) |
| Partition Walls (Cubicles) | Compressed AC Sheet | 12m2 | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 7442/B00D/R0003/Partition Walls (Cubicles)/S5 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - General Learning - 1923 - Brick/Block (Brick/Block)

Exterior

| | |
|-----------------|-------------------|
| Ceiling Void | No Asbestos Found |
| Underfloor Void | No Asbestos Found |

Interior

B00E - R0003 - Craft Store

No Asbestos

B00E - R0004 - Movement

No Asbestos

B00E - R0005 - Music Store

No Asbestos

B00E - R0006 - External Movement

No Asbestos

B00E - R0007 - External Movement

No Asbestos

B00E - R0008 - Stairs

No Asbestos

B00E - R0009 - Movement

No Asbestos

B00E - R0010 - Home Base

No Asbestos

B00E - R0011 - Home Base

No Asbestos

B00E - R0012 - Practical Activities

No Asbestos

B00E - R1001 - Home Base

No Asbestos

B00E - R1002 - Home Base

No Asbestos

B00E - R1003 - Personal Effects Storage

| | |
|-----------------------------|-------------|
| Floor Coverings Res/Textile | Vinyl Tiles |
|-----------------------------|-------------|

7442/B00E/R1003/Floor Coverings Res/Textile/S17

No Asbestos Detected

B00E - R1004 - Movement

No Asbestos

B00E - R1005 - Stairs

No Asbestos

B00E - R1006 - Movement

No Asbestos

B00E - R1007 - Movement

No Asbestos



| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

B00F - General Learning/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Covered Outdoor Learning Area

No Asbestos

B00F - R0002 - General Assistant/Bulk Store

No Asbestos

B00F - R0003 - Plant

No Asbestos

B00F - R0004 - External Stairs

No Asbestos

B00F - R0005 - Main Switch Board

No Asbestos

B00F - R0006 - Access Shower/Toilet/Change

No Asbestos

B00F - R0007 - Sports Store

No Asbestos

B00F - R0008 - External Movement

No Asbestos

B00F - R0009 - General Assistant/Bulk Store

No Asbestos

B00F - R0010 - Movement

No Asbestos

B00F - R0011 - Ramp

No Asbestos

B00F - R0012 - Raised Platform

No Asbestos

B00F - R0013 - Communal Space

No Asbestos

B00F - R0014 - Movement

No Asbestos

B00F - R0015 - Plant

No Asbestos

B00F - R0016 - Communal/Performance Store

No Asbestos

B00F - R0017 - P.E. Store

No Asbestos

B00F - R0018 - Chair Storeroom

No Asbestos

B00F - R0019 - Toilet - Lobby

No Asbestos

B00F - R0020 - Toilets - Girls

No Asbestos

B00F - R0021 - Cleaning Distributed Store

No Asbestos

B00F - R0022 - Toilet - Lobby

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |
| B00F - R0023 - Toilets - Boys | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0024 - Sound Cupboard | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0025 - Canteen Office/Store | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0026 - External Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0027 - Canteen | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1001 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1002 - Withdrawal Space - 2hb | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1003 - Home Base Store | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1004 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1005 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1006 - Home Base Store | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1007 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1008 - Withdrawal Space - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1009 - Home Base Store | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1010 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1011 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1012 - External Movement | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1013 - External Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00F - R1014 - External Stairs | | | | | | |
| No Asbestos | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D14096 - Learning Unit - Standard/Withdrawal : Placement Date - 21/10/2008

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 600 - D14997 - Learning Unit - Small : Placement Date - 27/04/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017