

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Glenfield Public School (2001)


Region : South Western Sydney

State Electorate : Macquarie Fields

Local Government Area : Campbelltown

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008

Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

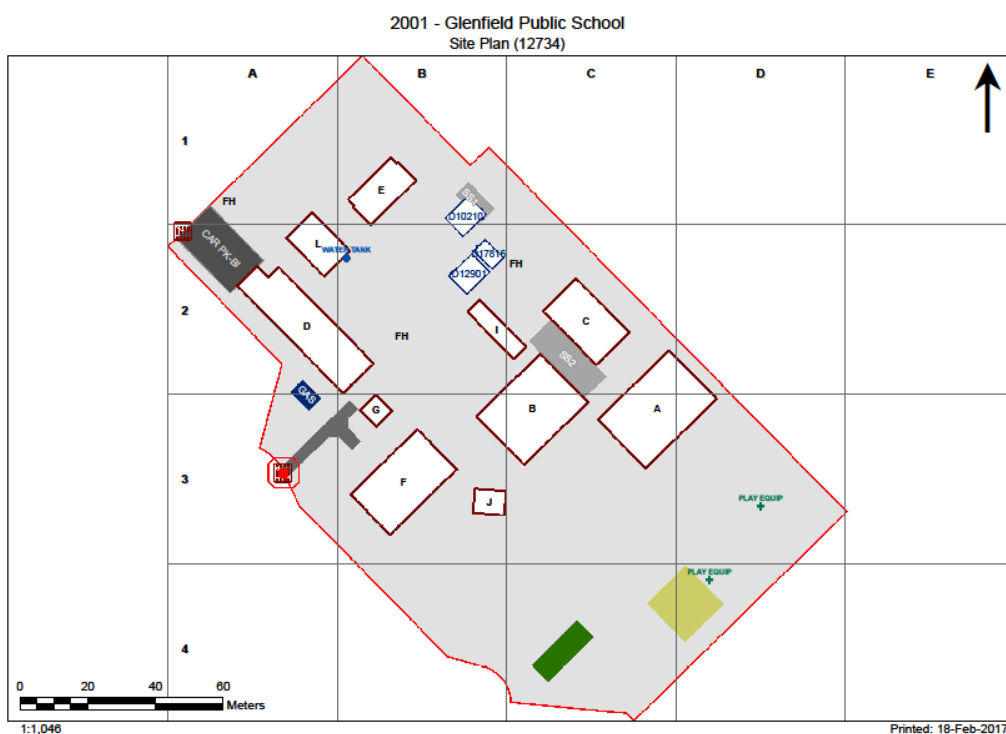

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible No voids
-----------------------------------	---

Ceiling Voids	No Asbestos Found
---------------	-------------------

Interior**B00A - R0001 - Home Base**

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

Floor Coverings Res/Textile	Vinyl Tiles 2001/B00A/R0001/Floor Coverings Res/Textile/S2	No Asbestos Detected
-----------------------------	---	----------------------

B00A - R0002 - Uniform Shop

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

B00A - R0003 - Toilets - Girls

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

Partition Walls (Cubicles)	Compressed AC Sheet	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00A/R0011/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

B00A - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0005 - Home Base

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

B00A - R0006 - Practical Activities - 1hb

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

B00A - R0007 - Toilets - Boys/Girls

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

B00A - R0008 - Toilets - Boys/Girls

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

B00A - R0009 - Practical Activities - 1hb

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

B00A - R0010 - Home Base

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

B00A - R0011 - Toilets - Boys

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

Partition Walls (Cubicles)	Compressed AC Sheet	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00A/R0011/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

B00A - R0012 - Cleaning Distributed Store

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

B00A - R0013 - Home Base

Ceiling Structures/Linings	Vermiculite 2001/B00A/R0010/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00A - R0014 - Practical Activities - 1hb						
Ceiling Structures/Linings	Vermiculite					
	2001/B00A/R0010/Ceiling Structures/Linings/S1				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles					
	2001/B00A/R0001/Floor Coverings Res/Textile/S2				No Asbestos Detected	
B00A - R0015 - External Movement						
No Asbestos						
B00A - R0016 - External Movement						
No Asbestos						
B00A - R0017 - External Movement						
No Asbestos						
B00A - R0018 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Administration - 1975 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area
- Area inaccessible No Voids

Ceiling Voids No Asbestos Found

Interior**B00B - R0001 - Practical Activities - 1hb**

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00B/R0006/Floor Coverings Res/Textile/S8	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Chrysotile (white asbestos)

B00B - R0002 - Home Base

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0003 - General Storeroom

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00B/R0006/Floor Coverings Res/Textile/S8	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Chrysotile (white asbestos)

B00B - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
Electrical Backing Board	Resinous Board 2001/B00B/R0004/Electrical Backing Board/S15	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)

Chrysotile (white asbestos)

B00B - R0005 - Home Base

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0006 - Practical Activities - 1hb

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00B/R0006/Floor Coverings Res/Textile/S8	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Chrysotile (white asbestos)

B00B - R0007 - Clerical Office

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0009 - Staff Room Annexe

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0010 - Staff Room

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0011 - Cleaning Distributed Store

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00B/R0006/Floor Coverings Res/Textile/S8	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Chrysotile (white asbestos)

B00B - R0012 - General Storeroom

Ceiling Structures/Linings	Vermiculite 2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00B - R0013 - Special Programs Room						
Ceiling Structures/Linings	Vermiculite					
	2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
B00B - R0014 - Duplicating Workroom						
Ceiling Structures/Linings	Vermiculite					
	2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
B00B - R0015 - Staff Toilet						
Ceiling Structures/Linings	Vermiculite					
	2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
B00B - R0016 - General Storeroom						
No Asbestos						
B00B - R0017 - Staff Toilet						
Ceiling Structures/Linings	Vermiculite					
	2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
B00B - R0018 - Movement						
Ceiling Structures/Linings	Vermiculite					
	2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
B00B - R0019 - External Movement						
No Asbestos						
B00B - R0020 - External Movement						
No Asbestos						
B00B - R0021 - External Movement						
No Asbestos						
B00B - R0022 - External Movement						
No Asbestos						
B00B - R0023 - Principal						
Ceiling Structures/Linings	Vermiculite					
	2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected
B00B - R0024 - Sick Bay						
Ceiling Structures/Linings	Vermiculite					
	2001/B00B/R0023/Ceiling Structures/Linings/S7					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning - 1985 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Ends	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00C/Gable Ends/S16			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting					
	2001/B00C/Eaves Linings/S17					No Asbestos Detected

Interior**B00C - R0001 - Movement**

Infill Panel	Flat AC Sheeting					
	2001/B00C/R0001/Infill Panel/S18					No Asbestos Detected

B00C - R0005 - Home Base Store

No Asbestos

B00C - R0006 - General Storeroom

No Asbestos

B00C - R0007 - Personal Effects Storage

No Asbestos

B00C - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	2001/B00C/R0008/Ceiling Structures/Linings/S3					No Asbestos Detected
Infill Panel	Flat AC Sheeting					
	2001/B00C/R0001/Infill Panel/S18					No Asbestos Detected

B00C - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	2001/B00C/R0008/Ceiling Structures/Linings/S3					No Asbestos Detected

B00C - R0010 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2001/B00C/R0010/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0011 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2001/B00C/R0010/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0012 - External Movement

Ceiling Structures/Linings No Asbestos Found

B00C - R0013 - Home Base Store

Ceiling Structures/Linings No Asbestos Found

B00C - R0014 - Practical Activities - 1hb

Ceiling Structures/Linings No Asbestos Found

B00C - R0015 - Home Base

Ceiling Structures/Linings No Asbestos Found

B00C - R0016 - Reading Area

Ceiling Structures/Linings No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Wall Cladding	Flat AC Sheeting 2001/B00D/Wall Cladding/S5					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 2001/B00D/Gable Verge Lining/S19	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2001/B00D/Eaves Linings/S20					No Asbestos Detected
Underfloor Voids	AC Fragments/Debris 2001/B00D/Underfloor Voids/S22					No Asbestos Detected

Interior**B00D - R0001 - Home Base Store**

No Asbestos

B00D - R0002 - Home Base

No Asbestos

B00D - R0006 - Home Base Store

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base Store

No Asbestos

B00D - R0009 - Home Base

No Asbestos

B00D - R0012 - Home Base Store

No Asbestos

B00D - R0013 - Home Base

No Asbestos

B00D - R0014 - Staff Room Annexe

No Asbestos

B00D - R0015 - General Storeroom

No Asbestos

B00D - R0016 - General Storeroom

No Asbestos

B00D - R0017 - K.L.A. Store

No Asbestos

B00D - R0018 - Movement

No Asbestos

B00D - R0022 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00D/R0024/Ceiling Structures/Linings/S13					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0023 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00D/R0024/Ceiling Structures/Linings/S13					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0024 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00D/R0024/Ceiling Structures/Linings/S13					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0025 - External Movement

No Asbestos

B00D - R0026 - Special Programs Room

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	

No Asbestos

B00D - R0027 - Practical Activities/Movement - 2hb

Ceiling Hatch

Flat AC Sheeting

2001/B00D/R0027/Ceiling Hatch/S21

No Asbestos Detected**B00D - R0028 - Practical Activities/Movement - 2hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00E - General Learning - 1912 - Timber (Timber)						
Exterior						
Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/Eaves Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00E - R0001 - Withdrawal Space - 1hb						
No Asbestos						
B00E - R0002 - Home Base Store						
No Asbestos						
B00E - R0003 - Home Base						
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/R0004/Wall Linings Internal/S12			Chrysotile (white asbestos)		
B00E - R0004 - Home Base						
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/R0004/Wall Linings Internal/S12			Chrysotile (white asbestos)		
B00E - R0005 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/R0005/Ceiling Structures/Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Infill Panel	Flat AC Sheeting			No Asbestos Detected		
	2001/B00E/R0005/Infill Panel/S25					
B00E - R0006 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2001/B00E/R0006/Ceiling Structures/Linings/S26			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Backing Board	No Asbestos Found					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 1985 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area
- Area inaccessible no voids

Ceiling Voids No Asbestos Found

Interior**B00F - R0001 - Communal Space**

No Asbestos

B00F - R0002 - Raised Platform

No Asbestos

B00F - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00A/R0011/Partition Walls (Cubicles)/S6						Chrysotile (white asbestos)

B00F - R0004 - Shower/Change

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00A/R0011/Partition Walls (Cubicles)/S6						Chrysotile (white asbestos)

B00F - R0005 - Plant

No Asbestos

B00F - R0006 - Cleaning Distributed Store

No Asbestos

B00F - R0007 - Movement

No Asbestos

B00F - R0008 - Movement

No Asbestos

B00F - R0009 - Shower/Change

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00A/R0011/Partition Walls (Cubicles)/S6						Chrysotile (white asbestos)

B00F - R0010 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00A/R0011/Partition Walls (Cubicles)/S6						Chrysotile (white asbestos)

B00F - R0011 - Hall Chair Store

No Asbestos

B00F - R0012 - Hall Chair Store

No Asbestos

B00F - R0013 - Garden Store

No Asbestos

B00F - R0014 - Disabled Toilet

No Asbestos

B00F - R0015 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0016 - Sports Store

No Asbestos

B00F - R0017 - Canteen Office/Store

No Asbestos

B00F - R0018 - Canteen Office/Store

No Asbestos

B00F - R0019 - Canteen

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00F - R0020 - External Movement						
No Asbestos						
B00F - R0021 - External Movement						
No Asbestos						
B00F - R0022 - External Movement						
No Asbestos						
B00F - R0023 - External Movement						
No Asbestos						
B00F - R0024 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00G - Building Services - 1985 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible no voids					
Eaves Linings	Flat AC Sheeting 2001/B00G/Eaves Linings/S27					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior**B00G - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00G/R0001/Ceiling Structures/Linings/S28					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00G - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00G/R0001/Ceiling Structures/Linings/S28					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00G/R0002/Floor Coverings Res/Textile/S14	18m2	Throughout	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

B00G - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00G/R0001/Ceiling Structures/Linings/S28					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00G/R0002/Floor Coverings Res/Textile/S14	3m2	Throughout	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

B00G - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 2001/B00G/R0001/Ceiling Structures/Linings/S28					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 2001/B00G/R0002/Floor Coverings Res/Textile/S14	4m2	Throughout	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00I - Pupil Facilities - 1985 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible no voids					
Eaves Linings	Flat AC Sheeting 2001/B00I/Eaves Linings/S29	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					

Interior**B00I - R0001 - General Storeroom**

No Asbestos

B00I - R0002 - General Storeroom

No Asbestos

B00I - R0003 - Toilets - Boys

No Asbestos

B00I - R0004 - Drinking Facilities

No Asbestos

B00I - R0005 - Drinking Facilities

No Asbestos

B00I - R0006 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1985 - Timber (Timber)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible Less than 300mm

Interior**B00J - R0001 - Garden Store**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2001/B00J/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00J - R0002 - Cleaning Supplies

No Asbestos

B00J - R0003 - External Movement

Floor Coverings Res/Textile	Vinyl Sheet
2001/B00J/R0003/Floor Coverings Res/Textile/S10	
No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00L - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00L - R0001 - External Movement**

No Asbestos

B00L - R0002 - Reading Area

No Asbestos

B00L - R0003 - Library Office/Workroom

No Asbestos

B00L - R0004 - Communications Room

No Asbestos

B00L - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10210 - Learning Unit - Standard With P.A.A. : Placement Date - 1/04/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10681 - Learning Unit - Standard With P.A.A. : Placement Date - 1/07/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12901 - Learning Unit - Standard With P.A.A. : Placement Date - 9/06/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 750 - D17816 - Learning Unit - ESL : Placement Date - 7/11/2014

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	5.76 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017