


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bangor Public School (4536)  
**Region :** Sydney  
**State Electorate :** Heathcote  
**Local Government Area :** Sutherland

**Initial Survey :** Noel Arnold & Associates : 26 - Mar - 2008  
**Register Issue Date :** 23 - Mar - 2017

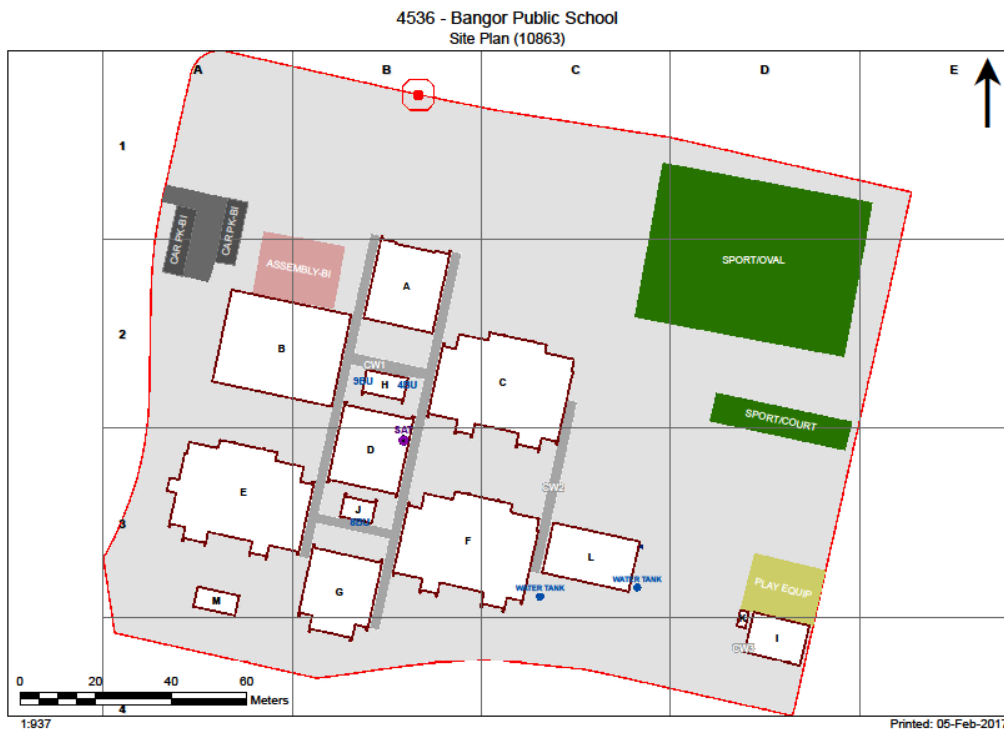

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4536/B00A/Eaves Linings/S1					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00A - R0001 - Principal**

No Asbestos

**B00A - R0002 - Movement**

No Asbestos

**B00A - R0003 - Staff Room**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00A/R0016/Floor Coverings Res/Textile/S4					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

**B00A - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00A/Eaves Linings/S1					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

**B00A - R0005 - Movement**

No Asbestos

**B00A - R0006 - Sick Bay - Shower/Toilet**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4536/B00A/R0006/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4536/B00A/R0006/Ceiling Structures/Linings/S3					No Asbestos Detected

**B00A - R0007 - Staff Toilet**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4536/B00A/R0006/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4536/B00A/R0006/Ceiling Structures/Linings/S3					No Asbestos Detected

**B00A - R0008 - Sick Bay**

No Asbestos

**B00A - R0009 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00A/R0016/Floor Coverings Res/Textile/S4					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

**B00A - R0010 - Movement**

No Asbestos

**B00A - R0011 - General Storeroom**

No Asbestos

**B00A - R0012 - Movement**

No Asbestos

**B00A - R0013 - Staff Toilet**

No Asbestos

**B00A - R0014 - Staff Room Annexe**

No Asbestos

**B00A - R0015 - Distribution Board**

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00A/R0016/Floor Coverings Res/Textile/S4					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

**B00A - R0016 - Security Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	4536/B00A/R0016/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
<b>B00A - R0017 - Clerical Office/Workroom</b>						
No Asbestos						
<b>B00A - R0018 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	4536/B00A/R0018/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>
<b>B00A - R0019 - Movement</b>						
No Asbestos						
<b>B00A - R0020 - Entry Vestibule</b>						
No Asbestos						
<b>B00A - R0021 - Duplicating Workroom</b>						
No Asbestos						
<b>B00A - R0022 - Clerical Office</b>						
No Asbestos						
<b>B00A - R0023 - Deputy Principal</b>						
No Asbestos						
<b>B00A - R0024 - Deputy Principal</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Communal Facilities/Building Services - 1984 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

**Interior****B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4536/B00B/R0002/Ceiling Structures/Linings/S16					

Partition Walls (Cubicles)	Compressed AC Sheet	9m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	-------------	--------------------	---------	--------------------

4536/B00B/R0002/Partition Walls (Cubicles)/S17

**Chrysotile (white asbestos)****B00B - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4536/B00B/R0002/Ceiling Structures/Linings/S16					

Partition Walls (Cubicles)	Compressed AC Sheet	9m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	-------------	--------------------	---------	--------------------

4536/B00B/R0002/Partition Walls (Cubicles)/S17

**Chrysotile (white asbestos)****B00B - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4536/B00B/R0010/Ceiling Structures/Linings/S9					

**B00B - R0005 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4536/B00B/R0002/Ceiling Structures/Linings/S16					

**B00B - R0006 - Music Store**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4536/B00B/R0014/Ceiling Structures/Linings/S6					

Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	4536/B00B/R0013/Floor Coverings Res/Textile/S8					

**B00B - R0007 - Movement**

No Asbestos

**B00B - R0008 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4536/B00B/R0002/Ceiling Structures/Linings/S16					

**B00B - R0009 - Cleaning Supplies**

Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	4536/B00B/R0013/Floor Coverings Res/Textile/S8					

**B00B - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4536/B00B/R0010/Ceiling Structures/Linings/S9					

**B00B - R0011 - Main Switch Board**

No Asbestos

**B00B - R0012 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4536/B00B/R0014/Ceiling Structures/Linings/S6					

**B00B - R0013 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	4536/B00B/R0013/Floor Coverings Res/Textile/S8					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0014 - Cleaning Distributed Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
			4536/B00B/R0014/Ceiling Structures/Linings/S6			<b>No Asbestos Detected</b>
<b>B00B - R0015 - Raised Platform</b>						
No Asbestos						
<b>B00B - R0016 - Hall Chair Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
			4536/B00B/R0014/Ceiling Structures/Linings/S6			<b>No Asbestos Detected</b>
<b>B00B - R0017 - Communal Space</b>						
No Asbestos						
<b>B00B - R0018 - Staff Kitchen</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
			4536/B00B/R0014/Ceiling Structures/Linings/S6			<b>No Asbestos Detected</b>
<b>B00B - R0019 - Communal Space</b>						
No Asbestos						
<b>B00B - R0020 - General Storeroom</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Pupil Facilities - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4536/B00C/Eaves Linings/S19					No Asbestos Detected
In-fill panel above windows	Flat AC Sheeting 4536/B00C/Eaves Linings/S19					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00C/Eaves Linings/S19					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

**B00C - R0002 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00C/R0030/Floor Coverings Res/Textile/S25					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00C - R0003 - Craft Store**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00C/R0030/Floor Coverings Res/Textile/S25					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00C - R0005 - Home Base**

No Asbestos

**B00C - R0006 - Home Base Store**

No Asbestos

**B00C - R0007 - Withdrawal Space - 1hb**

No Asbestos

**B00C - R0008 - Home Base**

No Asbestos

**B00C - R0009 - Home Base Store**

No Asbestos

**B00C - R0010 - Home Base Store**

No Asbestos

**B00C - R0011 - Staff Room Annexe**

No Asbestos

**B00C - R0012 - Home Base**

No Asbestos

**B00C - R0013 - Withdrawal Space - 1hb**

No Asbestos

**B00C - R0014 - Home Base**

No Asbestos

**B00C - R0015 - Home Base Store**

No Asbestos

**B00C - R0016 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00C/R0016/Ceiling Structures/Linings/S21					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 4536/B00C/R0016/Partition Walls (Cubicles)/S20	5m2	East facing	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

**B00C - R0017 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00C/R0016/Ceiling Structures/Linings/S21					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

**B00C - R0018 - Toilets - Girls**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00C/R0016/Ceiling Structures/Linings/S21					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 4536/B00C/R0016/Partition Walls (Cubicles)/S20	10m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00C - R0019 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00C/R0030/Floor Coverings Res/Textile/S25					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00C - R0020 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00C/Eaves Linings/S19					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

**B00C - R0021 - Uniform Shop**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00C/R0030/Floor Coverings Res/Textile/S25					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00C - R0022 - Home Base**

No Asbestos

**B00C - R0023 - Movement**

No Asbestos

**B00C - R0024 - Home Base Store**

No Asbestos

**B00C - R0025 - Withdrawal Space - 1hb**

No Asbestos

**B00C - R0026 - Home Base**

No Asbestos

**B00C - R0027 - Home Base Store**

No Asbestos

**B00C - R0028 - Movement**

No Asbestos

**B00C - R0029 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00C/R0030/Floor Coverings Res/Textile/S25					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00C - R0030 - Security Store**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00C/R0030/Floor Coverings Res/Textile/S25					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00C - R0031 - Distribution Board** Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0032 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00C/R0030/Floor Coverings Res/Textile/S25					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library/Tiered Learning - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4536/B00D/Eaves Linings/S22					<b>No Asbestos Detected</b>
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00D - R0001 - Special Programs Room**

No Asbestos

**B00D - R0002 - Movement**

No Asbestos

**B00D - R0003 - Reading Area**

No Asbestos

**B00D - R0004 - Seminar/Study**

No Asbestos

**B00D - R0005 - K.L.A. Store**

No Asbestos

**B00D - R0006 - Reading Area**

No Asbestos

**B00D - R0007 - Distribution Board**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00D/R0007/Ceiling Structures/Linings/S24					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00D - R0008 - Movement**

No Asbestos

**B00D - R0009 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00D/R0009/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>
--------------------------------	--	--	--	--	--	-----------------------------

**B00D - R0010 - Library Office/Workroom**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00D/R0009/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>
--------------------------------	--	--	--	--	--	-----------------------------

**B00D - R0011 - Communications Room**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Pupil Facilities - 1984 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting 4536/B00E/In-fill panel above windows/S32					No Asbestos Detected
In-fill panel above windows	Flat AC Sheeting 4536/B00E/In-fill panel above windows/S32					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior****B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00E/In-fill panel above windows/S32					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

**B00E - R0002 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00E - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00E/R0003/Ceiling Structures/Linings/S34					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 4536/B00E/R0003/Partition Walls (Cubicles)/S33	13m2	West facing	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

**B00E - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00E/R0003/Ceiling Structures/Linings/S34					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

**B00E - R0005 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00E/R0003/Ceiling Structures/Linings/S34					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 4536/B00E/R0003/Partition Walls (Cubicles)/S33	6m2	South facing, West facing	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

**B00E - R0006 - Home Base Store**

No Asbestos

**B00E - R0007 - Home Base**

No Asbestos

**B00E - R0008 - Withdrawal Space - 1hb**

No Asbestos

**B00E - R0009 - Home Base**

No Asbestos

**B00E - R0010 - Home Base Store**

No Asbestos

**B00E - R0011 - Home Base Store**

No Asbestos

**B00E - R0012 - Staff Room Annexe**

No Asbestos

**B00E - R0013 - Home Base**

No Asbestos

**B00E - R0014 - Withdrawal Space - 1hb**

No Asbestos

**B00E - R0015 - Home Base Store**

No Asbestos

**B00E - R0016 - Home Base**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00E - R0017 - Movement</b>						
No Asbestos						
<b>B00E - R0018 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		4536/B00F/R0030/Floor Coverings Res/Textile/S29				<b>No Asbestos Detected</b>
<b>B00E - R0019 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
		4536/B00E/In-fill panel above windows/S32				<b>No Asbestos Detected</b>
<b>B00E - R0020 - Craft Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		4536/B00F/R0030/Floor Coverings Res/Textile/S29				<b>No Asbestos Detected</b>
<b>B00E - R0021 - Home Base</b>						
No Asbestos						
<b>B00E - R0022 - Movement</b>						
No Asbestos						
<b>B00E - R0023 - Home Base Store</b>						
No Asbestos						
<b>B00E - R0024 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00E - R0025 - Home Base</b>						
No Asbestos						
<b>B00E - R0026 - Home Base Store</b>						
No Asbestos						
<b>B00E - R0027 - Movement</b>						
No Asbestos						
<b>B00E - R0028 - Craft Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		4536/B00F/R0030/Floor Coverings Res/Textile/S29				<b>No Asbestos Detected</b>
<b>B00E - R0029 - Cleaning Distributed Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		4536/B00F/R0030/Floor Coverings Res/Textile/S29				<b>No Asbestos Detected</b>
<b>B00E - R0030 - Security Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		4536/B00F/R0030/Floor Coverings Res/Textile/S29				<b>No Asbestos Detected</b>
<b>B00E - R0031 - Distribution Board</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00E - R0032 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		4536/B00F/R0030/Floor Coverings Res/Textile/S29				<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning/Pupil Facilities - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4536/B00F/In-fill panel above windows/S26					No Asbestos Detected
In-fill panel above windows	Flat AC Sheeting 4536/B00F/In-fill panel above windows/S26					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00F/In-fill panel above windows/S26					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

**B00F - R0002 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00F - R0004 - Home Base**

No Asbestos

**B00F - R0005 - Home Base Store**

No Asbestos

**B00F - R0006 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0007 - Home Base**

No Asbestos

**B00F - R0008 - Home Base Store**

No Asbestos

**B00F - R0009 - Home Base Store**

No Asbestos

**B00F - R0010 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0011 - Home Base**

No Asbestos

**B00F - R0012 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0013 - Home Base**

No Asbestos

**B00F - R0014 - Home Base Store**

No Asbestos

**B00F - R0015 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00F/R0015/Ceiling Structures/Linings/S28					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 4536/B00F/R0015/Partition Walls (Cubicles)/S27	5m2	East facing	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

**B00F - R0016 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00F/R0015/Ceiling Structures/Linings/S28					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

**B00F - R0017 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00F/R0015/Ceiling Structures/Linings/S28					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	13m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4536/B00F/R0015/Partition Walls (Cubicles)/S27					Chrysotile (white asbestos)	
<b>B00F - R0018 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected	
<b>B00F - R0019 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
4536/B00F/In-fill panel above windows/S26					No Asbestos Detected	
<b>B00F - R0020 - Craft Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected	
<b>B00F - R0021 - Home Base</b>						
No Asbestos						
<b>B00F - R0022 - Movement</b>						
No Asbestos						
<b>B00F - R0023 - Home Base Store</b>						
No Asbestos						
<b>B00F - R0024 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00F - R0025 - Home Base</b>						
No Asbestos						
<b>B00F - R0026 - Home Base Store</b>						
No Asbestos						
<b>B00F - R0027 - Movement</b>						
No Asbestos						
<b>B00F - R0028 - Craft Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected	
<b>B00F - R0029 - Distribution Board</b>						
No Asbestos					Note: No inspection of live electrical installation.	
<b>B00F - R0030 - Security Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected	
<b>B00F - R0031 - Cleaning Distributed Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected	
<b>B00F - R0032 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4536/B00G/Eaves Linings/S30					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00G - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00G/R0001/Ceiling Structures/Linings/S31					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

**B00G - R0002 - Special Programs Room**

No Asbestos

**B00G - R0003 - Craft Store**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00G - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00G - R0005 - Home Base Store**

No Asbestos

**B00G - R0006 - Home Base**

No Asbestos

**B00G - R0007 - Withdrawal Space - 1hb**

No Asbestos

**B00G - R0008 - Home Base**

No Asbestos

**B00G - R0009 - Home Base Store**

No Asbestos

**B00G - R0010 - Home Base Store**

No Asbestos

**B00G - R0011 - Withdrawal Space - 1hb**

No Asbestos

**B00G - R0012 - Home Base**

No Asbestos

**B00G - R0013 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00G - R0014 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet 4536/B00F/R0030/Floor Coverings Res/Textile/S29					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00G - R0015 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00G/R0001/Ceiling Structures/Linings/S31					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Pupil Facilities - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00H - R0001 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00H/R0002/Ceiling Structures/Linings/S18	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B00H - R0002 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00H/R0002/Ceiling Structures/Linings/S18	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B00H - R0003 - Canteen Office/Store**

No Asbestos

**B00H - R0004 - Canteen**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Other-After School Care - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B001 - R0001 - Out Of School Hours Care Centre**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4536/B001/R0001/Ceiling Structures/Linings/S14					
Floor Coverings Res/Textile	Compressed AC Sheet					No Asbestos Detected
	4536/B001/R0001/Floor Coverings Res/Textile/S15					

**B001 - R0002 - Out Of School Hours Care Centre**

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4536/B001/R0002/Floor Coverings Res/Textile/S13					

**B001 - R0003 - Out Of School Hours Care Centre**

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4536/B001/R0006/Floor Coverings Res/Textile/S12					

**B001 - R0004 - Out Of School Hours Care Centre**

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4536/B001/R0002/Floor Coverings Res/Textile/S13					

**B001 - R0005 - Out Of School Hours Care Centre**

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4536/B001/R0002/Floor Coverings Res/Textile/S13					

**B001 - R0006 - Out Of School Hours Care Centre**

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4536/B001/R0006/Floor Coverings Res/Textile/S12					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Tiered Learning - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00J - R0001 - Special Programs Room**

No Asbestos

**B00J - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4536/B00J/R0002/Ceiling Structures/Linings/S11	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Other-After School Care - 1984 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00K - R0001 - Out Of School Hours Care Centre**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00L - R0001 - Home Base**

No Asbestos

**B00L - R0002 - Practical Activities - 1hb**

No Asbestos

**B00L - R0003 - Practical Activities - 1hb**

No Asbestos

**B00L - R0004 - Home Base Store**

No Asbestos

**B00L - R0005 - Home Base**

No Asbestos

**B00L - R0006 - Withdrawal Space - 2hb**

No Asbestos

**B00L - R0007 - Home Base Store**

No Asbestos

**B00L - R0008 - Special Programs Room**

No Asbestos

**B00L - R0009 - Special Programs Store**

No Asbestos

**B00L - R0010 - Special Programs Store**

No Asbestos

**B00L - R0011 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Building Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00M - R0001 - Sports Store**

No Asbestos

**B00M - R0002 - General Assistant/Bulk Store**

No Asbestos

**B00M - R0003 - Garden Store**

No Asbestos

**B00M - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

4536\_ASB\_201210\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017