


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kelso Public School (2275)  
**Region :** Western NSW  
**State Electorate :** Bathurst  
**Local Government Area :** Bathurst

**Initial Survey :** Noel Arnold & Associates : 22 - May - 2008  
**Reviewed By :** Greencap-NAA : 17 - Apr - 2015

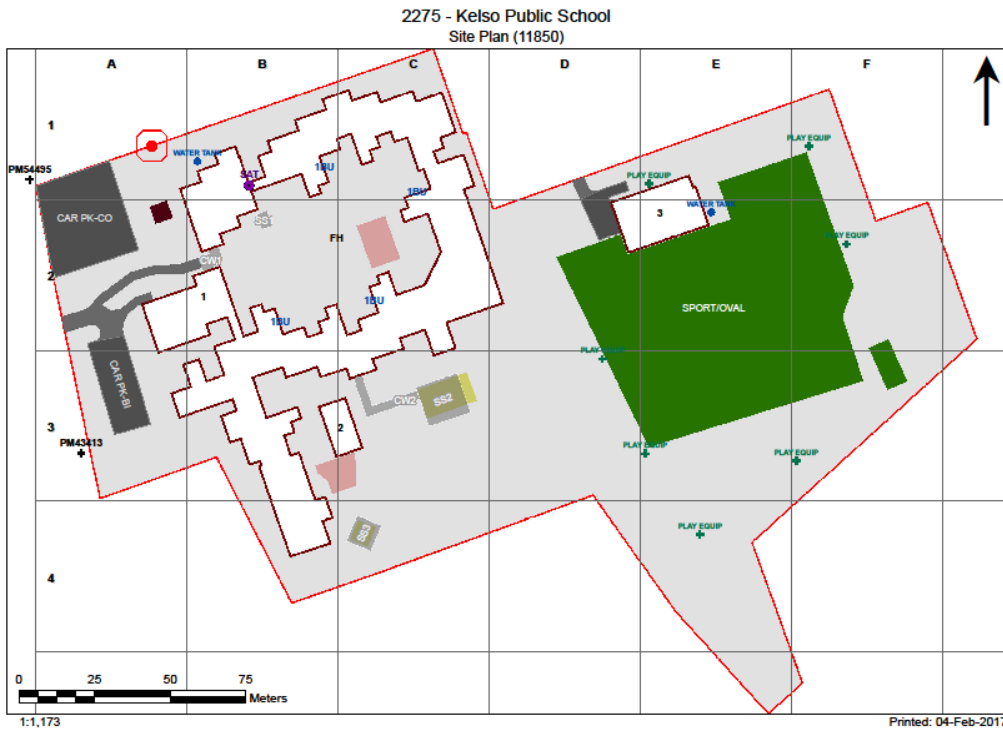

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - General Learning/Administration - 1979 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- No asbestos found.					

**Interior**

**B001 - R0001 - Main Switch Board**

Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Electrical Mounting Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - No sample- live.**

**B001 - R0002 - Movement**

No Asbestos

**B001 - R0003 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>

**B001 - R0004 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>

**B001 - R0005 - Cleaning Distributed Store**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>

**B001 - R0006 - Library Office/Workroom**

No Asbestos

**B001 - R0007 - Reading Area**

No Asbestos

**B001 - R0008 - K.L.A. Store**

No Asbestos

**B001 - R0009 - Library Office/Workroom**

No Asbestos

**B001 - R0010 - Seminar/Study**

No Asbestos

**B001 - R0011 - Seminar/Study**

No Asbestos

**B001 - R0012 - Movement**

No Asbestos

**B001 - R0013 - Movement**

No Asbestos

**B001 - R0014 - Movement**

No Asbestos

**B001 - R0015 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R0016 - Special Programs Room</b>						
Non Accessible						
<b>B001 - R0017 - Cleaning Distributed Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay under dark green vinyl sheet:					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
<b>B001 - R0018 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0019 - Movement</b>						
No Asbestos						
<b>B001 - R0020 - Home Base</b>						
No Asbestos						
<b>B001 - R0021 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0022 - Home Base</b>						
No Asbestos						
<b>B001 - R0023 - Movement</b>						
No Asbestos						
<b>B001 - R0024 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0025 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0026 - Distribution Board</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R0027 - Movement</b>						
No Asbestos						
<b>B001 - R0028 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay under dark green vinyl sheet:					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
<b>B001 - R0029 - Toilets - Girls</b>						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>
<b>B001 - R0030 - Personal Effects Storage</b>						
No Asbestos						
<b>B001 - R0031 - Staff Room Annexe</b>						
No Asbestos						
<b>B001 - R0032 - Movement</b>						
No Asbestos						
<b>B001 - R0033 - Home Base</b>						
No Asbestos						
<b>B001 - R0034 - Movement</b>						
No Asbestos						
<b>B001 - R0035 - Withdrawal Space - 1hb</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R0036 - Movement</b>						
No Asbestos						
<b>B001 - R0037 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B001 - R0038 - Personal Effects Storage</b>						
No Asbestos						
<b>B001 - R0039 - Staff Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
<b>B001 - R0040 - Toilets - Boys</b>						
Wall Linings Internal	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
<b>B001 - R0041 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
2275/B001/R0080/Floor Coverings Res/Textile/S8						
Floor Coverings Res/Textile	Adhesive/underlay under dark green vinyl sheet:					No Asbestos Detected
2275/B001/R0080/Floor Coverings Res/Textile/S9						
<b>B001 - R0042 - Home Base</b>						
No Asbestos						
<b>B001 - R0043 - Movement</b>						
No Asbestos						
<b>B001 - R0044 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0045 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0046 - Movement</b>						
No Asbestos						
<b>B001 - R0047 - Home Base</b>						
No Asbestos						
<b>B001 - R0048 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0049 - Movement</b>						
No Asbestos						
<b>B001 - R0050 - Home Base</b>						
No Asbestos						
<b>B001 - R0051 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0052 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
2275/B001/R0164/Floor Coverings Res/Textile/S6						
Floor Coverings Res/Textile	Adhesive/backing of green vinyl sheet					No Asbestos Detected
2275/B001/R0164/Floor Coverings Res/Textile/S7						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R0053 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B001 - R0054 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B001 - R0055 - Toilets - Boys</b>						
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Not accessible no key.</b>						
<b>B001 - R0056 - Movement</b>						
No Asbestos						
<b>B001 - R0057 - Distribution Board</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R0058 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0164/Floor Coverings Res/Textile/S6					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of green vinyl sheet					
	2275/B001/R0164/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B001 - R0059 - Cleaning Distributed Store</b>						
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B001 - R0060 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0061 - Home Base</b>						
No Asbestos						
<b>B001 - R0062 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0063 - Home Base</b>						
No Asbestos						
<b>B001 - R0064 - Movement</b>						
No Asbestos						
<b>B001 - R0065 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B001 - R0066 - Personal Effects Storage</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B001 - R0067 - Toilets - Girls</b>						
Wall Linings Internal	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
<b>B001 - R0068 - Staff Room Annexe</b>						
No Asbestos						
<b>B001 - R0069 - Movement</b>						
No Asbestos						
<b>B001 - R0070 - Staff Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)
<b>B001 - R0071 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0072 - Distribution Board</b>						
No Asbestos						
<b>B001 - R0073 - Uniform Shop</b>						
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B001 - R0074 - Canteen Office/Store</b>						
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B001 - R0075 - Canteen Office/Store</b>						
Wall Linings Internal	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B001 - R0076 - Canteen</b>						
Wall Linings Internal	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9				<b>No Asbestos Detected</b>	
<b>B001 - R0077 - General Storeroom</b>						
No Asbestos						
<b>B001 - R0078 - Communal Space</b>						
No Asbestos						
<b>B001 - R0079 - Raised Platform</b>						
No Asbestos						
<b>B001 - R0080 - P.E. Store</b>						
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9				<b>No Asbestos Detected</b>	
<b>B001 - R0081 - Plant</b>						
Floor Coverings Res/Textile	Dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S8				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive/backing of dark green vinyl sheet					
	2275/B001/R0080/Floor Coverings Res/Textile/S9				<b>No Asbestos Detected</b>	
<b>B001 - R0082 - Movement</b>						
No Asbestos						
<b>B001 - R0083 - Movement</b>						
No Asbestos						
<b>B001 - R0084 - Movement</b>						
No Asbestos						
<b>B001 - R0085 - Movement</b>						
No Asbestos						
<b>B001 - R0086 - Movement</b>						
No Asbestos						
<b>B001 - R0087 - Movement</b>						
No Asbestos						
<b>B001 - R0088 - Movement</b>						
No Asbestos						
<b>B001 - R0089 - Movement</b>						
No Asbestos						
<b>B001 - R0090 - Movement</b>						
No Asbestos						
<b>B001 - R0091 - Movement</b>						
No Asbestos						
<b>B001 - R0092 - Special Programs Room</b>						
No Asbestos						
<b>B001 - R0093 - Toilets - Girls</b>						
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0094 - Toilets - Boys</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
<b>B001 - R0095 - Sports Store</b>						
No Asbestos						
<b>B001 - R0096 - Hall Chair Store</b>						
No Asbestos						
<b>B001 - R0097 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0098 - Movement</b>						
No Asbestos						
<b>B001 - R0099 - Distribution Board</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R0100 - General Assistant/Bulk Store</b>						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	
<b>B001 - R0101 - Garden Store</b>						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	
<b>B001 - R0102 - Home Base</b>						
No Asbestos						
<b>B001 - R0103 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0104 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0105 - Toilets - Boys</b>						
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
<b>B001 - R0106 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B001 - R0107 - Home Base Store</b>						
Wall Linings Internal	Flat AC Sheeting	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	
<b>B001 - R0108 - Home Base</b>						
No Asbestos						
<b>B001 - R0109 - Movement</b>						
No Asbestos						
<b>B001 - R0110 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0111 - Movement</b>						
No Asbestos						
<b>B001 - R0112 - Movement</b>						
No Asbestos						
<b>B001 - R0113 - Home Base Store</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R0114 - Home Base</b>						
No Asbestos						
<b>B001 - R0115 - Movement</b>						
No Asbestos						
<b>B001 - R0116 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0117 - Movement</b>						
No Asbestos						
<b>B001 - R0118 - Home Base</b>						
No Asbestos						
<b>B001 - R0119 - Toilets - Girls</b>						
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>
<b>B001 - R0120 - Staff Toilet</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
<b>B001 - R0121 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
<b>B001 - R0122 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0164/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay of green vinyl sheet					
	2275/B001/R0164/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B001 - R0123 - Movement</b>						
No Asbestos						
<b>B001 - R0124 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0125 - Distribution Board</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R0126 - Movement</b>						
No Asbestos						
<b>B001 - R0127 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0128 - Movement</b>						
No Asbestos						
<b>B001 - R0129 - Home Base</b>						
No Asbestos						
<b>B001 - R0130 - Withdrawal Space - 1hb</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R0131 - Toilets - Boys</b>						
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0132 - Personal Effects Storage</b>						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0133 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B001 - R0134 - Staff Room Annexe</b>						
No Asbestos						
<b>B001 - R0135 - Home Base</b>						
No Asbestos						
<b>B001 - R0136 - Movement</b>						
No Asbestos						
<b>B001 - R0137 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0138 - Movement</b>						
No Asbestos						
<b>B001 - R0140 - Withdrawal Space - 1hb</b>						
Non Accessible						
<b>B001 - R0141 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0142 - Toilets - Boys/Girls</b>						
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0143 - Home Base Store</b>						
Wall Linings Internal	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0145 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0147 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0148 - Distribution Board</b>						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0149 - Movement</b>						
No Asbestos						
<b>B001 - R0150 - Toilets - Boys/Girls</b>						
Wall Linings Internal	Flat AC Sheeting	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0152 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B001 - R0153 - Home Base Store</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R0154 - Special Programs Room</b>						
No Asbestos						
<b>B001 - R0155 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
<b>B001 - R0156 - Staff Room Annexe</b>						
No Asbestos						
<b>B001 - R0157 - Cleaning Distributed Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
<b>B001 - R0158 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0159 - Home Base</b>						
No Asbestos						
<b>B001 - R0160 - Movement</b>						
No Asbestos						
<b>B001 - R0161 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0162 - Movement</b>						
No Asbestos						
<b>B001 - R0163 - Home Base</b>						
No Asbestos						
<b>B001 - R0164 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0164/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay green lino					
	2275/B001/R0164/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B001 - R0165 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
<b>B001 - R0166 - Staff Toilet</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
<b>B001 - R0167 - Disabled Shower/Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R0168 - Movement</b>						
No Asbestos						
<b>B001 - R0169 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>
<b>B001 - R0170 - Staff Room Annexe</b>						
No Asbestos						
<b>B001 - R0171 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>
<b>B001 - R0172 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>
<b>B001 - R0173 - Distribution Board</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R0174 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0175 - Movement</b>						
No Asbestos						
<b>B001 - R0176 - Home Base</b>						
No Asbestos						
<b>B001 - R0177 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B001 - R0178 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>
<b>B001 - R0179 - Home Base</b>						
No Asbestos						
<b>B001 - R0180 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
		2275/B001/R0196/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>
<b>B001 - R0181 - Personal Effects Storage</b>						
No Asbestos						
<b>B001 - R0182 - Staff Room Annexe</b>						
No Asbestos						
<b>B001 - R0183 - Staff Toilet</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R0184 - Movement</b>						
No Asbestos						
<b>B001 - R0185 - Movement</b>						
No Asbestos						
<b>B001 - R0186 - Interview</b>						
No Asbestos						
<b>B001 - R0187 - Deputy Principal</b>						
No Asbestos						
<b>B001 - R0188 - Cleaning Supplies</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					No Asbestos Detected
<b>B001 - R0189 - Cleaning Distributed Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					No Asbestos Detected
<b>B001 - R0190 - General Assistant/Bulk Store</b>						
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					No Asbestos Detected
<b>B001 - R0191 - Staff Toilet</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
<b>B001 - R0192 - Staff Toilet</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
<b>B001 - R0193 - General Assistant/Bulk Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					No Asbestos Detected
<b>B001 - R0194 - Staff Room</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					No Asbestos Detected
<b>B001 - R0195 - Duplicating Workroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4					No Asbestos Detected
<b>B001 - R0196 - Sick Bay</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					
	2275/B001/R0196/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>	
<b>B001 - R0197 - Distribution Board</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R0198 - Clerical Office</b>						
No Asbestos						
<b>B001 - R0199 - Principal</b>						
No Asbestos						
<b>B001 - R0200 - Interview</b>						
No Asbestos						
<b>B001 - R0201 - Movement</b>						
No Asbestos						
<b>B001 - R0202 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B001 - R0203 - Home Base - E</b>						
No Asbestos						
<b>B001 - R0204 - Movement</b>						
No Asbestos						
<b>B001 - R0205 - Home Base</b>						
No Asbestos						
<b>B001 - R0206 - Home Base Store</b>						
No Asbestos						
<b>B001 - R0207 - Other-Community Use</b>						
Under window in-fill panels	Flat AC Sheeting	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0208 - Other-Community Use</b>						
Under window in-fill panels	Flat AC Sheeting	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0209 - Girls &amp; boys toilet</b>						
No Asbestos						
<b>B001 - R0210 - Staff toilet</b>						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B002 - Pupil Facilities - 1979 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
<b>Interior</b>						
<b>B002 - R0001 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
<b>B002 - R0002 - Drinking Facilities</b>						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
<b>B002 - R0003 - Toilets - Girls</b>						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>
<b>B002 - R0004 - Cleaning Distributed Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
<b>B002 - R0005 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Asbestos encased in metal</b>					
<b>B002 - R0006 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
<b>B002 - R0007 - Cleaning Supplies</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
<b>B002 - R0008 - Plant</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Toilet Cistern	Fibre Cement Casting (Monocrete)	11Unit(s)	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - No sample avoid damage.</b>					
<b>B002 - R0009 - Toilets - Boys</b>						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2275/B001/R0192/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
<b>B002 - R0010 - Drinking Facilities</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	
<b>B002 - R0011 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2275/B001/R0192/Wall Linings Internal/S1					Chrysotile (white asbestos)	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B003 - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids - Flat Roof No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B003 - R0001 - Communal Space**

No Asbestos

**B003 - R0002 - Raised Platform**

No Asbestos

**B003 - R0003 - Movement**

No Asbestos

**B003 - R0004 - Covered Outdoor Learning Area**

No Asbestos

**B003 - R0005 - Ramp**

No Asbestos

**B003 - R0006 - Movement**

No Asbestos

**B003 - R0007 - Hall Chair Store**

No Asbestos

**B003 - R0008 - Communal/Performance Store**

No Asbestos

**B003 - R0009 - P.E. Store**

No Asbestos

**B003 - R0010 - Toilet - Lobby**

No Asbestos

**B003 - R0011 - Toilets - Girls**

No Asbestos

**B003 - R0012 - Sound Cupboard**

No Asbestos

**B003 - R0013 - Toilets - Boys**

No Asbestos

**B003 - R0014 - Toilet - Lobby**

No Asbestos

**B003 - R0015 - Cleaning Distributed Store**

No Asbestos

**B003 - R0016 - Other**

No Asbestos

**B003 - R0017 - Distribution Board**

No Asbestos

Note: No inspection of live electrical installation.

**B003 - R0018 - Access Shower/Toilet/Change**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

2275\_ASB\_261112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017