


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Koorringal Public School (4173)
Region : Riverina
State Electorate : Wagga Wagga
Local Government Area : Wagga Wagga

Initial Survey : Noel Arnold & Associates : 04 - May - 2008
Reviewed By : Greencap-NAA : 18 - Feb - 2015

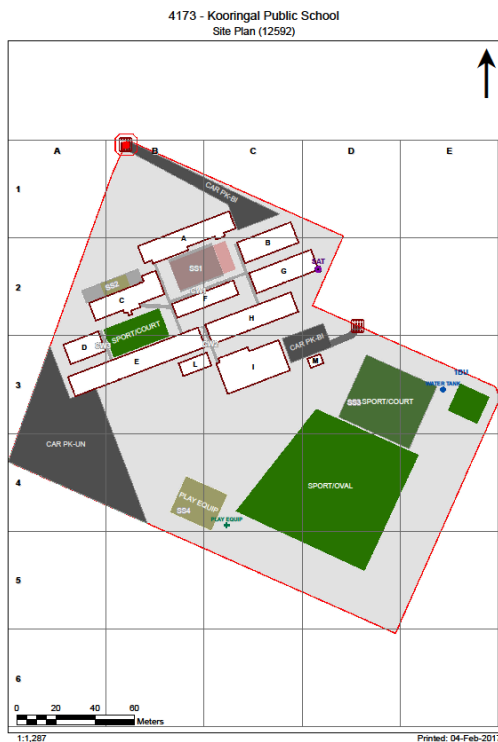

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4173/B00B/Eaves Linings/S22	100m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting 4173/B00A/Wall Cladding/S1	30m2	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Entry Steps	Flat AC Sheeting 4173/B00A/Wall Cladding/S2					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00A - R0001 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 4173/B00A/R0003/Wall Linings Internal/S4					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00A - R0002 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Sheet 4173/B00A/R0002/Floor Coverings Res/Textile/S3					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00A - R0003 - External Movement

Wall Linings Internal	Flat AC Sheeting 4173/B00A/R0003/Wall Linings Internal/S4					No Asbestos Detected
Floor Coverings Res/Textile	Flat AC Sheeting 4173/B00A/R0029/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Personal Effects Storage

No Asbestos

B00A - R0007 - External Movement

No Asbestos

B00A - R0008 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 4173/B00A/R0003/Wall Linings Internal/S4					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00A - R0009 - Staff Room Annexe

No Asbestos

B00A - R0010 - General Storeroom

No Asbestos

B00A - R0011 - Interview

No Asbestos

B00A - R0012 - Staff Toilet

No Asbestos

B00A - R0013 - Security Store

No Asbestos

B00A - R0014 - Movement

Floor Coverings Res/Textile	Vinyl Sheet 4173/B00A/R0014/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0015 - Entry Vestibule						
No Asbestos						
B00A - R0016 - Principal						
No Asbestos						
B00A - R0017 - General Storeroom						
No Asbestos						
B00A - R0018 - Distribution Board						
					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4173/B00A/R0018/Electrical Mounting Board/S21					Chrysotile (white asbestos)	
B00A - R0019 - General Storeroom						
No Asbestos						
B00A - R0020 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
4173/B00A/R0003/Wall Linings Internal/S4						
B00A - R0021 - Clerical Office						
No Asbestos						
B00A - R0022 - Sick Bay						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
4173/B00A/R0022/Floor Coverings Res/Textile/S6						
B00A - R0023 - Deputy Principal						
No Asbestos						
B00A - R0024 - Staff Room Annexe						
No Asbestos						
B00A - R0025 - Movement						
No Asbestos						
B00A - R0026 - Home Base Store						
No Asbestos						
B00A - R0027 - Home Base Store						
No Asbestos						
B00A - R0028 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
4173/B00A/R0003/Wall Linings Internal/S4						
B00A - R0029 - External Movement						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
4173/B00A/R0003/Wall Linings Internal/S4						
Floor Coverings Res/Textile	Flat AC Sheeting					No Asbestos Detected
4173/B00A/R0029/Floor Coverings Res/Textile/S5						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00B/Eaves Linings/S22					Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	45m2	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4173/B00B/Wall Cladding/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00B - R0001 - Home Base Store

No Asbestos

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Home Base

No Asbestos

B00B - R0004 - Home Base Store

No Asbestos

B00B - R0005 - Home Base Store

No Asbestos

B00B - R0006 - Home Base

No Asbestos

B00B - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00B/Eaves Linings/S22					Chrysotile (white asbestos)

B00B - R0008 - Personal Effects Storage

No Asbestos

B00B - R0009 - Personal Effects Storage

No Asbestos

B00B - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00B/Eaves Linings/S22					Chrysotile (white asbestos)

B00B - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00B/Eaves Linings/S22					Chrysotile (white asbestos)

B00B - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00B/Eaves Linings/S22					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Staff Facilities/General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Wall Cladding	Flat AC Sheeting 4173/B00B/Wall Cladding/S8	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting 4173/B00B/Eaves Linings/S22	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00C - R0001 - Cleaning Supplies

No Asbestos

B00C - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 4173/B00A/R0003/Wall Linings Internal/S4					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 4173/B00A/R0003/Wall Linings Internal/S4					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00C - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Sheet 4173/B00C/R0004/Floor Coverings Res/Textile/S23					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0005 - External Movement

Wall Linings Internal	Flat AC Sheeting 4173/B00A/R0003/Wall Linings Internal/S4					No Asbestos Detected
Floor Coverings Res/Textile	Flat AC Sheeting 4173/B00A/R0029/Floor Coverings Res/Textile/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4173/B00A/R0003/Wall Linings Internal/S4					No Asbestos Detected

B00C - R0006 - Practical Activities - 1hb

No Asbestos

B00C - R0007 - Toilets - Boys/Girls

No Asbestos

B00C - R0008 - Personal Effects Storage

No Asbestos

B00C - R0009 - Home Base

No Asbestos

B00C - R0010 - Staff Room Annexe

No Asbestos

B00C - R0011 - Withdrawal Space - 1hb

No Asbestos

B00C - R0012 - Uniform Shop

No Asbestos

B00C - R0013 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles 4173/B00C/R0013/Floor Coverings Res/Textile/S9	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00C - R0014 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Flat AC Sheeting
 4173/B00A/R0003/Wall Linings Internal/S4 **No Asbestos Detected**

B00C - R0015 - Movement

No Asbestos

B00C - R0016 - Home Base Store

No Asbestos

B00C - R0017 - Home Base Store

No Asbestos

B00C - R0018 - General Storeroom

No Asbestos

B00C - R0019 - Staff Room

No Asbestos

B00C - R0020 - Movement

Ceiling Structures/Linings Flat AC Sheeting
 4173/B00A/R0003/Wall Linings Internal/S4 **No Asbestos Detected**

B00C - R0021 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00B/Eaves Linings/S22				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00D - M0001 - Withdrawal Space - 1hb

No Asbestos

B00D - R0001 - Home Base Store

No Asbestos

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Home Base

No Asbestos

B00D - R0004 - Home Base Store

No Asbestos

B00D - R0005 - Personal Effects Storage

No Asbestos

B00D - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00D/R0006/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0007 - Movement

No Asbestos

B00D - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00D/R0006/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0009 - Personal Effects Storage

No Asbestos

B00D - R0010 - Movement

No Asbestos

B00D - R0011 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities/General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Assumed Asbestos

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00E - R0001 - Toilets - Boys

No Asbestos

B00E - R0002 - Out Of School Hours Care Centre

Floor Coverings Res/Textile	Vinyl Tiles	4173/B00E/R0002/Floor Coverings Res/Textile/S13				No Asbestos Detected
-----------------------------	-------------	---	--	--	--	-----------------------------

B00E - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4173/B00E/R0003/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	4173/B00E/R0003/Wall Linings Internal/S12				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

B00E - R0004 - Home Base

No Asbestos

B00E - R0005 - Home Base Store

No Asbestos

B00E - R0006 - Home Base Store

No Asbestos

B00E - R0007 - Home Base

No Asbestos

B00E - R0008 - Home Base

No Asbestos

B00E - R0009 - Home Base Store

No Asbestos

B00E - R0010 - Craft Store

No Asbestos

B00E - R0011 - Home Base Store

No Asbestos

B00E - R0012 - Home Base

No Asbestos

B00E - R0013 - Home Base

No Asbestos

B00E - R0014 - Toilets - Boys/Girls

No Asbestos

B00E - R0015 - Personal Effects Storage

No Asbestos

B00E - R0016 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4173/B00D/R0006/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0017 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - R0018 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4173/B00D/R0006/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0019 - Personal Effects Storage

No Asbestos

B00E - R0020 - Cleaning Supplies

No Asbestos

B00E - R0021 - Personal Effects Storage

No Asbestos

B00E - R0022 - Personal Effects Storage

No Asbestos

B00E - R0023 - Personal Effects Storage

No Asbestos

B00E - R0024 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4173/B00D/R0006/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00B/Eaves Linings/S22					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00F - R0005 - Home Base

No Asbestos

B00F - R0006 - Darkroom Space

No Asbestos

B00F - R0007 - Staff Room Annexe

No Asbestos

B00F - R0008 - General Storeroom

No Asbestos

B00F - R0009 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Sheet					
	4173/B00F/R0009/Floor Coverings Res/Textile/S14					No Asbestos Detected

B00F - R0010 - Movement

Floor Coverings Res/Textile	Vinyl Sheet					
	4173/B00F/R0010/Floor Coverings Res/Textile/S15					No Asbestos Detected

B00F - R0011 - Staff Room Annexe

No Asbestos

B00F - R0012 - Staff Room Annexe

No Asbestos

B00F - R0013 - Interview

No Asbestos

B00F - R0014 - Movement

No Asbestos

B00F - R0015 - Handwashing Facilities

Wall Linings Internal	Compressed AC Sheet	45m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4173/B00F/R0015/Wall Linings Internal/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0016 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00E/R0003/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)

Wall Linings Internal	Compressed AC Sheet	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00F/R0015/Wall Linings Internal/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0017 - Staff Toilet

No Asbestos

B00F - R0019 - Staff Toilet

No Asbestos

B00F - R0020 - General Storeroom

No Asbestos

B00F - R0021 - Toilets - Boys

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00F - R0022 - Toilets - Boys

No Asbestos

B00F - R0023 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4173/B00B/Eaves Linings/S22	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting 4173/B00B/Wall Cladding/S8	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00G - R0001 - Reading Area

No Asbestos

B00G - R0002 - General Storeroom

No Asbestos

B00G - R0003 - General Storeroom

No Asbestos

B00G - R0004 - Movement

No Asbestos

B00G - R0005 - Library Office/Workroom

No Asbestos

B00G - R0006 - General Storeroom

No Asbestos

B00G - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Compressed AC Sheet	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00B/Eaves Linings/S22					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00H - R0001 - Home Base

No Asbestos

B00H - R0002 - Home Base Store

No Asbestos

B00H - R0003 - Home Base Store

No Asbestos

B00H - R0004 - Home Base

No Asbestos

B00H - R0005 - Home Base

No Asbestos

B00H - R0006 - Security Store

No Asbestos

B00H - R0007 - Home Base Store

No Asbestos

B00H - R0008 - Home Base

No Asbestos

B00H - R0009 - Home Base

No Asbestos

B00H - R0010 - Home Base Store

No Asbestos

B00H - R0011 - Personal Effects Storage

No Asbestos

B00H - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00D/R0006/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00H - R0013 - Movement

No Asbestos

B00H - R0014 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4173/B00D/R0006/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00H - R0015 - Personal Effects Storage

No Asbestos

B00H - R0016 - Personal Effects Storage

No Asbestos

B00H - R0017 - Personal Effects Storage

No Asbestos

B00H - R0018 - Movement

No Asbestos

B00H - R0019 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00H - R0020 - Movement

No Asbestos

B00H - R0021 - Movement

No Asbestos

B00H - R0022 - Movement

No Asbestos

B00H - R0023 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Communal Facilities/Pupil Facilities - 1991 - Brick/Block (Brick/Block)

Exterior

Awnings	Compressed AC Sheet 4173/B00I/Awnings/S24					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00I - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 4173/B00I/R0001/Wall Linings Internal/S17					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00I - R0002 - Plant

Wall Linings Internal	Flat AC Sheeting 4173/B00I/R0001/Wall Linings Internal/S17					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00I - R0003 - Shower/Change

Wall Linings Internal	Flat AC Sheeting 4173/B00I/R0001/Wall Linings Internal/S17					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00I - R0004 - Movement

No Asbestos

B00I - R0005 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 4173/B00I/R0001/Wall Linings Internal/S17					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

Partition Walls (Cubicles)	Compressed AC Sheet 4173/B00I/R0005/Partition Walls (Cubicles)/S18					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00I - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 4173/B00I/R0006/Wall Linings Internal/S19					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

Wall Linings Internal	Flat AC Sheeting 4173/B00I/R0006/Wall Linings Internal/S19					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00I - R0007 - Canteen

Floor Coverings Res/Textile	Vinyl Sheet 4173/B00I/R0007/Floor Coverings Res/Textile/S20					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00I - R0008 - Uniform Shop

Floor Coverings Res/Textile	Vinyl Sheet 4173/B00I/R0007/Floor Coverings Res/Textile/S20					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00I - R0009 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Sheet 4173/B00I/R0007/Floor Coverings Res/Textile/S20					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00I - R0010 - Sports Store

No Asbestos

B00I - R0011 - Plant

No Asbestos

B00I - R0012 - Disabled Toilet

No Asbestos

B00I - R0014 - Music Store

Ceiling Structures/Linings	Flat AC Sheeting 4173/B00I/R0006/Wall Linings Internal/S19					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00I - R0015 - Communal Space

Ceiling Structures/Linings	Flat AC Sheeting 4173/B00I/R0006/Wall Linings Internal/S19					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00I - R0016 - Hall Chair Store						
No Asbestos						
B00I - R0017 - Toilets - Boys						
Wall Linings Internal	Flat AC Sheeting		4173/B00I/R0001/Wall Linings Internal/S17			No Asbestos Detected
B00I - R0018 - Distribution Board						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00I - R0019 - Movement						
No Asbestos						
B00I - R0020 - Movement						
Wall Linings Internal	Flat AC Sheeting		4173/B00I/R0006/Wall Linings Internal/S19			No Asbestos Detected
B00I - R0021 - Raised Platform						
No Asbestos						
B00I - R0022 - Hall Chair Store						
No Asbestos						
B00I - R0023 - Shower/Change						
Wall Linings Internal	Flat AC Sheeting		4173/B00I/R0001/Wall Linings Internal/S17			No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet		4173/B00I/R0005/Partition Walls (Cubicles)/S18			No Asbestos Detected
B00I - R0024 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Building Services - 2006 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00L - R0001 - General Assistant/Bulk Store

No Asbestos

B00L - R0002 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 2016 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00M - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017