


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lalor Park Public School (4191)
Region : Western Sydney
State Electorate : Blacktown
Local Government Area : Blacktown

Initial Survey : Noel Arnold & Associates : 21 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

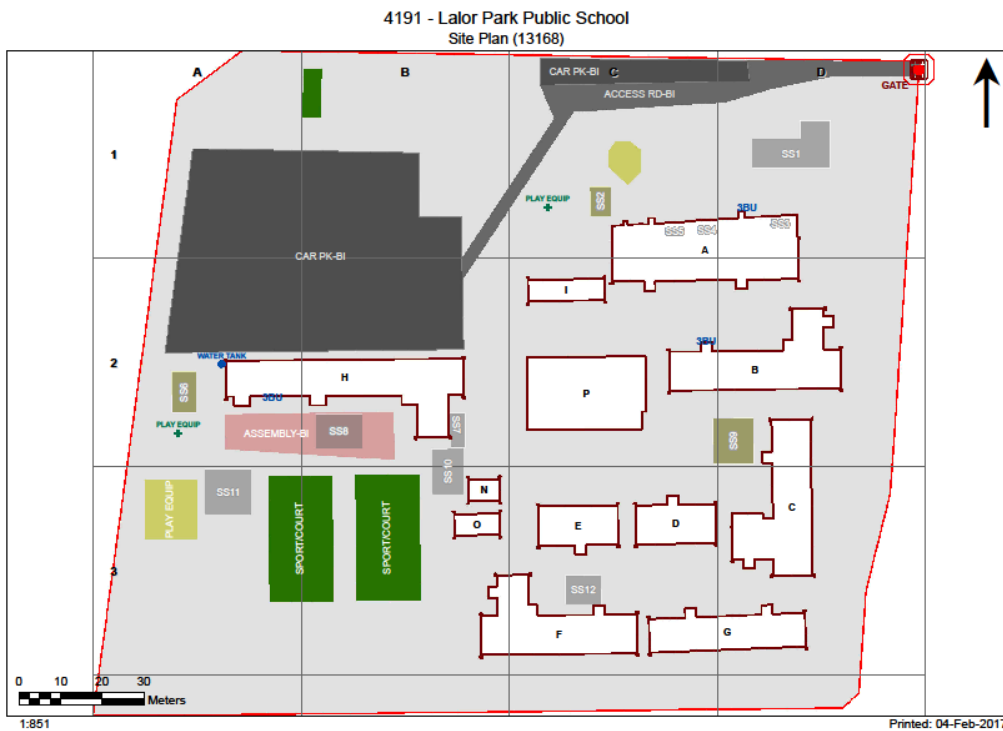

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Pre-School Facilities - 1958 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00L/Eaves Linings/S2	150m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4191/B00A/Underfloor Voids/S10	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00A - R0001 - External Movement	No Asbestos					
B00A - R0002 - Home Base	No Asbestos					
B00A - R0003 - Home Base Store	No Asbestos					
B00A - R0004 - Toilets - Boys/Girls	No Asbestos					
B00A - R0005 - Personal Effects Storage	No Asbestos					
B00A - R0006 - Movement	No Asbestos					
B00A - R0007 - Movement	No Asbestos					
B00A - R0008 - Personal Effects Storage	No Asbestos					
B00A - R0009 - Toilets - Boys/Girls	No Asbestos					
B00A - R0010 - Home Base Store	No Asbestos					
B00A - R0011 - Home Base	No Asbestos					
B00A - R0012 - External Movement	No Asbestos					
B00A - R0013 - External Movement	No Asbestos					
B00A - R0014 - Home Base	No Asbestos					
B00A - R0015 - Personal Effects Storage	No Asbestos					
B00A - R0016 - Staff Kitchen	No Asbestos					
B00A - R0017 - Movement	No Asbestos					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0018 - Movement						
No Asbestos						
B00A - R0019 - General Storeroom - Pre						
No Asbestos						
B00A - R0020 - Practical Activities - Pre						
No Asbestos						
B00A - R0021 - Personal Effects - Pre						
No Asbestos						
B00A - R0022 - Toilets - Boys/Girls - Pre						
No Asbestos						
B00A - R0023 - Home Base - Pre						
No Asbestos						
B00A - R0024 - Practical Activities - Pre						
No Asbestos						
B00A - R0025 - Staff Room - Pre						
No Asbestos						
B00A - R0027 - External Movement						
No Asbestos						
B00A - R0028 - External Movement						
No Asbestos						
B00A - R0029 - External Movement						
No Asbestos						
B00A - R0030 - Outdoor Learning Area						
No Asbestos						
B00A - R0031 - Staff Toilet - Pre						
Wall Linings Internal	Flat AC Sheeting					
	4191/B00A/R0031/Wall Linings Internal/S5					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Other-Community Use - 1958 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00B/Eaves Linings/S7	200m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4191/B00B/Underfloor Voids/S11	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Practical Activities - 1hb

No Asbestos

B00B - R0003 - Staff Room Annexe

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - General Storeroom

No Asbestos

B00B - R0006 - Staff Room Annexe

No Asbestos

B00B - R0007 - Personal Effects Storage

No Asbestos

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - Home Base

No Asbestos

B00B - R0010 - Home Base Store

No Asbestos

B00B - R0011 - Home Base

No Asbestos

B00B - R0012 - Home Base Store

No Asbestos

B00B - R0013 - Home Base Store

No Asbestos

B00B - R0014 - Movement

No Asbestos

B00B - R0015 - Other-Community Use

No Asbestos

B00B - R0016 - Other-Community Use

No Asbestos

B00B - R0017 - Community Clinic

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0018 - Movement						
No Asbestos						
B00B - R0019 - Movement						
No Asbestos						
B00B - R0020 - General Storeroom						
No Asbestos						
B00B - R0021 - Practical Activities - 1hb						
No Asbestos						
B00B - R0022 - Staff Toilet						
No Asbestos						
B00B - R0023 - General Storeroom						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1958 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00B/Eaves Linings/S7	200m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4191/B00C/Underfloor Voids/S12	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00C - R0001 - Home Base

No Asbestos

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0003 - Personal Effects Storage

No Asbestos

B00C - R0004 - Movement

No Asbestos

B00C - R0005 - Movement

No Asbestos

B00C - R0006 - Personal Effects Storage

No Asbestos

B00C - R0007 - General Storeroom

No Asbestos

B00C - R0008 - Communal Space

No Asbestos

B00C - R0009 - Raised Platform

No Asbestos

B00C - R0010 - General Storeroom

No Asbestos

B00C - R0011 - Personal Effects Storage

No Asbestos

B00C - R0012 - Movement

No Asbestos

B00C - R0013 - Personal Effects Storage

No Asbestos

B00C - R0014 - Home Base Store

No Asbestos

B00C - R0015 - Home Base

No Asbestos

B00C - R0016 - Staff Room Annexe

No Asbestos

B00C - R0017 - Canteen Office/Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0018 - Canteen						
No Asbestos						
B00C - R0019 - Canteen Office/Store						
No Asbestos						
B00C - R0020 - Canteen Office/Store						
No Asbestos						
B00C - R0021 - Movement						
No Asbestos						
B00C - R0022 - Cleaning Distributed Store						
No Asbestos						
B00C - R0023 - Staff Toilet						
No Asbestos						
B00C - R0024 - Movement						
No Asbestos						
B00C - R0025 - Movement						
No Asbestos						
B00C - R0026 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Support Unit/General Learning - 1958 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00B/Eaves Linings/S7	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00D - R0001 - Home Base - M

No Asbestos

B00D - R0002 - Toilet - M

No Asbestos

B00D - R0003 - Home Base Store - M

No Asbestos

B00D - R0004 - Movement

Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4191/B00D/R0004/Electrical Backing Board/S16					Chrysotile (white asbestos)

B00D - R0005 - Movement

No Asbestos

B00D - R0006 - Personal Effects Storage

No Asbestos

B00D - R0007 - Home Base Store

No Asbestos

B00D - R0008 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1958 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00B/Eaves Linings/S7	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base Store

No Asbestos

B00E - R0003 - Personal Effects Storage

No Asbestos

B00E - R0004 - Movement

Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4191/B00E/R0004/Electrical Backing Board/S17					Chrysotile (white asbestos)

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - Personal Effects Storage

No Asbestos

B00E - R0007 - Home Base Store

No Asbestos

B00E - R0008 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Staff Facilities - 1958 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00B/Eaves Linings/S7	150m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00F - R0001 - Home Base

No Asbestos

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - General Storeroom

No Asbestos

B00F - R0004 - Movement

No Asbestos

B00F - R0005 - Movement

No Asbestos

B00F - R0006 - Personal Effects Storage

No Asbestos

B00F - R0007 - Home Base Store

No Asbestos

B00F - R0008 - Practical Activities - 1hb

No Asbestos

B00F - R0009 - Practical Activities - 1hb

No Asbestos

B00F - R0010 - Home Base Store

No Asbestos

B00F - R0011 - Personal Effects Storage

No Asbestos

B00F - R0012 - Personal Effects Storage

No Asbestos

B00F - R0013 - Home Base Store

No Asbestos

B00F - R0014 - Home Base

No Asbestos

B00F - R0015 - Staff Room Annexe

No Asbestos

B00F - R0016 - Movement

No Asbestos

B00F - R0017 - Movement

No Asbestos

B00F - R0018 - Staff Toilet

No Asbestos

B00F - R0019 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00F - R0020 - Staff Toilet						
No Asbestos						
B00F - R0021 - Staff Room						
No Asbestos						
B00F - R0022 - Movement						
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4191/B00F/R0022/Electrical Backing Board/S18						Chrysotile (white asbestos)
B00F - R0023 - Cleaning Distributed Store						
No Asbestos						
B00F - R0024 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Other-D.E.C. Admin - 1958 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00B/Eaves Linings/S7	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	Flat AC Sheeting 4191/B00G/Underfloor Voids/S13	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Crocidolite (blue asbestos)

Interior

B00G - R0001 - Other - Regional Use

No Asbestos

B00G - R0002 - Other - Regional Use

No Asbestos

B00G - R0003 - Other - Regional Use

No Asbestos

B00G - R0004 - Other - Regional Use

No Asbestos

B00G - R0005 - Other - Regional Use

No Asbestos

B00G - R0006 - Withdrawal Space - 1hb

No Asbestos

B00G - R0007 - Movement

No Asbestos

B00G - R0008 - Home Base Store

No Asbestos

B00G - R0009 - Home Base

No Asbestos

B00G - R0010 - Home Base

No Asbestos

B00G - R0011 - Home Base Store

No Asbestos

B00G - R0012 - Personal Effects Storage

No Asbestos

B00G - R0013 - Movement

No Asbestos

B00G - R0014 - Movement

No Asbestos

B00G - R0015 - Personal Effects Storage

No Asbestos

B00G - R0016 - Home Base Store

No Asbestos

B00G - R0017 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration/Library - 1958 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00B/Eaves Linings/S7	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4191/B00H/Underfloor Voids/S14	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior

B00H - R0002 - Staff Toilet

No Asbestos

B00H - R0003 - Staff Room Annexe

No Asbestos

B00H - R0004 - Entry Vestibule

No Asbestos

B00H - R0005 - Movement

No Asbestos

B00H - R0006 - Principal

No Asbestos

B00H - R0007 - Staff Toilet

No Asbestos

B00H - R0008 - Interview

No Asbestos

B00H - R0009 - Movement

No Asbestos

B00H - R0010 - Cleaning Distributed Store

No Asbestos

B00H - R0011 - Movement

No Asbestos

B00H - R0012 - External Movement

No Asbestos

B00H - R0013 - Movement

No Asbestos

B00H - R0014 - Clerical Office

No Asbestos

B00H - R0015 - General Storeroom

No Asbestos

B00H - R0016 - General Storeroom

No Asbestos

B00H - R0017 - Clerical Office

No Asbestos

B00H - R0018 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0019 - Sick Bay						
No Asbestos						
B00H - R0020 - General Storeroom						
No Asbestos						
B00H - R0021 - Sports Store						
No Asbestos						
B00H - R0022 - Movement						
No Asbestos						
B00H - R0023 - External Movement						
No Asbestos						
B00H - R0024 - Personal Effects Storage						
No Asbestos						
B00H - R0025 - Home Base Store						
No Asbestos						
B00H - R0026 - Home Base						
No Asbestos						
B00H - R0027 - Home Base						
No Asbestos						
B00H - R0028 - Home Base Store						
No Asbestos						
B00H - R0029 - Personal Effects Storage						
No Asbestos						
B00H - R0030 - Movement						
No Asbestos						
B00H - R0031 - External Movement						
No Asbestos						
B00H - R0032 - Craft Store						
No Asbestos						
B00H - R0033 - Staff Room						
No Asbestos						
B00H - R0034 - Staff Kitchen						
No Asbestos						
B00H - R0036 - Security Store						
No Asbestos						
B00H - R0037 - Stairs						
No Asbestos						
B00H - R0038 - Stairs						
No Asbestos						
B00H - R0039 - Stairs						
No Asbestos						
B00H - R0040 - Distribution Board						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00H - R1001 - Other - Regional Use						
Floor Coverings Res/Textile	Vinyl Tiles	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4191/B00H/R1018/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00H - R1002 - Other - Regional Use						
No Asbestos						
B00H - R1003 - Library Office/Workroom						
No Asbestos						
B00H - R1005 - Movement						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00H - R1007 - K.L.A. Store						
No Asbestos						
B00H - R1008 - Reading Area						
No Asbestos						
B00H - R1009 - K.L.A. Store						
No Asbestos						
B00H - R1010 - Personal Effects Storage						
No Asbestos						
B00H - R1011 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4191/B00H/R1018/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00H - R1012 - Personal Effects Storage						
No Asbestos						
B00H - R1013 - K.L.A. Store						
No Asbestos						
B00H - R1014 - Seminar/Study						
No Asbestos						
B00H - R1015 - Other - Regional Use						
No Asbestos						
B00H - R1016 - Other - Regional Use						
No Asbestos						
B00H - R1017 - General Storeroom						
No Asbestos						
B00H - R1018 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4191/B00H/R1018/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00H - R1019 - Stairs						
No Asbestos						
B00H - R1020 - Movement						
No Asbestos						
B00H - R1021 - Library Office/Workroom						
No Asbestos						
B00H - R1022 - Stairs						
No Asbestos						
B00H - R1023 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B001 - Pupil Facilities - 1958 - Concrete (Concrete)

Exterior

Eaves Linings	Flat AC Sheeting 4191/B00B/Eaves Linings/S7	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting 4191/B00A/Gable Verge Lining/S8					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4191/B00B/Underfloor Voids/S9	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	AC Fragments/Debris 4191/B00I/Ceiling Void/S15	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B001 - R0001 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting 4191/B00I/R0001/Ceiling Structures/Linings/S4	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 4191/B00I/R0001/Ceiling Structures/Linings/S4	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Pupil Facilities - 1958 - Concrete (Concrete)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4191/B00B/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting					No Asbestos Detected
	4191/B00A/Gable Verge Lining/S8					
Ceiling Void	No Asbestos Found					

Interior

B00N - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4191/B00M/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Pupil Facilities - 1958 - Concrete (Concrete)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4191/B00B/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting					No Asbestos Detected
	4191/B00A/Gable Verge Lining/S8					
Ceiling Void	No Asbestos Found					

Interior

B000 - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4191/B00M/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B000 - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4191/B00M/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00P - R0001 - Communal Space

No Asbestos

B00P - R0002 - Raised Platform

No Asbestos

B00P - R0003 - Movement

No Asbestos

B00P - R0004 - Ramp

No Asbestos

B00P - R0005 - Movement

No Asbestos

B00P - R0006 - Hall Chair Store

No Asbestos

B00P - R0007 - Communal/Performance Store

No Asbestos

B00P - R0008 - P.E. Store

No Asbestos

B00P - R0009 - Toilet - Lobby

No Asbestos

B00P - R0010 - Toilets - Girls

No Asbestos

B00P - R0011 - Sound Cupboard

No Asbestos

B00P - R0012 - Toilet - Lobby

No Asbestos

B00P - R0013 - Toilets - Boys

No Asbestos

B00P - R0014 - Cleaning Distributed Store

No Asbestos

B00P - R0015 - Disabled Shower/Toilet

No Asbestos

B00P - R0016 - Main Switch Board

No Asbestos

B00P - R0017 - Covered Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017