


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Plumpton House School (5754)
Region : Western Sydney
State Electorate : Mount DrUITt
Local Government Area : Blacktown

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Parsons Brinckerhoff : 03 - May - 2015

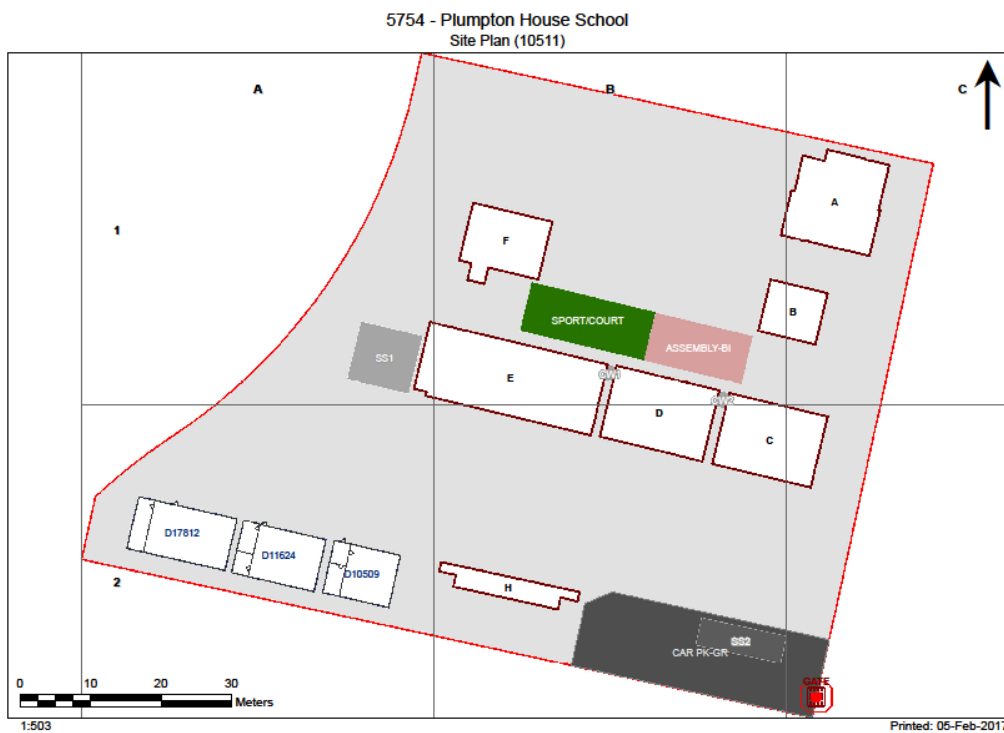

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Multi Purpose Facilities/Staff Facilities - 1923 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 5754/B00A/Eaves Linings/S6					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0003 - Movement**

No Asbestos

B00A - R0005 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 5754/B00A/R0004/Wall Linings Internal/S5	13m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 5754/B00A/R0005/Wall Linings Internal/S18	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R0006 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 5754/B00A/R0004/Wall Linings Internal/S5	13m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 5754/B00A/R0006/Wall Linings Internal/S19	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 5754/B00A/R0005/Wall Linings Internal/S18	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - General Storeroom

No Asbestos

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Staff Kitchen

No Asbestos

B00A - R0012 - Sick Bay

No Asbestos

B00A - R0013 - Deputy Principal - Type 1

No Asbestos

B00A - R0014 - Deputy Principal - Type 1

No Asbestos

B00A - R0015 - Principal

No Asbestos

B00A - R0016 - Movement

No Asbestos

B00A - R0017 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 5754/B00A/R0005/Wall Linings Internal/S18	10m2	North & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------	---	------	--------------	--------------------	---------	--------------------	------------------------------------

B00A - R0018 - Entry Vestibule

No Asbestos

B00A - R0019 - Clerical Office

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1998 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration - 1959 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 5754/B00C/Eaves Linings/S7					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0003 - Duplicating Workroom

No Asbestos

B00C - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 5754/B00D/R0001/Ceiling Structures/Linings/S3					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 5754/B00C/R0008/Wall Linings Internal/S12					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 5754/B00C/R0008/Ceiling Structures/Linings/S11	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0009 - Staff Room

Ceiling Structures/Linings	Flat AC Sheeting 5754/B00C/R0009/Ceiling Structures/Linings/S13	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	-------	--------------------	---------	---

B00C - R0010 - Staff Kitchen

No Asbestos

B00C - R0011 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 5754/B00C/R0009/Ceiling Structures/Linings/S13	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	-------	--------------------	---------	---

B00C - R0012 - Library Office/Workroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1959 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 5754/B00C/Eaves Linings/S7					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 5754/B00D/R0001/Ceiling Structures/Linings/S3					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 5754/B00C/R0008/Wall Linings Internal/S12					No Asbestos Detected

B00D - R0002 - General Learning Space

Wall Linings Internal	Flat AC Sheeting 5754/B00D/R0003/Wall Linings Internal/S2	20m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 5754/B00D/R0002/Ceiling Structures/Linings/S14	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0003 - General Learning Space

Wall Linings Internal	Flat AC Sheeting 5754/B00D/R0003/Wall Linings Internal/S2	20m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 5754/B00D/R0002/Ceiling Structures/Linings/S14	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1959 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 5754/B00D/R0001/Ceiling Structures/Linings/S3	No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 5754/B00E/R0001/Wall Linings Internal/S20	No Asbestos Detected

B00E - R0002 - Interview

No Asbestos

B00E - R0003 - Staff Room Annexe

No Asbestos

B00E - R0004 - Movement

No Asbestos

B00E - R0005 - General Learning Space

No Asbestos

B00E - R0006 - General Learning Space

No Asbestos

B00E - R0007 - General Storeroom

No Asbestos

B00E - R0008 - Cleaning Distributed Store

Floor Coverings Res/Textile	Compressed AC Sheet 5754/B00E/R0008/Floor Coverings Res/Textile/S1	No Asbestos Detected
--------------------------------	---	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Special Purpose - 1998 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	5754/B00F/Eaves Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	5m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5754/B00F/Gable Verge Lining/S9				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	5754/B00F/Underfloor Voids/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					

Interior**B00F - R0001 - Special Programs Room**

No Asbestos

B00F - R0002 - Craft Store

No Asbestos

B00F - R0003 - Movement

No Asbestos

B00F - R0004 - Craft Store

No Asbestos

B00F - R0005 - Craft Store

No Asbestos

B00F - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5754/B00F/R0006/Ceiling Structures/Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
In-fill-panel	Flat AC Sheeting	<1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	5754/B00F/R0006/In-fill-panel/S16				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1959 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting 5754/B00H/R0001/Wall Linings Internal/S4					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00H - R0001 - Toilets - Girls**

Wall Linings Internal	Flat AC Sheeting 5754/B00H/R0001/Wall Linings Internal/S4					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 5754/B00H/R0001/Wall Linings Internal/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 5754/B00H/R0003/Ceiling Structures/Linings/S17					No Asbestos Detected

B00H - R0002 - Shower/Change

Wall Linings Internal	Flat AC Sheeting 5754/B00H/R0001/Wall Linings Internal/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 5754/B00H/R0003/Ceiling Structures/Linings/S17					No Asbestos Detected

B00H - R0003 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 5754/B00H/R0001/Wall Linings Internal/S4					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 5754/B00H/R0001/Wall Linings Internal/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 5754/B00H/R0003/Ceiling Structures/Linings/S17					No Asbestos Detected

B00H - R0004 - Shower/Change

Wall Linings Internal	Flat AC Sheeting 5754/B00H/R0001/Wall Linings Internal/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 5754/B00H/R0003/Ceiling Structures/Linings/S17					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10509 - Learning Unit - Standard/Withdrawal : Placement Date - 26/03/1998

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 711 - D11624 - Home Science/Art/Science Dem/Computer : Placement Date - 8/02/1999

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	14.4 m2

Interior

R1 - Computer Room

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	

R2 - Food Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	73 m2

R3 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos	
---------	---------------	------------------	--

OS 760 - D17812 - Woodwork/Store : Placement Date - 9/06/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Woodwork

No Asbestos Found.

R2 - Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

5754_ASB_221112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017