


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Albury West Public School (1019)
Region : Riverina
State Electorate : Albury
Local Government Area : Albury

Initial Survey : Noel Arnold & Associates : 14 - May - 2008
Reviewed By : Greencap-NAA : 07 - Jul - 2016

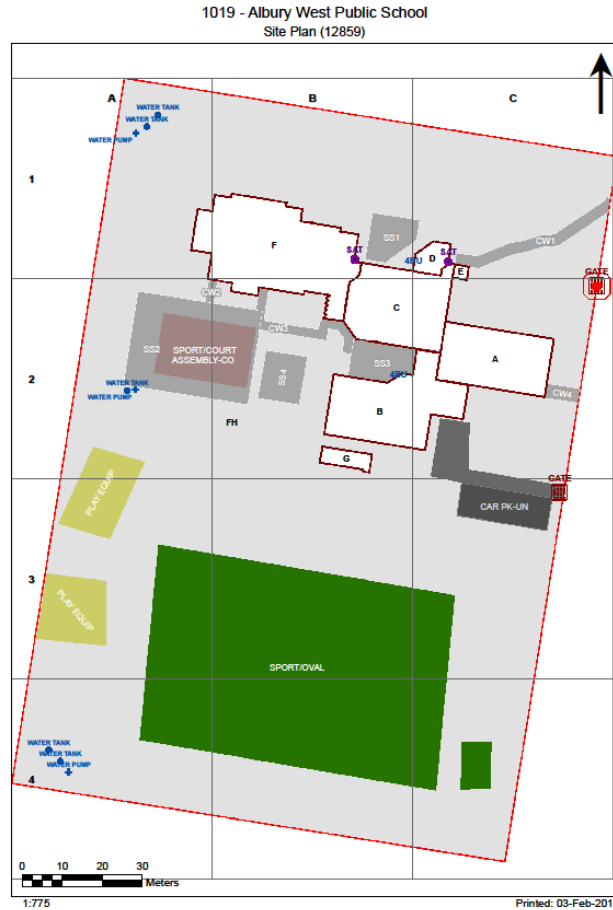

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1983 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area

- Area inaccessible

Ceiling Voids No Asbestos Found

Interior**B00A - R0001 - Principal (23.75 m2)**

No Asbestos

B00A - R0008 - Clerical Office (17.63 m2)

No Asbestos

B00A - R0009 - Duplicating Workroom (20.5 m2)

Floor Coverings Res/Textile Vinyl Tiles

1019/B00A/R0017/Floor Coverings Res/Textile/S1

No Asbestos Detected

Floor Coverings Res/Textile Adhesive

1019/B00A/R0017/Floor Coverings Res/Textile/S6

No Asbestos Detected

B00A - R0010 - General Storeroom (14.1 m2)

Floor Coverings Res/Textile Vinyl Tiles

1019/B00A/R0017/Floor Coverings Res/Textile/S1

No Asbestos Detected

Floor Coverings Res/Textile Adhesive

1019/B00A/R0017/Floor Coverings Res/Textile/S6

No Asbestos Detected

Ceiling Structures/Linings Flat AC Sheeting 15m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

1019/B00A/R0010/Ceiling Structures/Linings/S7

Chrysotile (white asbestos)

B00A - R0011 - Staff Room (56.85 m2)

No Asbestos

B00A - R0012 - Movement (6.13 m2)

No Asbestos

B00A - R0013 - Staff Toilet (6.61 m2)

Partition Walls (Cubicles) Compressed AC Sheet 2m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

1019/B00B/R0011/Partition Walls (Cubicles)/S5

Chrysotile (white asbestos)

Ceiling Structures/Linings Flat AC Sheeting 7m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

1019/B00A/R0010/Ceiling Structures/Linings/S7

Chrysotile (white asbestos)

B00A - R0014 - Cleaning Supplies (0.7 m2)

Ceiling Structures/Linings Flat AC Sheeting 1m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

1019/B00A/R0010/Ceiling Structures/Linings/S7

Chrysotile (white asbestos)

B00A - R0015 - Staff Toilet (6.66 m2)

Partition Walls (Cubicles) Compressed AC Sheet 2m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

1019/B00B/R0011/Partition Walls (Cubicles)/S5

Chrysotile (white asbestos)

Ceiling Structures/Linings Flat AC Sheeting 7m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

1019/B00A/R0010/Ceiling Structures/Linings/S7

Chrysotile (white asbestos)

B00A - R0016 - Interview (12.5 m2)

No Asbestos

B00A - R0017 - Sick Bay (9.65 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
			1019/B00A/R0017/Floor Coverings Res/Textile/S1			No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
			1019/B00A/R0017/Floor Coverings Res/Textile/S6			No Asbestos Detected
B00A - R0018 - Staff Room Annexe (11.57 m2)						
No Asbestos						
B00A - R0019 - Staff Room Annexe (11.67 m2)						
No Asbestos						
B00A - R0020 - Movement (37.83 m2)						
No Asbestos						
B00A - R0021 - Movement (2.76 m2)						
No Asbestos						
B00A - R0022 - Movement (49.01 m2)						
No Asbestos						
B00A - R0023 - Movement (48.53 m2)						
No Asbestos						
B00A - R0024 - Uniform Shop (14.43 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Communal Facilities/Pupil Facilities - 1983 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
- Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00B - R0002 - Movement (14.93 m2)

No Asbestos

B00B - R0003 - General Assistant/Bulk Store (7.01 m2)

Floor Coverings Res/Textile Vinyl Tiles
1019/B00A/R0017/Floor Coverings Res/Textile/S1 **No Asbestos Detected**

Ceiling Structures/Linings Flat AC Sheeting 8m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00B - R0004 - General Storeroom (6.94 m2)

Ceiling Structures/Linings Flat AC Sheeting 7m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00B - R0005 - Garden Store (13.23 m2)

Ceiling Structures/Linings Flat AC Sheeting 14m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00B - R0006 - Garden Store (8.72 m2)

Ceiling Structures/Linings Flat AC Sheeting 9m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00B - R0008 - Hall Chair Store (6.23 m2)

Ceiling Structures/Linings Flat AC Sheeting 7m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00B - R0009 - Sports Store (17.74 m2)

Ceiling Structures/Linings Flat AC Sheeting 18m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00B - R0010 - P.E. Store (12.7 m2)

Floor Coverings Res/Textile Vinyl Tiles
1019/B00A/R0017/Floor Coverings Res/Textile/S1 **No Asbestos Detected**

Ceiling Structures/Linings Flat AC Sheeting 13m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

Floor Coverings Res/Textile Adhesive
1019/B00A/R0017/Floor Coverings Res/Textile/S6 **No Asbestos Detected**

B00B - R0011 - Toilets - Girls (10.47 m2)

Partition Walls (Cubicles) Compressed AC Sheet 5m2 Variable positions Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0011/Partition Walls (Cubicles)/S5 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Flat AC Sheeting 11m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00B - R0012 - Toilets - Boys (10.27 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0011/Partition Walls (Cubicles)/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00B - R0013 - Communal Space (144.69 m2)						
No Asbestos						
B00B - R0014 - Movement (6.33 m2)						
No Asbestos						
B00B - R0015 - Hall Chair Store (5.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00B - R0016 - Raised Platform (66.94 m2)						
No Asbestos						
B00B - R0017 - Cleaning Supplies (2.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00B - R0018 - Movement (50.57 m2)						
No Asbestos						
B00B - R0019 - Canteen (31.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	5m2	Above Roller doors	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00B - R0020 - Distribution Board (1.09 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00B - R0021 - Movement (5.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00B - R0022 - Staff Shower/Change (3.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00B - R0024 - Sports Store (8.64 m2)						
No Asbestos						
B00B - R0025 - Movement (20.55 m2)						
No Asbestos						
B00B - R0026 - Canteen Office/Store (11.17 m2)						
No Asbestos						
B00B - R0027 - General Storeroom (16.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	1019/B00A/R0017/Floor Coverings Res/Textile/S1				No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings
Res/Textile

Adhesive

1019/B00A/R0017/Floor Coverings Res/Textile/S6

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1983 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground
Non Accessible Area
- Area inaccessible

Ceiling Voids - Raked Ceiling
No Asbestos Found

Interior

B00C - R0001 - Toilets - Boys (3.36 m2)

Partition Walls (Cubicles) Compressed AC Sheet 4m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0011/Partition Walls (Cubicles)/S5 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Flat AC Sheeting 4m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00C - R0002 - Toilets - Girls (3.36 m2)

Partition Walls (Cubicles) Compressed AC Sheet 4m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0011/Partition Walls (Cubicles)/S5 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Flat AC Sheeting 4m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00C - R0003 - Main Switch Board (4.84 m2)

Ceiling Structures/Linings Flat AC Sheeting 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

Electrical Mounting Board Resinous Board 1Unit South facing Good Condition (1) Low (1) Low Priority (2-3)

Assumed Asbestos - Electrical Hazard

B00C - R0004 - Reading Area (159.74 m2)

No Asbestos

B00C - R0005 - Communications Room (12.28 m2)

No Asbestos

B00C - R0006 - Library Office/Workroom (20.06 m2)

No Asbestos

B00C - R0010 - Movement (123.06 m2)

No Asbestos

B00C - R0012 - Stairs (5.21 m2)

No Asbestos

B00C - R0013 - Special Programs Room (51.25 m2)

No Asbestos

B00C - R0014 - Movement (15.7 m2)

No Asbestos

B00C - R0015 - Resource/Toy Space (19.78 m2)

No Asbestos

B00C - R0016 - General Storeroom (19.55 m2)

No Asbestos

B00C - R0017 - General Storeroom (1.13 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Tiered Learning - 1983 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids - Raked Ceiling Non Accessible Area
 - Area inaccessible

Interior

B00D - R0001 - Special Programs Room (49.44 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 1983 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00E - R0001 - General Storeroom (8.18 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1983 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area

- Area inaccessible

Ceiling Voids - Raked Ceiling Non Accessible Area

- Area inaccessible

Interior**B00F - R0001 - Home Base Store (6.31 m2)**

No Asbestos

B00F - R0002 - Security Store (19.91 m2)

Floor Coverings Res/Textile Vinyl Tiles

1019/B00A/R0017/Floor Coverings Res/Textile/S1

No Asbestos Detected

Floor Coverings Res/Textile Adhesive

1019/B00A/R0017/Floor Coverings Res/Textile/S6

No Asbestos Detected

B00F - R0003 - Personal Effects Storage (3.93 m2)

Ceiling Structures/Linings Vermiculite

1019/B00F/R0005/Ceiling Structures/Linings/S4

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0004 - Movement (2.24 m2)

No Asbestos

B00F - R0005 - Movement (178.5 m2)

Ceiling Structures/Linings Vermiculite

1019/B00F/R0005/Ceiling Structures/Linings/S4

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0006 - Cleaning Supplies (1.95 m2)

No Asbestos

B00F - R0007 - No Access (28.77 m2)

No Asbestos

B00F - R0008 - Movement (17.12 m2)

No Asbestos

B00F - R0009 - Toilets - Girls (14.69 m2)

Partition Walls (Cubicles) Compressed AC Sheet

10m2

West facing

Good Condition (1)

Low (1) Low Priority (2-3)

1019/B00B/R0011/Partition Walls (Cubicles)/S5

Chrysotile (white asbestos)

Ceiling Structures/Linings Flat AC Sheeting

15m2

All surfaces

Good Condition (1)

Low (1) Low Priority (2-3)

1019/B00B/R0017/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00F - R0010 - Toilets - Boys (14.74 m2)

Partition Walls (Cubicles) Compressed AC Sheet

5m2

East facing

Good Condition (1)

Low (1) Low Priority (2-3)

1019/B00B/R0011/Partition Walls (Cubicles)/S5

Chrysotile (white asbestos)

Ceiling Structures/Linings Flat AC Sheeting

15m2

All surfaces

Good Condition (1)

Low (1) Low Priority (2-3)

1019/B00B/R0017/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00F - R0011 - Staff Room Annexe (15.67 m2)

Ceiling Structures/Linings Vermiculite

1019/B00F/R0005/Ceiling Structures/Linings/S4

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0012 - Movement (27.15 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0013 - General Storeroom (6.88 m2)						
No Asbestos						
B00F - R0014 - Home Base Store (6.02 m2)						
No Asbestos						
B00F - R0015 - Personal Effects Storage (4.04 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0016 - Cleaning Supplies (1.58 m2)						
No Asbestos						
B00F - R0017 - Home Base (57.04 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0018 - Withdrawal Space - 1hb (14.12 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0019 - Home Base (54.74 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0020 - Personal Effects Storage (4.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0021 - Home Base Store (4.4 m2)						
No Asbestos						
B00F - R0022 - Home Base Store (4.4 m2)						
No Asbestos						
B00F - R0023 - Personal Effects Storage (4.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0024 - Home Base (55.47 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0025 - Withdrawal Space - 1hb (14 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0026 - Home Base (55.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0027 - Distribution Board (1.12 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00F - R0028 - Personal Effects Storage (3.94 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	1019/B00F/R0005/Ceiling Structures/Linings/S4				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00F - R0029 - Home Base Store (4.65 m2)						
No Asbestos						
B00F - R0030 - General Storeroom (1.77 m2)						
Ceiling Structures/Linings	Vermiculite	1019/B00F/R0005/Ceiling Structures/Linings/S4				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00F - R0031 - Home Base (55.37 m2)						
Ceiling Structures/Linings	Vermiculite	1019/B00F/R0005/Ceiling Structures/Linings/S4				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00F - R0032 - Movement (1.37 m2)						
No Asbestos						
B00F - R0033 - Movement (11.42 m2)						
No Asbestos						
B00F - R0034 - Movement (9.8 m2)						
No Asbestos						
B00F - R1001 - Withdrawal Space - 1hb (15.68 m2)						
No Asbestos						
B00F - R1002 - Home Base Store (5.32 m2)						
No Asbestos						
B00F - R1003 - Personal Effects Storage (3.93 m2)						
Ceiling Structures/Linings	Vermiculite	1019/B00F/R0005/Ceiling Structures/Linings/S4				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00F - R1004 - Disabled Toilet (4.76 m2)						
Ceiling Structures/Linings	Vermiculite	1019/B00F/R0005/Ceiling Structures/Linings/S4				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00F - R1005 - Movement (6.8 m2)						
No Asbestos						
B00F - R1006 - Movement (182.44 m2)						
No Asbestos						
B00F - R1007 - Toilets - Girls (14.9 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0011/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00F - R1008 - Toilets - Boys (14.89 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0011/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00F - R1009 - Staff Room Annexe (15.83 m2)						
No Asbestos						
B00F - R1010 - Kiln Room (18.54 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R1011 - General Storeroom (6.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00F - R1012 - Home Base Store (5.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00F - R1013 - Personal Effects Storage (4.12 m2)						
No Asbestos						
B00F - R1014 - Cleaning Supplies (1.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00F - R1015 - Home Base (57.75 m2)						
No Asbestos						
B00F - R1016 - Withdrawal Space - 1hb (14.11 m2)						
No Asbestos						
B00F - R1017 - Home Base (56.06 m2)						
No Asbestos						
B00F - R1018 - Personal Effects Storage (4.12 m2)						
No Asbestos						
B00F - R1019 - Home Base Store (4.5 m2)						
No Asbestos						
B00F - R1020 - Home Base Store (4.43 m2)						
No Asbestos						
B00F - R1021 - Personal Effects Storage (4.88 m2)						
No Asbestos						
B00F - R1022 - Home Base (54.98 m2)						
No Asbestos						
B00F - R1023 - Withdrawal Space - 1hb (14.07 m2)						
Ceiling Structures/Linings	Vermiculite					
1019/B00F/R0005/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00F - R1024 - Home Base (56.3 m2)						
No Asbestos						
B00F - R1025 - Distribution Board (1.12 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00F - R1026 - Personal Effects Storage (3.91 m2)						
No Asbestos						
B00F - R1027 - Home Base Store (4.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00F - R1028 - General Storeroom (1.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1019/B00B/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00F - R1029 - Home Base (56.62 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - R1030 - Movement (6.76 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - Garden Store (12.74 m2)

No Asbestos

B00G - R0002 - General Assistant/Bulk Store (15.77 m2)

No Asbestos

B00G - R0003 - Sports Store (12.92 m2)

No Asbestos

B00G - R0004 - Distribution Board (0.43 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017