


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ashfield Public School (1065)
Region : Sydney
State Electorate : Summer Hill
Local Government Area : Ashfield

Initial Survey : Noel Arnold & Associates : 04 - Jun - 2008
Reviewed By : AECOM : 29 - Oct - 2014

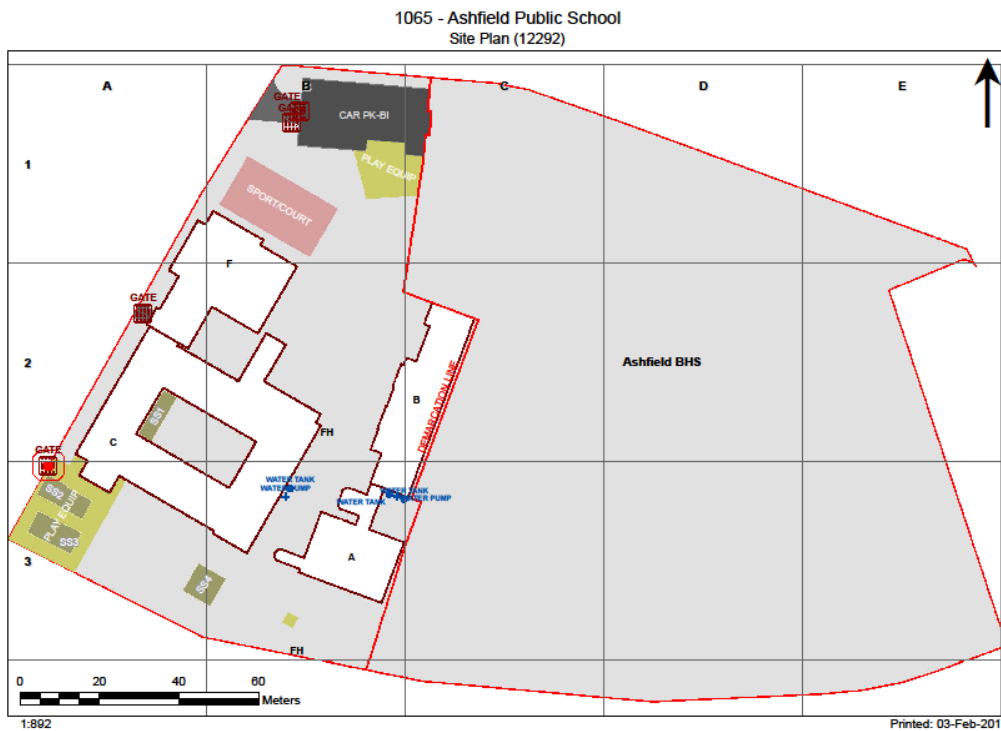

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found
Electrical Backing Board	Non Accessible Area - Electrical Hazard

Interior

B00A - R0001 - Sports Store (8.05 m2)

No Asbestos

B00A - R0003 - Movement (18.14 m2)

No Asbestos

B00A - R0005 - Distribution Board (1.67 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	Backing board	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	---------------	--------------------	---------	--------------------

Assumed Asbestos - Live electrical board

B00A - R0006 - Staff Room (69.29 m2)

Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1065/B00A/R1006/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00A - R0007 - Staff Toilet (3.12 m2)

No Asbestos

B00A - R0008 - Staff Toilet (2.6 m2)

No Asbestos

B00A - R0009 - Cleaning Distributed Store (4.32 m2)

No Asbestos

B00A - R0010 - Principal (19.38 m2)

Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0011 - Interview (12.64 m2)

Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0013 - Security Store (14.59 m2)

Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1065/B00A/R1006/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00A - R0016 - Clerical Office (13.02 m2)

Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0017 - Sick Bay (8.46 m2)

Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1065/B00A/R1006/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00A - R0018 - Deputy Principal (13.06 m2)						
Ceiling Structures/Linings	Vermiculite					
1065/B00A/R1006/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0019 - External Movement (7.95 m2)						
No Asbestos						
B00A - R0020 - General Assistant/Bulk Store (9.16 m2)						
No Asbestos						
B00A - R0021 - Cleaning Supplies (7.77 m2)						
Ceiling Structures/Linings	Vermiculite					
1065/B00A/R1006/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1065/B00A/R1006/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00A - R0022 - Sports Store (9.93 m2)						
No Asbestos						
B00A - R0023 - Duplicating Workroom (13.97 m2)						
Ceiling Structures/Linings	Vermiculite					
1065/B00A/R1006/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1065/B00A/R1006/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00A - R0024 - External Movement (59.67 m2)						
No Asbestos						
B00A - R0025 - External Movement (58.01 m2)						
No Asbestos						
B00A - R0026 - Stairs (9.46 m2)						
No Asbestos						
B00A - R0027 - Entry Vestibule (10.54 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0028 - Movement (37.3 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1002 - Entry Vestibule (11.91 m2)						
Ceiling Structures/Linings	Vermiculite					
1065/B00A/R1006/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1003 - Distribution Board (1.79 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite					
1065/B00A/R1006/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Electrical Mounting Board	Resinous Board	1Unit	East Facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R1004 - Toilets - Girls (3.34 m2)						
Ceiling Structures/Linings	Vermiculite					
1065/B00A/R1006/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1005 - Cleaning Distributed Store (0.83 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - Library Office/Workroom (21.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1065/B00A/R1006/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - Library Office/Workroom (8.32 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - Communications Room (12.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1065/B00A/R1006/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1009 - Seminar/Study (11.85 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1010 - Seminar/Study (12.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1011 - Reading Area (53.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1012 - Library Office/Workroom (12.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1013 - Reading Area (175.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1014 - External Movement (7.9 m2)						
No Asbestos						
B00A - R1015 - Cleaning Distributed Store (2.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1016 - Toilets - Boys (3.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00A/R1006/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1017 - External Movement (38.13 m2)						
No Asbestos						
B00A - R1018 - Stairs (9.81 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1019 - Stairs (30.49 m2)

No Asbestos

B00A - R2001 - External Movement (31.53 m2)

No Asbestos

B00A - R2002 - Movement (23.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	North facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1065/B00A/R1006/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B00A - R2007 - General Storeroom (7.65 m2)

No Asbestos

B00A - R2010 - External Movement (8.76 m2)

No Asbestos

B00A - R2013 - Movement (16.7 m2)

No Asbestos

B00A - R2014 - Stairs (26.56 m2)

No Asbestos

B00A - R2015 - Stairs (9.07 m2)

No Asbestos

B00A - R2016 - Home Base (51.28 m2)

No Asbestos

B00A - R2017 - Practical Activities - 1hb (18.25 m2)

No Asbestos

B00A - R2018 - Home Base (51.41 m2)

No Asbestos

B00A - R2019 - Practical Activities - 1hb (18.3 m2)

No Asbestos

B00A - R2020 - Practical Activities - 1hb (18.4 m2)

No Asbestos

B00A - R2021 - Home Base (51.39 m2)

No Asbestos

B00A - R2022 - Practical Activities - 1hb (18.37 m2)

No Asbestos

B00A - R2023 - Home Base (51.32 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1894 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00B - R0001 - Withdrawal Space - 1hb (18.81 m2)**

No Asbestos

B00B - R0002 - Practical Activities - 1hb (47.79 m2)

No Asbestos

B00B - R0004 - Home Base (45.58 m2)

No Asbestos

B00B - R0005 - Home Base (61.54 m2)

No Asbestos

B00B - R0007 - Home Base (47.2 m2)

No Asbestos

B00B - R0008 - Movement (28.82 m2)

Floor Coverings Res/Textile	Vinyl Tiles
1065/B00B/R0008/Floor Coverings Res/Textile/S3	

No Asbestos Detected**B00B - R0009 - Cleaning Supplies (10.56 m2)**

No Asbestos

B00B - R0010 - Movement (18.44 m2)

No Asbestos

B00B - R0011 - General Storeroom (3.62 m2)

No Asbestos

B00B - R0012 - General Storeroom (7.93 m2)

No Asbestos

B00B - R0013 - Toilets - Boys/Girls (4.22 m2)

No Asbestos

B00B - R0014 - Movement (52.44 m2)

No Asbestos

B00B - R0015 - Movement (1.7 m2)

No Asbestos

B00B - R0016 - Cleaning Distributed Store (5.48 m2)

No Asbestos

B00B - R0017 - Stairs (7.02 m2)

No Asbestos

B00B - R0018 - Stairs (2.64 m2)

No Asbestos

B00B - R0019 - Home Base (12.86 m2)

No Asbestos

B00B - R0020 - Home Base Store (8.51 m2)

No Asbestos

B00B - R0021 - Withdrawal Space - 2hb (11.94 m2)

No Asbestos

B00B - R0022 - Home Base (15.01 m2)

No Asbestos

B00B - R0023 - Home Base (18.5 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0024 - Home Base Store (9.44 m2)						
No Asbestos						
B00B - R0025 - Withdrawal Space - 2hb (10.98 m2)						
No Asbestos						
B00B - R0026 - Home Base (17.21 m2)						
No Asbestos						
B00B - R1001 - Craft Store (6.93 m2)						
No Asbestos						
B00B - R1002 - General Storeroom (9.57 m2)						
No Asbestos						
B00B - R1003 - Practical Activities - 1hb (49.51 m2)						
No Asbestos						
B00B - R1005 - Home Base (48.12 m2)						
No Asbestos						
B00B - R1008 - Home Base (49.67 m2)						
No Asbestos						
B00B - R1011 - Craft Store (14.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1065/B00B/R1011/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00B - R1012 - General Storeroom (14.32 m2)						
No Asbestos						
B00B - R1013 - Staff Toilet (2.12 m2)						
No Asbestos						
B00B - R1014 - Music Store (3.47 m2)						
No Asbestos						
B00B - R1016 - Movement (96.04 m2)						
No Asbestos						
B00B - R1017 - Stairs (12.38 m2)						
No Asbestos						
B00B - R1018 - Stairs (7.53 m2)						
No Asbestos						
B00B - R1019 - Home Base (61.38 m2)						
No Asbestos						
B00B - R1021 - Home Base (10.83 m2)						
No Asbestos						
B00B - R1022 - Home Base Store (9.14 m2)						
No Asbestos						
B00B - R1023 - Withdrawal Space - 2hb (12.1 m2)						
No Asbestos						
B00B - R1024 - Home Base (15.49 m2)						
No Asbestos						
B00B - R1025 - Special Programs Store (6.86 m2)						
No Asbestos						
B00B - R1026 - Withdrawal Space - 1hb (11.61 m2)						
No Asbestos						
B00B - R1027 - Special Programs Room - Type 1 (39.25 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - General Learning/Support Unit - 1970 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- No asbestos was found.					
Interior						
B00C - R0001 - Other-Community Use (3.57 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0002 - Other-Community Use (2.34 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0003 - Other-Community Use (7.4 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0004 - Cleaning Distributed Store (7.23 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0005 - Cleaning Supplies (4.55 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0006 - Distribution Board (1.13 m2)						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Electrical Mounting Board	Flat AC Sheeting	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
B00C - R0008 - Home Base Store (3.98 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0011 - Home Base Store (4.17 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0012 - Personal Effects Storage (9.12 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0013 - Toilets - Girls (35.37 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1065/B00C/R0026/Ceiling Structures/Linings/S7					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1065/B00C/R0014/Partition Walls (Cubicles)/S8					
	Chrysotile (white asbestos) , Amosite (brown asbestos)					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0014 - Toilets - Boys (35.47 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 1065/B00C/R0014/Partition Walls (Cubicles)/S8	16m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0016 - Home Base (87.07 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Sealed unit, live and in use
B00C - R0017 - Toilets - Boys/Girls (3.62 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0018 - Home Base Store (2.48 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0019 - Personal Effects Storage (3.28 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0020 - Movement (4.13 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0021 - Home Base (56.8 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Sealed unit, live and in use
B00C - R0022 - Home Base Store (7.14 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0023 - Personal Effects Storage (6.11 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0024 - Home Base (57.19 m2)						
Ceiling Structures/Linings	Vermiculite 1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Sealed unit, live and in use
B00C - R0025 - Home Base Store (6.47 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0026 - Personal Effects Storage (7.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0027 - Home Base Store - M (57.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	East facing, West facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Sealed unit, live and in use</i>						
B00C - R0028 - Home Base Store - M (4.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0029 - Toilet - M (5.21 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0030 - Movement (3.7 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0031 - Home Base - M (56.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, West facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Sealed unit, live and in use</i>						
B00C - R0032 - Home Base Store - M (4.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0033 - Home Base Store - M (5.03 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0034 - Personal Effects - M (4.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0035 - Home Base (56.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, West facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Sealed unit, live and in use</i>						
B00C - R0036 - Home Base Store (4.98 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0037 - Personal Effects Storage (8.53 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0038 - Other-Community Use (17.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0039 - Other-Community Use (8.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0040 - Other-Community Use (9.29 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0041 - Other-Community Use (3.85 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0042 - Other-Community Use (2.1 m2)						
Incinerate	Flat AC Sheeting	1Unit(s)	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Sealed unit - no access</i>						
B00C - R0043 - Other-Community Use (1.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0044 - Other-Community Use (21.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0045 - Other-Community Use (7.22 m2)						
No Asbestos						
B00C - R0049 - Other-Community Use (0.79 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0050 - Other-Community Use (3.73 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0051 - Other-Community Use (6.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0052 - Other-Community Use (3.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	1065/B00C/R0026/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0053 - Other-Community Use (6.82 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0057 - Other-Community Use (1.82 m2)						
No Asbestos						
B00C - R0058 - Other-Community Use (3.71 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0059 - Other-Community Use (78.29 m2)						
No Asbestos						
B00C - R0063 - External Movement (123.84 m2)						
No Asbestos						
B00C - R0064 - External Movement (51.8 m2)						
No Asbestos						
B00C - R0065 - General Storeroom - Pre (4.19 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0066 - General Storeroom - Pre (18.54 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0067 - Home Base - Pre (55.34 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0068 - Home Base - Pre (85.57 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0070 - Special Programs Room (16.05 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Sealed unit, live and in use</i>						
B00C - R0071 - Home Base (93.77 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	East facing, West facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Sealed unit, live and in use</i>						
B00C - R0072 - Practical Activities - 1hb (7.53 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0073 - Practical Activities - 1hb (8.29 m2)						
Ceiling Structures/Linings	Vermiculite		1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0074 - External Movement (14.58 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0075 - External Movement (226.03 m2)						
No Asbestos						
B00C - R0076 - External Movement (37.01 m2)						
Recently Modified Space	Requires Inspection					
B00C - R9003 - Canteen Office/Store (2.97 m2)						
Ceiling Structures/Linings	Vermiculite	1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R9004 - Canteen Office/Store (2.99 m2)						
Ceiling Structures/Linings	Vermiculite	1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R9006 - Distribution Board (0.38 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite	1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - live electrical board</i>						
B00C - R9010 - External Movement (30.87 m2)						
No Asbestos						
B00C - R9011 - Toilets - Girls (40.06 m2)						
Ceiling Structures/Linings	Vermiculite	1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1065/B00C/R0014/Partition Walls (Cubicles)/S8			<i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>			
B00C - R9012 - Toilets - Boys (25.97 m2)						
Ceiling Structures/Linings	Vermiculite	1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1065/B00C/R0014/Partition Walls (Cubicles)/S8			<i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>			
B00C - R9013 - Cleaning Distributed Store (7.61 m2)						
No Asbestos						
B00C - R9014 - Sports Store (29.32 m2)						
Ceiling Structures/Linings	Vermiculite	1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R9015 - General Assistant/Bulk Store (29.1 m2)						
Ceiling Structures/Linings	Vermiculite	1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R9016 - General Assistant/Bulk Store (81.35 m2)						
Ceiling Structures/Linings	Vermiculite	1065/B00C/R0026/Ceiling Structures/Linings/S7			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Communal Facilities/Pupil Facilities - 2001 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00F - R0001 - Disabled Toilet (5.74 m2)**

No Asbestos

B00F - R0002 - Cleaning Distributed Store (3.33 m2)

No Asbestos

B00F - R0003 - Communal Space (148.8 m2)

No Asbestos

B00F - R0004 - Covered Outdoor Learning Area (298.52 m2)

No Asbestos

B00F - R0005 - Canteen (38.73 m2)

No Asbestos

B00F - R0006 - Canteen Office/Store (13.88 m2)

No Asbestos

B00F - R0007 - Toilets - Boys (11.87 m2)

No Asbestos

B00F - R0008 - Communal/Performance Store (9.31 m2)

No Asbestos

B00F - R0009 - Distribution Board (0.57 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0010 - Movement (22.07 m2)

No Asbestos

B00F - R0011 - Raised Platform (39.03 m2)

No Asbestos

B00F - R0012 - Movement (12.58 m2)

No Asbestos

B00F - R0013 - Hall Chair Store (13.45 m2)

No Asbestos

B00F - R0014 - Cleaning Supplies (5.79 m2)

No Asbestos

B00F - R0015 - P.E. Store (9.62 m2)

No Asbestos

B00F - R0016 - Toilets - Girls (11.07 m2)

No Asbestos

B00F - R0017 - Communications Cupboard (2.62 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017