


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Allambie Heights Public School (4200)  
**Region :** Northern Sydney  
**State Electorate :** Wakehurst  
**Local Government Area :** Warringah

**Initial Survey :** Noel Arnold & Associates : 21 - Jan - 2008  
**Reviewed By :** Parsons Brinckerhoff : 10 - Apr - 2015

4200 - Allambie Heights Public School  
Site Plan (10588)

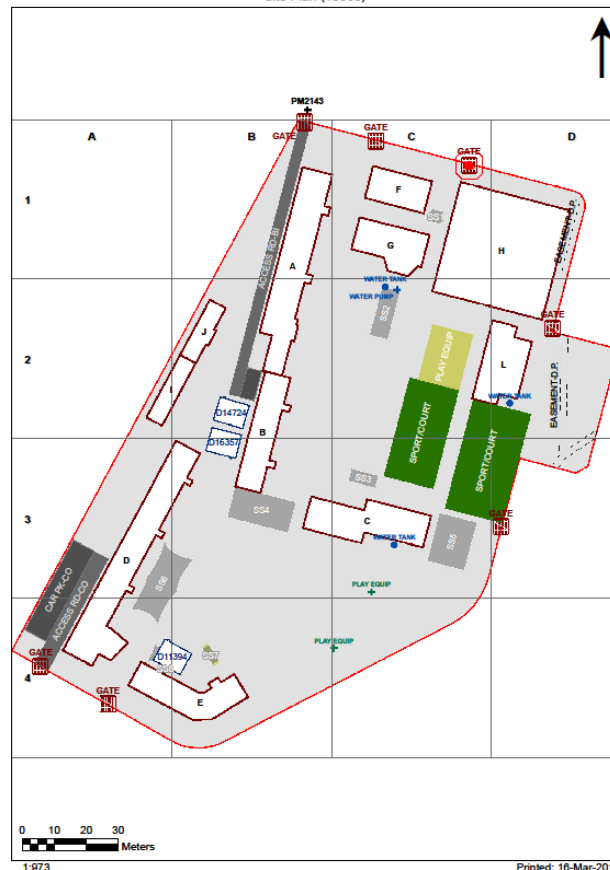

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1959 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/Eaves Linings/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	Panel behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/R0016/Wall Linings Internal/S5				<b>Chrysotile (white asbestos)</b>	

**B00A - R0002 - Home Base Store**

No Asbestos

**B00A - R0003 - Personal Effects Storage**

Wall Linings Internal	Flat AC Sheeting	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/R0003/Wall Linings Internal/S6				<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	3m2	Infill Panelling Within Electrical Cupboard	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/R0003/Wall Linings Internal/S6				<b>Chrysotile (white asbestos)</b>	

**B00A - R0004 - Cleaning Distributed Store**

No Asbestos

**B00A - R0005 - Sports Store**

No Asbestos

**B00A - R0006 - Personal Effects Storage**

No Asbestos

**B00A - R0007 - Movement**

No Asbestos

**B00A - R0008 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/R0008/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00A - R0009 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	Panel behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/R0016/Wall Linings Internal/S5				<b>Chrysotile (white asbestos)</b>	

**B00A - R0010 - Home Base Store**

No Asbestos

**B00A - R0011 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	Panel behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/R0016/Wall Linings Internal/S5				<b>Chrysotile (white asbestos)</b>	

**B00A - R0012 - Home Base Store**

No Asbestos

**B00A - R0013 - Personal Effects Storage**

No Asbestos

**B00A - R0014 - Interview**

No Asbestos

**B00A - R0015 - Staff Toilet**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0016 - Other-Commercial</b>						
Wall Linings Internal	Flat AC Sheeting	2m2	Panel behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0016/Wall Linings Internal/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0017 - Other-Commercial</b>						
No Asbestos						
<b>B00A - R0018 - Movement</b>						
No Asbestos						
<b>B00A - R0019 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00A - R0023 - Canteen Office/Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0024/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0024 - Canteen Office/Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0024/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0025 - External Movement</b>						
Wall Linings Internal	Flat AC Sheeting	5m2	North upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0025/Wall Linings Internal/S17					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00A - R0026 - External Movement</b>						
No Asbestos						
<b>B00A - R0027 - Canteen</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/Eaves Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	<1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4200/B00B/Underfloor Voids/S13					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00B - R0002 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0003 - Movement**

No Asbestos

**B00B - R0006 - Home Base**

No Asbestos

**B00B - R0007 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00B - R0008 - Home Base**

No Asbestos

**B00B - R0009 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00B - R0010 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00B - R0011 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00B - R0012 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00B - R0013 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00B - R0014 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00B - R0015 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00A/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0017 - Personal Effects Storage**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00B - R0018 - Disabled Toilet**

No Asbestos

**B00B - R0019 - Staff Toilet**

No Asbestos

**B00B - R0020 - Movement**

No Asbestos

**B00B - R0021 - Staff Kitchen**

No Asbestos

**B00B - R0022 - Staff Room**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00B/R0022/Floor Coverings Res/Textile/S23				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1959 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00C - R0001 - Home Base**

No Asbestos

**B00C - R0002 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles					
4200/B00C/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>	

**B00C - R0003 - Personal Effects Storage**

No Asbestos

**B00C - R0004 - Movement**

No Asbestos

**B00C - R0005 - Home Base**

No Asbestos

**B00C - R0006 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles					
4200/B00C/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>	

**B00C - R0007 - Home Base**

No Asbestos

**B00C - R0008 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles					
4200/B00C/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>	

**B00C - R0010 - Movement**

No Asbestos

**B00C - R0011 - Home Base**

No Asbestos

**B00C - R0012 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles					
4200/B00C/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>	

**B00C - R0013 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00C/R0014/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R0014 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00C/R0014/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R0015 - Special Programs Room**

No Asbestos

**B00C - R0016 - Personal Effects Storage**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1959 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00D - R0001 - Home Base**

No Asbestos

**B00D - R0002 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00D - R0003 - Cleaning Distributed Store**

No Asbestos

**B00D - R0004 - Movement**

No Asbestos

**B00D - R0005 - Home Base**

No Asbestos

**B00D - R0006 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00D - R0007 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00D - R0008 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00D - R0009 - Home Base**

No Asbestos

**B00D - R0010 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00D - R0011 - Movement**

No Asbestos

**B00D - R0012 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00D - R0013 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00D - R0014 - Home Base**

No Asbestos

**B00D - R0015 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00D - R0016 - General Storeroom**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0017 - Staff Room Annexe</b>						
No Asbestos						
<b>B00D - R0021 - Out Of School Hours Care Centre</b>						
No Asbestos						
<b>B00D - R0022 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0023 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0024 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0025 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00B/R0007/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0026 - Home Base Store</b>						
No Asbestos						
<b>B00D - R0027 - Personal Effects Storage</b>						
No Asbestos						
<b>B00D - R0028 - Staff Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00D - R0029 - External Movement</b>						
No Asbestos						
<b>B00D - R0031 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00D - R0032 - Reading Area</b>						
No Asbestos						
<b>B00D - R0033 - Staff Toilet</b>						
No Asbestos						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Other-Non-Govt Pre-School - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00E - R0001 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0002 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0003 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0004 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0005 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0006 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0007 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0008 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0009 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0010 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0011 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0012 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R0013 - Other-Non Government Pre-Sch**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0008/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0014 - Other-Non Government Pre-Sch**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00A/R0008/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0015 - Other-Non Government Pre-Sch**

No Asbestos

**B00E - R9001 - Other-Non Government Pre-Sch**

Ceiling Structures/Linings	Flat AC Sheeting	71m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00E/R9001/Ceiling Structures/Linings/S10				<b>Chrysotile (white asbestos)</b>		

**B00E - R9002 - Other-Non Government Pre-Sch**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00E/R9001/Ceiling Structures/Linings/S10				<b>Chrysotile (white asbestos)</b>		

**B00E - R9003 - General Storeroom - Pre**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Administration - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	25m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00F/Eaves Linings/S16					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00F - R0008 - Interview/Office - Type 3**

No Asbestos

**B00F - R0009 - Sick Bay**

No Asbestos

**B00F - R0010 - Entry Vestibule**

No Asbestos

**B00F - R0011 - Clerical Office**

No Asbestos

**B00F - R0012 - Security Store**

No Asbestos

**B00F - R0013 - Principal**

No Asbestos

**B00F - R0014 - Movement**

No Asbestos

**B00F - R0015 - Interview**

No Asbestos

**B00F - R0016 - Disabled Toilet**

No Asbestos

**B00F - R0017 - Interview**

No Asbestos

**B00F - R0018 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00F/R0018/Ceiling Structures/Linings/S22					<b>Chrysotile (white asbestos)</b>

**B00F - R0019 - Distribution Board**

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4200/B00F/R0019/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4200/B00F/R0019/Wall Linings Internal/S20					

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4200/B00F/R0019/Wall Linings Internal/S20					

**B00F - R0020 - Toilet - Lobby**

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00F/R0020/Wall Linings Internal/S21					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00F/R0020/Wall Linings Internal/S21					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00F - R0021 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00F/R0020/Wall Linings Internal/S21					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00F/R0020/Wall Linings Internal/S21			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Library - 1959 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0006 - Reading Area**

No Asbestos

**B00G - R0007 - Library Office/Workroom**

No Asbestos

**B00G - R0008 - Resource/Toy Space**

No Asbestos

**B00G - R0009 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00G/R0009/Ceiling Structures/Linings/S25				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R9001 - General Storeroom**

No Asbestos

**B00G - R9002 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 1986 - Brick/Block (Brick/Block)**

**Exterior**

Flue Pipe	Fibre Cement Pipe	2m	East side of roof	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00H/M0002/Flue pipe/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00H - M0001 - Special Programs Room**

No Asbestos

**B00H - M0002 - Plant**

Flue pipe	Fibre Cement Pipe	3m	Southeast corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00H/M0002/Flue pipe/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00H - M0003 - Stairs**

No Asbestos

**B00H - R0001 - External Movement**

No Asbestos

**B00H - R0002 - Movement**

No Asbestos

**B00H - R0003 - Plant**

No Asbestos

**B00H - R0004 - Plant**

No Asbestos

**B00H - R0005 - Disabled Toilet**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos)</b>	

**B00H - R0006 - Cleaning Distributed Store**

No Asbestos

**B00H - R0007 - Cleaning Distributed Store**

No Asbestos

**B00H - R0008 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos)</b>	

**B00H - R0009 - General Storeroom**

No Asbestos

**B00H - R0010 - Communal Space**

No Asbestos

**B00H - R0011 - Communal Space**

No Asbestos

**B00H - R0012 - Staff Kitchen**

No Asbestos

**B00H - R0013 - Communal Space**

No Asbestos

**B00H - R0014 - Hall Chair Store**

No Asbestos

**B00H - R0015 - Clerical Office/Workroom**

No Asbestos

**B00H - R0016 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
<b>B00H - R0017 - Clerical Office/Workroom</b>						
No Asbestos						
<b>B00H - R0018 - Staff Room</b>						
No Asbestos						
<b>B00H - R0019 - Movement</b>						
No Asbestos						
<b>B00H - R0020 - Disabled Toilet</b>						
No Asbestos						
<b>B00H - R0022 - Plant</b>						
No Asbestos						
<b>B00H - R0025 - P.E. Store</b>						
No Asbestos						
<b>B00H - R0026 - P.E. Store</b>						
No Asbestos						
<b>B00H - R0029 - P.E. Store</b>						
No Asbestos						
<b>B00H - R0030 - Special Programs Room</b>						
No Asbestos						
<b>B00H - R0031 - Kiln Room</b>						
No Asbestos						
<b>B00H - R0033 - Staff Toilet</b>						
No Asbestos						
<b>B00H - R0034 - Movement</b>						
No Asbestos						
<b>B00H - R0035 - Stairs</b>						
No Asbestos						
<b>B00H - R0036 - Stairs</b>						
No Asbestos						
<b>B00H - R0037 - Movement</b>						
No Asbestos						
<b>B00H - R0038 - Stairs</b>						
No Asbestos						
<b>B00H - R0039 - Movement</b>						
No Asbestos						
<b>B00H - R0040 - Lift</b>						
No Asbestos						
<b>B00H - R0041 - Raised Platform</b>						
No Asbestos						
<b>B00H - R0042 - Communal Space</b>						
No Asbestos						
<b>B00H - R9001 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00J/R0001/Partition Walls (Cubicles)/S1						<b>Chrysotile (white asbestos)</b>
<b>B00H - R9002 - Shower/Change</b>						
No Asbestos						
<b>B00H - R9003 - Main Switch Board</b>						
No Asbestos						
<b>B00H - R9004 - Movement</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00H - R9005 - Movement</b>						
No Asbestos						
<b>B00H - R9006 - General Storeroom</b>						
No Asbestos						
<b>B00H - R9007 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00J/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R9008 - Shower/Change</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4200/B00J/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R9009 - Movement</b>						
No Asbestos						
<b>B00H - R9010 - Stairs</b>						
No Asbestos						
<b>B00H - R9011 - Stairs</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Pupil Facilities - 1974 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00I/Eaves Linings/S14				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00I - R0001 - Handwashing Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00I - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00I - R0003 - Handwashing Facilities**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00I - R0004 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00I - R0005 - Personal Effects Storage**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities - 1970 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/Eaves Linings/S15				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00J - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00J - R0002 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00J - R0003 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00J - R0004 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00J - R0005 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00J - R0006 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4200/B00J/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00J - R0007 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

<b>B00L - R0001 - External Movement</b>	No Asbestos
<b>B00L - R0002 - Practical Activities - 1hb</b>	No Asbestos
<b>B00L - R0003 - Home Base Store</b>	No Asbestos
<b>B00L - R0004 - Home Base</b>	No Asbestos
<b>B00L - R0005 - Withdrawal Space - 2hb</b>	No Asbestos
<b>B00L - R0006 - Home Base</b>	No Asbestos
<b>B00L - R0007 - Home Base Store</b>	No Asbestos
<b>B00L - R0008 - Practical Activities - 1hb</b>	No Asbestos
<b>B00L - R0009 - External Stairs</b>	No Asbestos
<b>B00L - R0010 - General Storeroom</b>	No Asbestos
<b>B00L - R0011 - External Stairs</b>	No Asbestos
<b>B00L - R0012 - General Storeroom</b>	No Asbestos
<b>B00L - R1001 - External Movement</b>	No Asbestos
<b>B00L - R1002 - Practical Activities - 1hb</b>	No Asbestos
<b>B00L - R1003 - Home Base Store</b>	No Asbestos
<b>B00L - R1004 - Home Base</b>	No Asbestos
<b>B00L - R1005 - Withdrawal Space - 2hb</b>	No Asbestos
<b>B00L - R1006 - Home Base</b>	No Asbestos
<b>B00L - R1007 - Home Base Store</b>	No Asbestos
<b>B00L - R1008 - Practical Activities - 1hb</b>	No Asbestos
<b>B00L - R1009 - External Stairs</b>	No Asbestos
<b>B00L - R1010 - External Stairs</b>	No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D11394 - Learning Unit - Standard With P.A.A. : Placement Date - 24/12/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D14724 - Learning Unit - Standard With P.A.A. : Placement Date - 23/10/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D16357 - Learning Unit - Standard With P.A.A. : Placement Date - 1/11/2013**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Learning space/withdrawal/entry**

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

**R2 - Home Base Store**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017