

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ashmont Public School (4375)
Region : Riverina
State Electorate : Wagga Wagga
Local Government Area : Wagga Wagga

Initial Survey : Noel Arnold & Associates : 16 - Dec - 2009
Reviewed By : Greencap-NAA : 18 - Feb - 2015



2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1966 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)
Awnings	Flat AC Sheeting	40m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00A - R0001 - Movement (151.86 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Interview (14.01 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Staff Toilet (4.6 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0004 - Staff Toilet (3.13 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Cleaning Supplies (1.61 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Distribution Board (0.58 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0007 - Sick Bay (7.07 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Entry Vestibule (30.23 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0011 - Principal (11.77 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0012 - Interview (20.52 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0013 - Clerical Office (11.1 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0014 - Security Store (10.21 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0015 - Security Store (11.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0016 - Interview (10.99 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0017 - Movement (9.82 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0020 - Home Base (60.42 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0021 - Withdrawal Space - 1hb (14.13 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0022 - Personal Effects Storage (6.22 m2)						
No Asbestos						
B00A - R0023 - General Storeroom (10.54 m2)						
No Asbestos						
B00A - R0024 - Stairs (6.22 m2)						
No Asbestos						
B00A - R0025 - Stairs (7.28 m2)						
No Asbestos						
B00A - R0026 - Principal (18.59 m2)						
No Asbestos						
B00A - R0027 - Staff Kitchen (11.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0028 - Staff Room (61.64 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1001 - Reading Area (223.11 m2)						
No Asbestos						
B00A - R1002 - Movement (12.7 m2)						
No Asbestos						
B00A - R1003 - Toilets - Boys (4.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1004 - Cleaning Supplies (2.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1005 - Toilets - Girls (4.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - Library Office/Workroom (11.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - Library Office/Workroom (5.46 m2)						
No Asbestos						
B00A - R1008 - General Storeroom (12.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	4375/B00A/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1009 - Stairs (17.08 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)
B00A - R1010 - Movement (7.11 m2)						
No Asbestos						
B00A - R1011 - Stairs (16.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1974 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 4375/B00A/R1009/Ceiling Structures/Linings/S21	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Awnings	Flat AC Sheeting 4375/B00A/R1009/Ceiling Structures/Linings/S21	100m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00B - R0001 - Toilets - Girls (54.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0002 - Staff Toilet (2.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0003 - Communal Space (114.62 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0004 - General Storeroom (3.34 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4375/B00B/R0004/Floor Coverings Res/Textile/S3	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0005 - General Storeroom (2.92 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4375/B00B/R0004/Floor Coverings Res/Textile/S3	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0006 - Staff Kitchen (20.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4375/B00B/R0004/Floor Coverings Res/Textile/S3	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0007 - Toilets - Boys (54.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0008 - Cleaning Supplies (2.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0009 - Home Base (56.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------


B00B - R0010 - Home Base Store (4.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0011 - Home Base Store (4.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0013 - Personal Effects Storage (15.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Sheet	4375/B00B/R0013/Floor Coverings Res/Textile/S4			No Asbestos Detected	
B00B - R0014 - Home Base (57.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0015 - Home Base (56.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0016 - Home Base Store (5.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0017 - Home Base Store (5.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0018 - Personal Effects Storage (12.74 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Sheet	4375/B00B/R0013/Floor Coverings Res/Textile/S4			No Asbestos Detected	
B00B - R0019 - Home Base (56.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0020 - Movement (162.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0021 - Movement (2.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0022 - Movement (2.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	
B00B - R0023 - General Assistant/Bulk Store (24.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22			No Asbestos Detected	

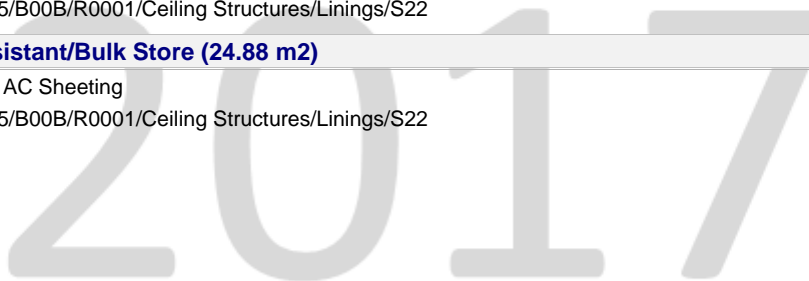

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1966 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00C - R0001 - Home Base (56.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00C - R0002 - Movement (43.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00C - R0003 - Home Base (56.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00C - R0004 - Home Base Store (5.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00C - R0005 - Home Base Store (5.59 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00C - R0006 - Personal Effects Storage (12.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

Floor Coverings Res/Textile	Vinyl Sheet	4375/B00B/R0013/Floor Coverings Res/Textile/S4				No Asbestos Detected
-----------------------------	-------------	--	--	--	--	-----------------------------

B00C - R0007 - Movement (2.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Multi Purpose Facilities - 1990 - Brick/Block (Brick/Block)

Exterior

Gable Ends	Flat AC Sheeting 4375/B00D/Gable Ends/S5					No Asbestos Detected
Awnings	Flat AC Sheeting 4375/B00A/R1009/Ceiling Structures/Linings/S21	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00D - R0001 - Distribution Board (1.52 m2)	Note: No inspection of live electrical installation.
No Asbestos	

B00D - R0002 - Shower/Change (2.76 m2)	
Partition Walls (Cubicles) Compressed AC Sheet 4375/B00D/R0020/Partition Walls (Cubicles)/S6	No Asbestos Detected

B00D - R0003 - Movement (7.33 m2)	
No Asbestos	

B00D - R0004 - Movement (16.37 m2)	
Wall Linings Internal Flat AC Sheeting 4375/B00D/Gable Ends/S5	No Asbestos Detected

B00D - R0005 - Movement (6.54 m2)	
No Asbestos	

B00D - R0006 - Cleaning Supplies (0.88 m2)	
No Asbestos	

B00D - R0007 - Plant (0.86 m2)	
No Asbestos	

B00D - R0008 - Shower/Change (2.25 m2)	
Partition Walls (Cubicles) Compressed AC Sheet 4375/B00D/R0020/Partition Walls (Cubicles)/S6	No Asbestos Detected

B00D - R0009 - Toilets - Girls (10.9 m2)	
Partition Walls (Cubicles) Compressed AC Sheet 4375/B00D/R0020/Partition Walls (Cubicles)/S6	No Asbestos Detected

B00D - R0010 - General Storeroom (2.63 m2)	
No Asbestos	

B00D - R0017 - Disabled Toilet (3.41 m2)	
No Asbestos	

B00D - R0019 - Cleaning Supplies (2.63 m2)	
No Asbestos	

B00D - R0020 - Toilets - Boys (11.48 m2)	
Partition Walls (Cubicles) Compressed AC Sheet 4375/B00D/R0020/Partition Walls (Cubicles)/S6	No Asbestos Detected

B00D - R0021 - Raised Platform (52.44 m2)	
No Asbestos	

B00D - R0023 - Communal Space (189.03 m2)	
No Asbestos	

B00D - R0024 - Movement (72.23 m2)	
No Asbestos	

B00D - R0025 - Sports Store (7.77 m2)
--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00D - R0026 - External Movement (17.85 m2)

No Asbestos

B00D - R0027 - General Storeroom (6.79 m2)

No Asbestos

B00D - R0028 - General Storeroom (6.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities/General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00E - R0001 - Movement (146.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0002 - Toilets - Girls (42.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0003 - General Storeroom (71.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0004 - Toilets - Boys (43.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0005 - Home Base (55.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0007 - Movement (2.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0009 - Home Base (56.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0010 - Home Base (85.24 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0014 - Movement (2.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0016 - Home Base (56.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					
B00E - R0018 - Home Base Store (8.5 m2)						
Non Accessible						
B00E - R0019 - Home Base Store (8.23 m2)						
Non Accessible						
B00E - R0020 - Movement (7.05 m2)						
Non Accessible						
B00E - R0021 - Home Base Store (9.77 m2)						
Non Accessible						
B00E - R0022 - Home Base Store (5.42 m2)						
Non Accessible						
B00E - R0023 - Home Base Store (8.26 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Non Accessible

B00E - R0024 - Movement (11.35 m2)

Non Accessible

B00E - R0025 - Movement (2.58 m2)

Non Accessible

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1967 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00F - R0001 - Home Base (56.11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00B/R0004/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00F - R0002 - Movement (42.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected	

B00F - R0003 - Home Base (56.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected	

B00F - R0004 - Home Base Store (4.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected	

B00F - R0005 - Home Base Store (4.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected	

B00F - R0006 - Personal Effects Storage (15.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Sheet					
	4375/B00B/R0013/Floor Coverings Res/Textile/S4				No Asbestos Detected	

B00F - R0007 - Movement (2.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1967 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	70m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00G - R0001 - Toilets - Boys/Girls (3.03 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00G/R0001/Wall Linings Internal/S9				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00G/R0001/Wall Linings Internal/S9				Chrysotile (white asbestos)	

B00G - R0002 - Home Base Store (6.32 m2)

No Asbestos

B00G - R0003 - Sports Store (5.68 m2)

No Asbestos

B00G - R0004 - General Storeroom (0.9 m2)

No Asbestos

B00G - R0005 - Personal Effects Storage (6.87 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet	4375/B00B/R0013/Floor Coverings Res/Textile/S4				No Asbestos Detected

B00G - R0006 - Home Base (85.18 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet	4375/B00G/R0006/Floor Coverings Res/Textile/S10				No Asbestos Detected

B00G - R0007 - Home Base (85.11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00G - R0008 - Toilets - Boys/Girls (3.11 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00G/R0001/Wall Linings Internal/S9				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected

B00G - R0009 - Home Base Store (4.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00G - R0010 - Personal Effects Storage (12.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4375/B00B/R0001/Ceiling Structures/Linings/S22				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet	4375/B00B/R0013/Floor Coverings Res/Textile/S4				No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0011 - Home Base Store (4.1 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet					
	4375/B00B/R0013/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00G - R0012 - Home Base (56.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
B00G - R0013 - Movement (84.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
B00G - R0014 - Movement (2.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
B00G - R0015 - Movement (3.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4375/B00B/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Staff Facilities - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00A/R1009/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00H - R0001 - Movement (34.32 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4375/B00B/R0001/Ceiling Structures/Linings/S22					

B00H - R0002 - General Storeroom (22.67 m2)

No Asbestos

B00H - R0003 - Cleaning Supplies (2.22 m2)

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4375/B00B/R0013/Floor Coverings Res/Textile/S4					

B00H - R0004 - Movement (22.61 m2)

No Asbestos

B00H - R0005 - Staff Room Annexe (17.22 m2)

No Asbestos

B00H - R0006 - Distribution Board (0.45 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4375/B00H/R0006/Electrical Mounting Board/S23				Chrysotile (white asbestos)	

B00H - R0007 - General Storeroom (7.44 m2)

No Asbestos

B00H - R0008 - Staff Toilet (3.08 m2)

Wall Linings Internal	Vinyl Tiles					No Asbestos Detected
	4375/B00H/R0009/Wall Linings Internal/S11					

B00H - R0009 - Staff Toilet (3.1 m2)

Wall Linings Internal	Vinyl Tiles					No Asbestos Detected
	4375/B00H/R0009/Wall Linings Internal/S11					

B00H - R0010 - Movement (7.02 m2)

No Asbestos

B00H - R0011 - Special Programs Room (22.82 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 2009 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - Home Base (37.19 m2)

No Asbestos

B00I - R0002 - Staff Kitchen (14.5 m2)

No Asbestos

B00I - R0003 - Toilets-Unisex (4.36 m2)

No Asbestos

B00I - R0004 - General Storeroom (6.52 m2)

No Asbestos

B00I - R0005 - Clerical Office (8.17 m2)

No Asbestos

B00I - R0006 - Movement (4.23 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Canteen (27 m2)

No Asbestos

B00J - R0002 - Canteen Office/Store (9.35 m2)

No Asbestos

B00J - R0003 - Main Switch Board (1.02 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017