


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ajuga School (5748)
Region : South Western Sydney
State Electorate : Macquarie Fields
Local Government Area : Campbelltown

Initial Survey : Noel Arnold & Associates : 23 - May - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Oct - 2015

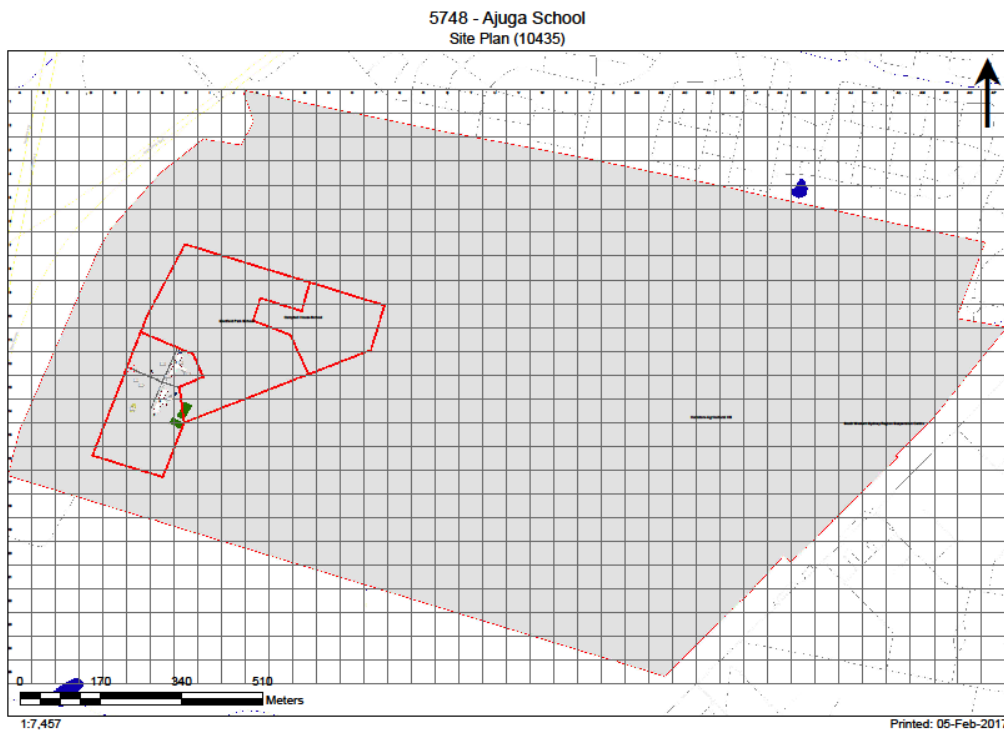

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Administration - 1992 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/Eaves Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - Laundry**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0003 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0003/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	5748/B00C/R0003/Wall Linings Internal/S10					

B00C - R0004 - Community Clinic

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0004/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting	2m2	Airlock adjacent R0004, west wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0004/Wall Linings Internal/S12				Chrysotile (white asbestos)	

B00C - R0005 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	2m2	North, east	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0005/Wall Linings Internal/S14				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0005/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0006/Ceiling Structures/Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0007 - General Learning Space

No Asbestos

B00C - R0008 - General Learning Space

No Asbestos

B00C - R0010 - Special Programs Room

No Asbestos

B00C - R0011 - General Storeroom

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	5748/B00C/R0011/Wall Linings Internal/S17					
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0011/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0012 - Clerical Office

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
No Asbestos							
B00C - R0013 - Clerical Office							
No Asbestos							
B00C - R0015 - Withdrawal Space - 1hb							
No Asbestos							
B00C - R0021 - Principal							
No Asbestos							
B00C - R0022 - General Learning Space							
No Asbestos							
B00C - R0023 - External Movement							
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0023/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)			
B00C - R0024 - Withdrawal Space - 1hb							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0024/Ceiling Structures/Linings/S19				Chrysotile (white asbestos) , Amosite (brown asbestos)			
Wall Linings Internal	Flat AC Sheeting	5748/B00C/R0024/Wall Linings Internal/S20				No Asbestos Detected	
B00C - R0026 - General Storeroom							
Wall Linings Internal	Flat AC Sheeting	5m2	East, South	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0026/Wall Linings Internal/S25				Chrysotile (white asbestos)			
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0026/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)			
B00C - R0027 - General Storeroom							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0027/Ceiling Structures/Linings/S66				Chrysotile (white asbestos)			
B00C - R0028 - Toilets-Unisex							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0028/Ceiling Structures/Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos)			
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0028/Partition Walls (Cubicles)/S27				Chrysotile (white asbestos)			
Wall Linings Internal	Flat AC Sheeting	5748/B00C/R0028/Wall Linings Internal/S28				No Asbestos Detected	
B00C - R0029 - Clerical Office							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0029/Ceiling Structures/Linings/S29				Chrysotile (white asbestos) , Amosite (brown asbestos)			
Wall Linings Internal	Flat AC Sheeting	4m2	North, West walls external to R0026	Good Condition (1)	Low (1)	Low Priority (2-3)	
5748/B00C/R0029/Wall Linings Internal/S31				Chrysotile (white asbestos)			
Infill Panel	Flat AC Sheeting	5748/B00C/R0029/Infill Panel/S30				No Asbestos Detected	
B00C - R0030 - Toilets-Unisex							
Infill panel	Flat AC Sheeting	5748/B00C/R0030/Infill panel/S32				No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting 5748/B00C/R0030/Wall Linings Internal/S33					No Asbestos Detected
B00C - R0031 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00C/R0031/Ceiling Structures/Linings/S67					Chrysotile (white asbestos)
B00C - R0032 - Movement						
No Asbestos						
B00C - R0033 - Toilet - Lobby						
No Asbestos						
B00C - R0034 - Toilets - Boys/Girls						
No Asbestos						
B00C - R0035 - Entry Vestibule						
No Asbestos						
B00C - R0036 - Special Programs Store						
No Asbestos						
B00C - R0037 - Staff Room						
No Asbestos						
B00C - R0038 - Practical Activities - 1hb						
No Asbestos						
B00C - R0039 - Clerical Office/Workroom						
No Asbestos						
B00C - R0040 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1992 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/Eaves Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	5748/B00D/Underfloor Voids/S4				Chrysotile (white asbestos)	

Interior**B00D - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	5748/B00D/R0001/Ceiling Structures/Linings/S34					

B00D - R0002 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0002/Wall Linings Internal/S37				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0002/Ceiling Structures/Linings/S61				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0002/Partition Walls (Cubicles)/S36				Chrysotile (white asbestos)	

B00D - R0003 - Shower/Change

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0003/Ceiling Structures/Linings/S62				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0003/Wall Linings Internal/S39				Chrysotile (white asbestos)	

B00D - R0004 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	5m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0004/Wall Linings Internal/S41				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0004/Ceiling Structures/Linings/S63				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0005 - Shower/Change

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0005/Ceiling Structures/Linings/S64				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0005/Wall Linings Internal/S43				Chrysotile (white asbestos)	

B00D - R0006 - Shower/Change

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5748/B00D/R0006/Ceiling Structures/Linings/S65				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0007 - General Learning Space

No Asbestos

B00D - R0008 - General Learning Space

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0009 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0009/Ceiling Structures/Linings/S45				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0010 - Special Programs Room						
No Asbestos						
B00D - R0011 - Staff Room Annexe						
No Asbestos						
B00D - R0012 - Staff Room Annexe						
No Asbestos						
B00D - R0013 - Movement						
No Asbestos						
B00D - R0014 - Withdrawal Space - 1hb						
No Asbestos						
B00D - R0015 - Food/Research Space						
No Asbestos						
B00D - R0016 - Seminar/Study						
Hatch	Flat AC Sheeting					
5748/B00D/R0016/Hatch/S46				No Asbestos Detected		
B00D - R0017 - Distribution Board						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting					
5748/B00D/R0017/Wall Linings Internal/S47				No Asbestos Detected		
B00D - R0018 - Pantry						
No Asbestos						
B00D - R0019 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0019/Ceiling Structures/Linings/S48				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0021 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0021/Ceiling Structures/Linings/S49				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0022 - Shower/Change						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0022/Ceiling Structures/Linings/S50				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Infill panels	Flat AC Sheeting	20m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0022/Infill panels/S51				Chrysotile (white asbestos)		
B00D - R0023 - Shower/Change						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0023/Ceiling Structures/Linings/S52				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0024 - Laundry						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0024/Ceiling Structures/Linings/S53				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0025 - Toilets - Boys						
In-fill-panel	Flat AC Sheeting	20m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0025/In-fill-panel/S55				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0025/Partition Walls (Cubicles)/S56					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0025/Ceiling Structures/Linings/S54					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	6m2	West wall external to R0026	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0025/Wall Linings Internal/S57					Chrysotile (white asbestos)	
B00D - R0026 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0026/Ceiling Structures/Linings/S58					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	5m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
5748/B00D/R0026/Wall Linings Internal/S59					Chrysotile (white asbestos)	
B00D - R0027 - Home Base/Practical Activities						
No Asbestos						
B00D - R0028 - Home Base/Practical Activities						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 2008 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Storage - 2014 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00F - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D13320 - Learning Unit - Standard/Withdrawal : Placement Date - 7/03/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017