


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Berowra Public School (1205)
Region : Northern Sydney
State Electorate : Hornsby
Local Government Area : Hornsby

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Sep - 2016

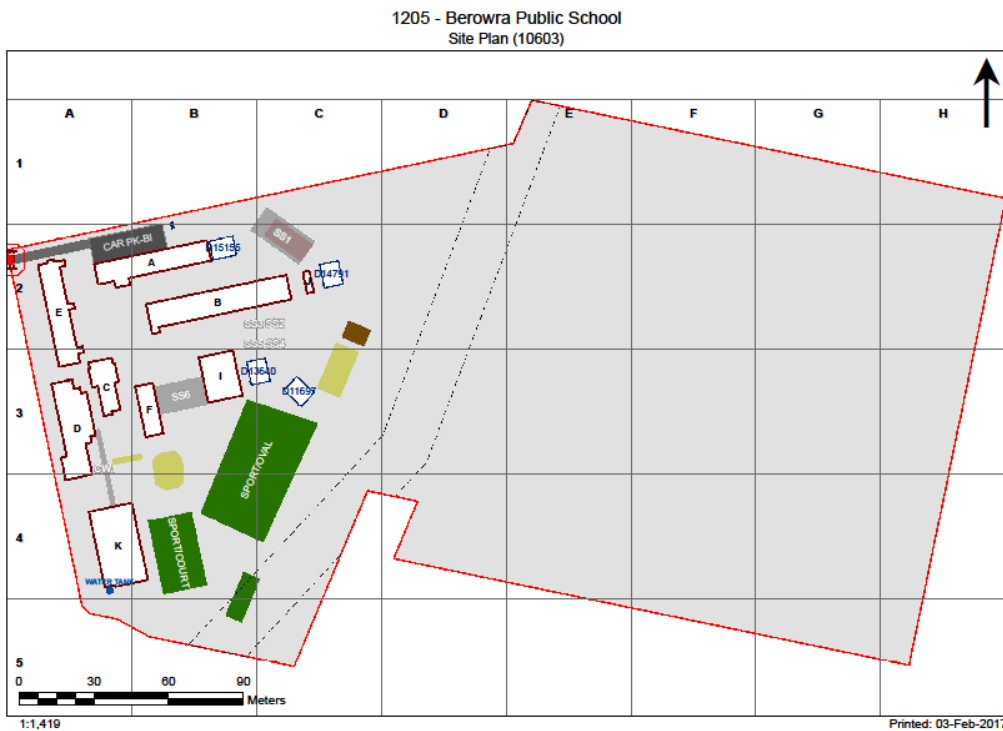

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - Administration/General Learning - 1964 - Brick/Veneer (Brick/Veneer)**Exterior**

| | | | | | | |
|-----------------------------------|--|-------|-------------------------------|--------------------|---------|--------------------|
| Ceiling Voids - Raked Ceiling | Non Accessible Area - Height Restriction >3m. | | | | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |
| Gable Ends | Flat AC Sheeting | 40m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Height Restriction >3m. | | | | | |
| Eaves Linings | Flat AC Sheeting | 200m2 | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Height Restriction >3m. | | | | | |

Interior**B00A - R0001 - Principal**

No Asbestos

B00A - R0002 - Duplicating Workroom

No Asbestos

B00A - R0003 - Clerical Office

No Asbestos

B00A - R0004 - Sick Bay

No Asbestos

B00A - R0005 - Staff Toilet

No Asbestos

B00A - R0006 - Disabled Toilet

No Asbestos

B00A - R0007 - Staff Room

No Asbestos

B00A - R0008 - Movement

| | | | | | | |
|----------------------------|---|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1205/B00A/R0008/Ceiling Structures/Linings/S9 | | | | | No Asbestos Detected |
|----------------------------|---|--|--|--|--|-----------------------------|

B00A - R0009 - External Movement

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1205/B00A/R0009/Ceiling Structures/Linings/S10 | | | | | No Asbestos Detected |
|----------------------------|--|--|--|--|--|-----------------------------|

B00A - R0010 - General Storeroom

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Entry Vestibule

No Asbestos

B00A - R0013 - Interview

No Asbestos

B00A - R0014 - Movement

No Asbestos

B00A - R0015 - Movement

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1205/B00A/R0015/Ceiling Structures/Linings/S11 | | | | | |
| | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | | | | |

B00A - R0016 - Movement

No Asbestos

B00A - R0017 - Personal Effects Storage

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|---|-------------|--------------------|
| Sample No | | | | | Test Result | |
| B00A - R0018 - Home Base Store | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0019 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0020 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0021 - Home Base Store | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0022 - Personal Effects Storage | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0023 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1205/B00A/R0015/Ceiling Structures/Linings/S11 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| B00A - R0024 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0025 - Staff Toilet | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 20m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1205/B00A/R0025/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00A - R0026 - Staff Toilet | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 4m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1205/B00A/R0025/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00A - R0027 - Cleaning Distributed Store | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0028 - Staff Room Annexe | | | | | | |
| No Asbestos | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00B - General Learning - 1952 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Height Restriction >3m.

Underfloor Voids - Packing to Floor Joists
 No Asbestos Found

Interior

B00B - R0001 - Cleaning Distributed Store

No Asbestos

B00B - R0002 - Music Store

| | | | | | | |
|--|-------------|------|--------------|--------------------|------------------------------------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 10m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1205/B00B/R0002/Floor Coverings Res/Textile/S4 | | | | | Chrysotile (white asbestos) | |

B00B - R0003 - General Storeroom

No Asbestos

B00B - R0004 - Special Programs Room

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - General Storeroom

| | | | | | | |
|--|-------------|------|--------------|--------------------|------------------------------------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 11m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1205/B00B/R0002/Floor Coverings Res/Textile/S4 | | | | | Chrysotile (white asbestos) | |

B00B - R0007 - Staff Room Annexe

No Asbestos

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Home Base

No Asbestos

B00B - R0010 - General Storeroom

No Asbestos

B00B - R0011 - General Storeroom

No Asbestos

B00B - R0012 - Home Base

No Asbestos

B00B - R0013 - Home Base

No Asbestos

B00B - R0014 - Craft Store

No Asbestos

B00B - R0015 - External Movement

| | | | | | | |
|---|------------------|-------|--------------|--------------------|---|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 136m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1205/B00B/R0015/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

| | | | | | | |
|--|------------------|-----|--------------------------|--------------------|---------|--------------------|
| Upstand Panels | Flat AC Sheeting | 6m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Height Restriction >3m. | | | | | | |

B00B - R0016 - Craft Store

No Asbestos

B00B - R9001 - General Storeroom

| | | | | | | |
|--|------------------|--|--|--|--|----------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 1205/B00B/R9001/Wall Linings Internal/S5 | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - Other-After School Care - 1964 - Timber (Timber)**Exterior**

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Height Restriction >3m.

Underfloor Voids - Packing to Floor Joists
No Asbestos Found

Interior**B00C - R0001 - General Storeroom**

No Asbestos

B00C - R0002 - General Storeroom

No Asbestos

B00C - R0003 - Out Of School Hours Care Centre

No Asbestos

B00C - R0004 - External Movement

| | | | | | | |
|----------------------------|--|------|-----------------------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 22m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1205/B00C/R0004/Ceiling Structures/Linings/S6 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| Upstand Panels | Flat AC Sheeting | 4m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Height Restriction >3m. | | | | | |

B00C - R0005 - Other-After School Care

No Asbestos

B00C - R0006 - Other-After School Care

No Asbestos

B00C - R0007 - Other-After School Care

No Asbestos

B00C - R0008 - Other-After School Care

No Asbestos

B00C - R0009 - Other-After School Care

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning - 1964 - Brick/Veneer (Brick/Veneer)**Exterior**

| | | | | | | |
|--|--|-------|-------------------------------|--------------------|---------|--|
| Ceiling Voids - Raked Ceiling | Non Accessible Area - Height Restriction >3m. | | | | | |
| Underfloor Voids - Packing to Floor Joists | Non Accessible Area - Area inaccessible - No access found. | | | | | |
| Gable Ends | Flat AC Sheeting 1205/B00D/Gable Ends/S12 | 40m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Eaves Linings | Flat AC Sheeting Assumed Asbestos - Height Restriction >3m. | 260m2 | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |

Interior**B00D - R0001 - External Movement**

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting 1205/B00C/R0004/Ceiling Structures/Linings/S6 | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) |
|----------------------------|---|-----|--------------|--------------------|---------|---|

B00D - R0002 - Staff Room Annexe

No Asbestos

B00D - R0003 - General Storeroom

No Asbestos

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Toilets - Boys/Girls

No Asbestos

B00D - R0006 - Personal Effects Storage

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base

No Asbestos

B00D - R0009 - Toilets - Boys/Girls

No Asbestos

B00D - R0010 - Personal Effects Storage

No Asbestos

B00D - R0011 - Movement

No Asbestos

B00D - R0012 - General Storeroom

No Asbestos

B00D - R0013 - External Movement

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting 1205/B00C/R0004/Ceiling Structures/Linings/S6 | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) |
|----------------------------|---|-----|--------------|--------------------|---------|---|

B00D - R0014 - Uniform Shop

No Asbestos

B00D - R0015 - External Movement

No Asbestos

B00D - R0016 - Movement

No Asbestos

B00D - R0017 - Toilets - Boys/Girls

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|--------------------|
| | Sample No | | | | | Test Result |

No Asbestos

B00D - R0018 - Cleaning Distributed Store

No Asbestos

B00D - R0019 - Dental Clinic

No Asbestos

B00D - R0020 - Clerical Office

No Asbestos

B00D - R0021 - Toilets - Boys/Girls

No Asbestos

B00D - R0022 - Staff Room

No Asbestos

B00D - R0023 - Dental Clinic

No Asbestos

B00D - R0024 - Covered Outdoor Learning Area

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - General Learning - 1964 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|--|--|-------|----------------------------|--------------------|---------|--------------------|
| Underfloor Voids - Packing to Floor Joists | Non Accessible Area | | | | | |
| | - Area inaccessible - doors could not be opened. | | | | | |
| Ceiling Voids - Raked Ceiling | Non Accessible Area | | | | | |
| | - Height Restriction >3m. | | | | | |
| Gable Ends | Flat AC Sheeting | 40m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Height Restriction >3m. | | | | | |
| Eaves Linings | Flat AC Sheeting | 250m2 | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Height Restriction >3m. | | | | | |

Interior

B00E - R0001 - External Movement

| | | | | | | |
|----------------------------|---|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | 1205/B00E/R9003/Ceiling Structures/Linings/S7 | | | | | No Asbestos Detected |

B00E - R0002 - Personal Effects Storage

No Asbestos

B00E - R0003 - Home Base Store

No Asbestos

B00E - R0004 - Home Base

No Asbestos

B00E - R0005 - Home Base

No Asbestos

B00E - R0006 - Home Base Store

No Asbestos

B00E - R0007 - Personal Effects Storage

No Asbestos

B00E - R0008 - Movement

No Asbestos

B00E - R0009 - External Movement

| | | | | | | |
|----------------------------|---|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | 1205/B00E/R9003/Ceiling Structures/Linings/S7 | | | | | No Asbestos Detected |

B00E - R0010 - Home Base Store

No Asbestos

B00E - R0011 - Home Base

No Asbestos

B00E - R0012 - Home Base

No Asbestos

B00E - R0013 - Personal Effects Storage

No Asbestos

B00E - R0014 - External Movement

| | | | | | | |
|----------------------------|---|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | 1205/B00E/R9003/Ceiling Structures/Linings/S7 | | | | | No Asbestos Detected |

B00E - R0015 - Movement

No Asbestos

B00E - R0016 - General Storeroom

No Asbestos

B00E - R0017 - General Storeroom

No Asbestos

B00E - R0018 - Staff Room Annexe

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

No Asbestos

B00E - R9001 - Communications Room

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | | 1205/B00E/R9003/Ceiling Structures/Linings/S7 | | | | No Asbestos Detected |

B00E - R9002 - Security Store

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | | 1205/B00E/R9003/Ceiling Structures/Linings/S7 | | | | No Asbestos Detected |

B00E - R9003 - Movement

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | | 1205/B00E/R9003/Ceiling Structures/Linings/S7 | | | | No Asbestos Detected |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - Pupil Facilities - 1964 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|--|-------------------|------|-------------------------------|--------------------|---------|--------------------|
| Ceiling Voids - Flat Roof | No Asbestos Found | | | | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | 80m2 | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Height Restriction >3m. | | | | | | |

Interior**B00F - R0001 - Cleaning Distributed Store**

| | | | | | | |
|--|------------------|-----|-------------|--------------------|---------|--------------------|
| Panel Above Door | Flat AC Sheeting | 1m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Height Restriction >3m. | | | | | | |

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1205/B00F/R0002/Ceiling Structures/Linings/S1 | | | | No Asbestos Detected |
|----------------------------|------------------|---|--|--|--|-----------------------------|

B00F - R0002 - Toilets - Boys

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1205/B00F/R0002/Ceiling Structures/Linings/S1 | | | | No Asbestos Detected |
|----------------------------|------------------|---|--|--|--|-----------------------------|

B00F - R0003 - Drinking Facilities

| | | | | | | |
|-----------------------|------------------|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | 1205/B00F/R0003/Wall Linings Internal/S2 | | | | No Asbestos Detected |
|-----------------------|------------------|--|--|--|--|-----------------------------|

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1205/B00F/R0002/Ceiling Structures/Linings/S1 | | | | No Asbestos Detected |
|----------------------------|------------------|---|--|--|--|-----------------------------|

B00F - R0004 - Drinking Facilities

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1205/B00F/R0002/Ceiling Structures/Linings/S1 | | | | No Asbestos Detected |
|----------------------------|------------------|---|--|--|--|-----------------------------|

B00F - R0005 - Toilets - Girls

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1205/B00F/R0002/Ceiling Structures/Linings/S1 | | | | No Asbestos Detected |
|----------------------------|------------------|---|--|--|--|-----------------------------|

B00F - R0006 - Cleaning Distributed Store

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1205/B00F/R0002/Ceiling Structures/Linings/S1 | | | | No Asbestos Detected |
|----------------------------|------------------|---|--|--|--|-----------------------------|

B00F - R0007 - Cleaning Distributed Store

| | | | | | | |
|----------------------------|------------------|---|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1205/B00F/R0002/Ceiling Structures/Linings/S1 | | | | No Asbestos Detected |
|----------------------------|------------------|---|--|--|--|-----------------------------|

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B001 - Library - 1964 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|--|-------------------|-------|-----------------------------|--------------------|---------|--------------------|
| Ceiling Voids - Raked Ceiling | No Asbestos Found | | | | | |
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | 100m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Height Restriction >3m. | | | | | | |

Interior

B001 - R0001 - External Movement

| | | | | | | |
|---|------------------|------|--------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 30m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1205/B00C/R0004/Ceiling Structures/Linings/S6 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B001 - R0002 - Library Office/Workroom

No Asbestos

B001 - R0003 - Communications Room

No Asbestos

B001 - R0004 - Reading Area

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00J - Special Purpose - 1964 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|-----------------------------------|-----------------------------|------|-----------------------------|--------------------|---------|------------------------------------|
| Ceiling Voids - Flat Roof | No Asbestos Found | | | | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | 40m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1205/B00J/Eaves Linings/S13 | | | | | Chrysotile (white asbestos) |

Interior**B00J - R0001 - General Assistant/Bulk Store**

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1205/B00C/R0004/Ceiling Structures/Linings/S6 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

B00J - R0002 - Kiln Room

| | | | | | | |
|----------------------------|---|------|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1205/B00C/R0004/Ceiling Structures/Linings/S6 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

B00K - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00K - R0001 - Covered Outdoor Learning Area**

No Asbestos

B00K - R0002 - Communal Space

No Asbestos

B00K - R0003 - Raised Platform

No Asbestos

B00K - R0004 - Hall Chair Store

No Asbestos

B00K - R0005 - Communal/Performance Store

No Asbestos

B00K - R0006 - P.E. Store

No Asbestos

B00K - R0007 - Toilet - Lobby

No Asbestos

B00K - R0008 - Toilets - Girls

No Asbestos

B00K - R0009 - Sound Cupboard

No Asbestos

B00K - R0010 - Toilets - Boys

No Asbestos

B00K - R0011 - Toilet - Lobby

No Asbestos

B00K - R0012 - Cleaning Distributed Store

No Asbestos

B00K - R0013 - Main Switch Board

No Asbestos

B00K - R0014 - Disabled Shower/Toilet

No Asbestos

B00K - R0015 - Plant

No Asbestos

B00K - R0016 - Canteen

No Asbestos

B00K - R0017 - Canteen Office/Store

No Asbestos

B00K - R0018 - Ramp

No Asbestos

B00K - R0019 - Movement

No Asbestos

B00K - R0020 - Movement

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11697 - Learning Unit - Standard With P.A.A. : Placement Date - 8/11/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13640 - Learning Unit - Standard With P.A.A. : Placement Date - 2/01/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14791 - Learning Unit - Standard With P.A.A. : Placement Date - 10/12/2012

Exterior

| | | | |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 11.52 m2 |

Interior

R1 - Learning space/withdrawal/entry

| | | | |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 70 m2 |
|---------|---------------|------------------|-------|

R2 - Home Base Store

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 3 m2 |

OS 603 - D15155 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 18/10/2004

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.



| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1205_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017