


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Balgowlah Heights Public School (3736)
Region : Northern Sydney
State Electorate : Manly
Local Government Area : Manly

Initial Survey : Noel Arnold & Associates : 21 - Jan - 2008
Reviewed By : Parsons Brinckerhoff : 15 - Sep - 2016

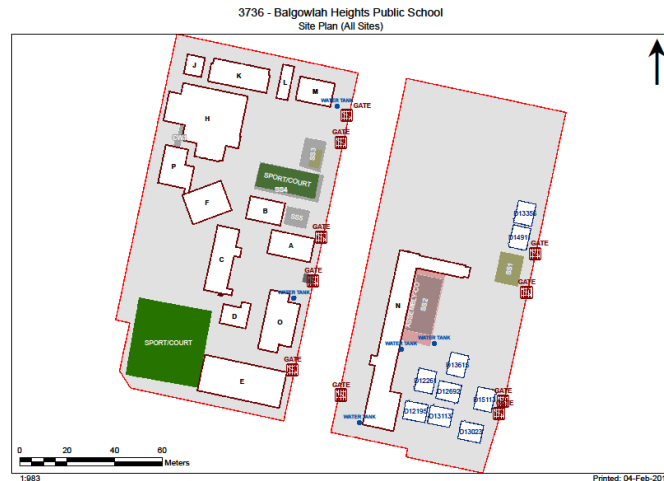

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1930 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area					
	- Area inaccessible, low clearance, sealed.					
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height Restriction >3m.

Interior

B00A - R0001 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles					
	3736/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected

B00A - R0002 - Staff Room

No Asbestos

B00A - R0003 - Principal

No Asbestos

B00A - R0004 - Sick Bay

No Asbestos

B00A - R0005 - Staff Room

No Asbestos

B00A - R0006 - Interview

No Asbestos

B00A - R0007 - Interview

Floor Coverings Res/Textile	Vinyl Tiles					
	3736/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected

B00A - R0008 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00A/R0009/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00A/R0009/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0009 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00A/R0009/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00A/R0009/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Security Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3736/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected

B00A - R0012 - Clerical Office

No Asbestos

B00A - R0013 - Entry Vestibule

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1955 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists
 Non Accessible Area
 - Area inaccessible, low clearance, access sealed.

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Height Restriction >3m.

Interior

B00B - R0001 - Home Base Store

No Asbestos

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Special Programs Room

No Asbestos

B00B - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1930 - Timber (Timber)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	60m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Gable Verge-lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Underfloor Voids	AC Fragments/Debris 3736/B00C/Underfloor Voids/S17	NA	South	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
Chrysotile (white asbestos) , Amosite (brown asbestos)						

Interior**B00C - R0001 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00C/R0001/Wall Linings Internal/S6						
Chrysotile (white asbestos) , Amosite (brown asbestos)						

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - Personal Effects Storage

No Asbestos

B00C - R0005 - Personal Effects Storage

No Asbestos

B00C - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00C/R0006/Ceiling Structures/Linings/S7						
Chrysotile (white asbestos) , Amosite (brown asbestos)						

B00C - R0007 - Home Base

No Asbestos

B00C - R0008 - Home Base Store

No Asbestos

B00C - R0009 - Home Base

No Asbestos

B00C - R0010 - Home Base Store

No Asbestos

B00C - R0011 - Personal Effects Storage

No Asbestos

B00C - R0012 - Movement

No Asbestos

B00C - R0013 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00C/R0006/Ceiling Structures/Linings/S7						
Chrysotile (white asbestos) , Amosite (brown asbestos)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1930 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Gable Verge-lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						

Interior

B00D - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00D/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0002 - Movement

No Asbestos

B00D - R0003 - Sports Store

No Asbestos

B00D - R0005 - Home Base

No Asbestos

B00D - R0007 - Personal Effects Storage

No Asbestos

B00D - R0008 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1930 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00E - R0001 - Reading Area**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0002 - Communications Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0003 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0004 - Cleaning Distributed Store

No Asbestos

B00E - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0006 - General Storeroom

No Asbestos

B00E - R0007 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0008 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0009 - Plant

No Asbestos

B00E - R0010 - Toilets - Boys

No Asbestos

B00E - R0011 - Toilets - Girls

No Asbestos

B00E - R0012 - External Movement

Ceiling Structures/Linings Flat AC Sheeting
3736/B00E/R0012/Ceiling Structures/Linings/S11 **No Asbestos Detected**

Wall Linings Internal Flat AC Sheeting
3736/B00E/R0012/Ceiling Structures/Linings/S11 **No Asbestos Detected**

B00E - R9005 - Chair Store

Wall Linings Internal Flat AC Sheeting
3736/B00E/R9009/Wall Linings Internal/S12 **No Asbestos Detected**

B00E - R9008 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R9009 - Sports Store

Wall Linings Internal Flat AC Sheeting
3736/B00E/R9009/Wall Linings Internal/S12 **No Asbestos Detected**

B00E - R9010 - General Assistant/Bulk Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R9011 - Uniform Shop

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 2006 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00F - R0001 - External Movement**

No Asbestos

B00F - R0002 - Practical Activities - 1hb

No Asbestos

B00F - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities - 1930 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	150m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00H/Eaves Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00H - R0001 - Clerical Office/Workroom

No Asbestos

B00H - R0002 - Cleaning Supplies

No Asbestos

B00H - R0005 - Canteen Office/Store

No Asbestos

B00H - R0007 - Staff Toilet

No Asbestos

B00H - R0010 - Communal Space

No Asbestos

B00H - R0011 - General Storeroom

No Asbestos

B00H - R0012 - Cleaning Distributed Store

No Asbestos

B00H - R0013 - Access Shower/Toilet

No Asbestos

B00H - R0014 - Communal Space

No Asbestos

B00H - R0015 - General Storeroom

No Asbestos

B00H - R0016 - Sports Store

No Asbestos

B00H - R0017 - Canteen Office/Store

No Asbestos

B00H - R0018 - Canteen

No Asbestos

B00H - R0019 - Covered Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1930 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	45m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00M/R0004/Wall Linings Internal/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00J - R0001 - External Movement

No Asbestos

B00J - R0002 - Withdrawal Space - 2hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1930 - Timber (Timber)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	30m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00K/R0001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00K - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00K/R0001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	8m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00K/R0001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0002 - Special Programs Room

No Asbestos

B00K - R0003 - Staff Toilet

No Asbestos

B00K - R0004 - Kiln Room

No Asbestos

B00K - R0005 - General Storeroom

No Asbestos

B00K - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	4m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00K/R0006/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0007 - Home Base

Wall Linings Internal	Flat AC Sheeting	4m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00K/R0006/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0008 - Movement

No Asbestos

B00K - R0009 - Craft Store

No Asbestos

B00K - R0010 - Craft Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1930 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00L/R0003/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00L - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00L/R0003/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00L/R0003/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0003 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00L/R0003/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Special Purpose/General Learning - 1955 - Steel (Steel)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Wall Cladding	Flat AC Sheeting	8m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00M/R0004/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00M - R0001 - Home Base Store**

Wall Linings Internal	Flat AC Sheeting	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00M/R0004/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00M - R0002 - Home Base

No Asbestos

B00M - R0003 - Home Base

No Asbestos

B00M - R0004 - No Access

Wall Linings Internal	Flat AC Sheeting	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00M/R0004/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00N - General Learning/Building Services - 1958 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	175m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Gable Verge-lining	Flat AC Sheeting	40m	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						

Interior**B00N - R0001 - Garden Store**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00N/R0009/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00N/R0009/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Partition Walls (Cubicles)	Compressed AC Sheet	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00N/R0003/Partition Walls (Cubicles)/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0003 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00N/R0009/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00N/R0003/Partition Walls (Cubicles)/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0004 - No Access

Non Accessible

B00N - R0005 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00N/R0009/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0006 - Craft Store

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00N/R0009/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0007 - Movement

No Asbestos

B00N - R0008 - No Access

Non Accessible

B00N - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	84m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3736/B00N/R0009/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R0010 - Movement						
No Asbestos						
B00N - R0011 - Stairs						
No Asbestos						
B00N - R0012 - Stairs						
No Asbestos						
B00N - R1001 - Home Base						
No Asbestos						
B00N - R1002 - Home Base Store						
No Asbestos						
B00N - R1003 - Personal Effects Storage						
No Asbestos						
B00N - R1004 - Movement						
No Asbestos						
B00N - R1005 - Personal Effects Storage						
No Asbestos						
B00N - R1006 - Home Base						
No Asbestos						
B00N - R1007 - Home Base Store						
No Asbestos						
B00N - R1008 - Home Base						
No Asbestos						
B00N - R1009 - Home Base Store						
No Asbestos						
B00N - R1010 - Personal Effects Storage						
No Asbestos						
B00N - R1011 - Movement						
No Asbestos						
B00N - R1012 - Personal Effects Storage						
No Asbestos						
B00N - R1013 - Home Base						
No Asbestos						
B00N - R1014 - Home Base Store						
No Asbestos						
B00N - R1015 - Principal						
No Asbestos						
B00N - R1016 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00N/R1016/Wall Linings Internal/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3736/B00N/R1016/Wall Linings Internal/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00N - R1018 - Cleaning Distributed Store						
No Asbestos						
B00N - R1019 - Clerical Office						
No Asbestos						
B00N - R1020 - Staff Room						
No Asbestos						
B00N - R1022 - External Movement						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	22m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height Restriction >3m.

B00N - R1023 - Home Base

No Asbestos

B00N - R1024 - Staff Toilet

No Asbestos

B00N - R1025 - Home Base Store

No Asbestos

B00N - R1026 - Personal Effects Storage

No Asbestos

B00N - R1027 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

3736/B00N/R1016/Wall Linings Internal/S13

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00N - R1028 - Stairs

No Asbestos

B00N - R1029 - Stairs

No Asbestos

B00N - R1030 - Disabled Shower/Toilet

No Asbestos

B00N - R1031 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B000 - R0001 - External Movement	No Asbestos
B000 - R0002 - Practical Activities - 1hb	No Asbestos
B000 - R0003 - Home Base Store	No Asbestos
B000 - R0004 - Home Base	No Asbestos
B000 - R0005 - Withdrawal Space - 2hb	No Asbestos
B000 - R0006 - Home Base	No Asbestos
B000 - R0007 - Home Base Store	No Asbestos
B000 - R0008 - Practical Activities - 1hb	No Asbestos
B000 - R0009 - Garden Store	No Asbestos
B000 - R0010 - External Stairs	No Asbestos
B000 - R0011 - Garden Store	No Asbestos
B000 - R0012 - External Stairs	No Asbestos
B000 - R1001 - External Movement	No Asbestos
B000 - R1002 - Practical Activities - 1hb	No Asbestos
B000 - R1003 - Home Base Store	No Asbestos
B000 - R1004 - Home Base	No Asbestos
B000 - R1005 - Withdrawal Space - 2hb	No Asbestos
B000 - R1006 - Home Base	No Asbestos
B000 - R1007 - Home Base Store	No Asbestos
B000 - R1008 - Practical Activities - 1hb	No Asbestos
B000 - R1009 - External Stairs	No Asbestos
B000 - R1010 - External Stairs	No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Other - After School Care - 2014 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00P - R0001 - Out Of School Hours Care Centre

No Asbestos

B00P - R0002 - Out Of School Hours Care Centre

No Asbestos

B00P - R0003 - Out Of School Hours Care Centre

No Asbestos

B00P - R0004 - Out Of School Hours Care Centre

No Asbestos

B00P - R0005 - Out Of School Hours Care Centre

No Asbestos

B00P - R0006 - Out Of School Hours Care Centre

No Asbestos

B00P - R0007 - Out Of School Hours Care Centre

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D12195 - Learning Unit - Standard/Withdrawal : Placement Date - 25/02/1999

Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D12261 - Learning Unit - Standard/Withdrawal : Placement Date - 31/01/2002

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D12692 - Learning Unit - Standard/Withdrawal : Placement Date - 11/02/2000

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D13023 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 10/11/2004

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D13113 - Learning Unit - Standard/Withdrawal : Placement Date - 24/05/2007						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Store						
No Asbestos Found.						
OS 602 - D13356 - Learning Unit - Standard With P.A.A. : Placement Date - 20/01/2014						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D13615 - Learning Unit - Standard With P.A.A. : Placement Date - 9/01/2014						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
OS 602 - D14911 - Learning Unit - Standard With P.A.A. : Placement Date - 16/01/2013						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D15113 - Learning Unit - Standard With P.A.A. : Placement Date - 10/01/2013						
Exterior						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3736_ASB_171210_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017