


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Birrong Public School (4057)
Region : South Western Sydney
State Electorate : Bankstown
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

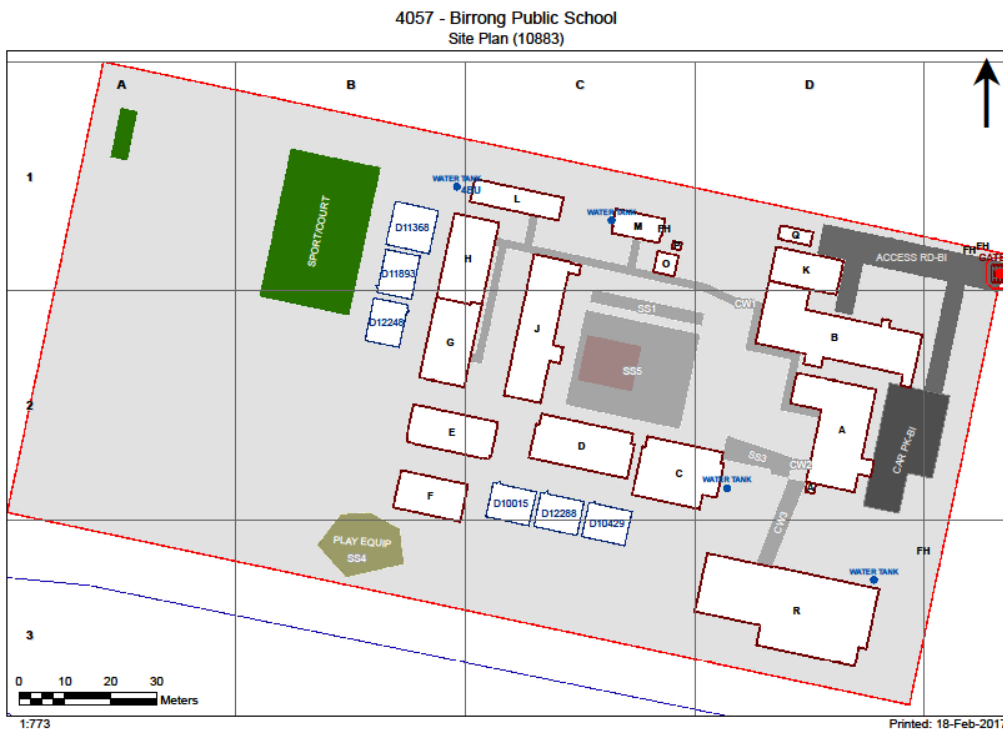

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00A - Administration/Library - 1971 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|--------------------|--|--|--|--|--|-----------------------------|
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting 4057/B00A/Eaves Linings/S19 | | | | | No Asbestos Detected |
| Gable Verge Lining | Flat AC Sheeting 4057/B00A/Gable Verge Lining/S20 | | | | | No Asbestos Detected |

Interior**B00A - R0001 - Clerical Office (14.24 m2)**

| | | | | | | |
|-----------------------------|--|------|--------------|----------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 4057/B00A/R0009/Floor Coverings Res/Textile/S16 | 15m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 15m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0002 - Entry Vestibule (8.86 m2)

| | | | | | | |
|----------------------------|---|-----|--------------|----------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 9m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0003 - Principal (17.55 m2)

| | | | | | | |
|----------------------------|---|------|--------------|----------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 18m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0004 - Staff Toilet (3.3 m2)

| | | | | | | |
|----------------------------|---|-----|--------------|----------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 4m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0005 - Cleaning Distributed Store (1.63 m2)

| | | | | | | |
|----------------------------|---|-----|--------------|----------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 2m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0006 - Staff Toilet (4.29 m2)

| | | | | | | |
|----------------------------|---|-----|--------------|----------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 5m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0007 - Staff Toilet (4.29 m2)

| | | | | | | |
|----------------------------|---|-----|--------------|----------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 5m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0009 - Security Store (8.02 m2)

| | | | | | | |
|-----------------------------|--|-----|--------------|----------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 4057/B00A/R0009/Floor Coverings Res/Textile/S16 | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 9m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0010 - Duplicating Workroom (11.45 m2)

| | | | | | | |
|-----------------------------|--|------|--------------|----------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 4057/B00A/R0009/Floor Coverings Res/Textile/S16 | 12m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |
| Ceiling Structures/Linings | Vermiculite 4057/B00A/R0009/Ceiling Structures/Linings/S17 | 12m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00A - R0011 - Sick Bay (6.64 m2)

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|----------------------|-----------------------------|--------------------|
| Sample No | | | | | Test Result | |
| Floor Coverings Res/Textile | Vinyl Tiles | 7m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00A/R0009/Floor Coverings Res/Textile/S16 | | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Vermiculite | 7m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| 4057/B00A/R0009/Ceiling Structures/Linings/S17 | | | | | Chrysotile (white asbestos) | |
| B00A - R0012 - Clerical Office (14.07 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | 15m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| 4057/B00A/R0009/Ceiling Structures/Linings/S17 | | | | | Chrysotile (white asbestos) | |
| B00A - R0013 - General Storeroom (0.81 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0014 - Movement (22.24 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00A/R0009/Floor Coverings Res/Textile/S16 | | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Vermiculite | 23m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| 4057/B00A/R0009/Ceiling Structures/Linings/S17 | | | | | Chrysotile (white asbestos) | |
| B00A - R0015 - General Assistant/Bulk Store (6.39 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0017 - Stairs (4.27 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0018 - External Movement (56.23 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0019 - Stairs (8.38 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0020 - General Assistant/Bulk Store (2.93 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0021 - Staff Room (55.99 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | 56m2 | All surfaces | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
| 4057/B00A/R0009/Ceiling Structures/Linings/S17 | | | | | Chrysotile (white asbestos) | |
| B00A - R0022 - Lift (1.54 m2) | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00A - R0023 - External Movement (9.72 m2) | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00A - R1001 - Communications Room (11.77 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1006 - Stairs (16.73 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1007 - Movement (7.92 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1008 - Reading Area (25.5 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1009 - Reading Area (145.1 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1010 - Movement (9.27 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1011 - Library Office/Workroom (23.87 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1012 - Movement (7.8 m2) | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|--------------------|
| | Sample No | | | | | Test Result |

No Asbestos

B00A - R1013 - Stairs (11.47 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00B - General Learning - 1971 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|--------------------|---|-------|-------------------------------|---|------------|-----------------------|
| Eaves Linings | Flat AC Sheeting 4057/B00B/Eaves Linings/S21 | 100m2 | North facing, South facing | Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos) | Low (1) | Low Priority (2-3) |
| Underfloor Voids | Packers on piers 4057/B00B/Underfloor Voids/S22 | 4m2 | Variable positions | Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | Low (1) | Low Priority (2-3) |
| Underfloor Voids | AC Fragments/Debris 4057/B00B/Underfloor Voids/S23 | 4m2 | Variable positions | Minimal Damage (2) Chrysotile (white asbestos) , Amosite (brown asbestos) | Medium (2) | Medium Priority (4-5) |
| Underfloor Voids | Flat AC Sheeting 4057/B00B/Underfloor Voids/S24 | 1m2 | Variable positions | Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | Low (1) | Low Priority (2-3) |
| Gable Verge Lining | Flat AC Sheeting 4057/B00B/Gable Verge Lining/S25 | 20m | East & West ends | Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos) | Low (1) | Low Priority (2-3) |
| Roof Voids | No Asbestos Found | | | | | |

Interior

B00B - R0001 - Movement (4.54 m2)

| | | | | | | |
|----------------------------|--|-----|--------------|--|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 4057/B00B/R0001/Ceiling Structures/Linings/S10 | 5m2 | All surfaces | Good Condition (1) Chrysotile (white asbestos) | Low (1) | Low Priority (2-3) |
|----------------------------|--|-----|--------------|--|---------|--------------------|

B00B - R0002 - Movement (3.71 m2)

No Asbestos

B00B - R0003 - Personal Effects Storage (8.75 m2)

No Asbestos

B00B - R0004 - Toilets - Boys/Girls (3.15 m2)

| | | | | | | |
|-----------------------|--|------|--------------|--|---------|--------------------|
| Wall Linings Internal | Flat AC Sheeting 4057/B00B/R0004/Wall Linings Internal/S9 | 20m2 | All surfaces | Good Condition (1) Chrysotile (white asbestos) | Low (1) | Low Priority (2-3) |
|-----------------------|--|------|--------------|--|---------|--------------------|

B00B - R0005 - Home Base (62.17 m2)

No Asbestos

B00B - R0006 - Practical Activities - 1hb (3.48 m2)

No Asbestos

B00B - R0007 - External Movement (2.7 m2)

No Asbestos

B00B - R0008 - Home Base (66.33 m2)

No Asbestos

B00B - R0009 - Practical Activities - 1hb (11.73 m2)

No Asbestos

B00B - R0010 - Movement (11.51 m2)

No Asbestos

B00B - R0011 - Movement (2.62 m2)

No Asbestos

B00B - R0012 - Interview (18.97 m2)

No Asbestos

B00B - R0013 - General Storeroom (2.78 m2)

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

No Asbestos

B00B - R0014 - External Movement (8.72 m2)

| | | | | | | |
|----------------------------|------------------|-----|--------------|--------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
|----------------------------|------------------|-----|--------------|--------------------|---------|--------------------|

4057/B00B/R0001/Ceiling Structures/Linings/S10

Chrysotile (white asbestos)

B00B - R0015 - Special Programs Room (26.65 m2)

No Asbestos

B00B - R0016 - Movement (9.2 m2)

No Asbestos

B00B - R0017 - Personal Effects Storage (12.69 m2)

No Asbestos

B00B - R0018 - Home Base (66.62 m2)

| | | | | | | |
|-----------------------|------------------|-----|------------------------------|--------------------|---------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 2m2 | North facing, East facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
|-----------------------|------------------|-----|------------------------------|--------------------|---------|--------------------|

4057/B00B/R0018/Wall Linings Internal/S11

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0019 - Covered Outdoor Learning Area (40.84 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - Communal Facilities - 1971 - Timber (Timber)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00C - R0001 - Sports Store (22.26 m2)

No Asbestos

B00C - R0005 - External Movement (29.97 m2)

No Asbestos

B00C - R0006 - Home Base Store (7.85 m2)

No Asbestos

B00C - R0007 - Home Base (53.53 m2)

No Asbestos

B00C - R0008 - Practical Activities (16.84 m2)

No Asbestos

B00C - R0009 - Withdrawal Space - 2hb (11.92 m2)

No Asbestos

B00C - R0010 - Practical Activities (16.75 m2)

No Asbestos

B00C - R0011 - Home Base (53.24 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning - 1971 - Timber (Timber)**Exterior**

| | |
|------------------|-------------------|
| Underfloor Voids | No Asbestos Found |
| Ceiling Voids | No Asbestos Found |

Interior**B00D - R0001 - Home Base (53.3 m2)**

| | | | | | | |
|---|------------------|-----|------------------------------|---|---------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 4m2 | South facing, East facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00D/R0004/Wall Linings Internal/S13 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00D - R0002 - General Storeroom (10.8 m2)

No Asbestos

B00D - R0003 - Craft Store (10.89 m2)

No Asbestos

B00D - R0004 - Home Base (53.31 m2)

| | | | | | | |
|---|------------------|-----|------------------------------|---|---------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 4m2 | South facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00D/R0004/Wall Linings Internal/S13 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00D - R0005 - Home Base Store (10.7 m2)

No Asbestos

B00D - R0006 - Withdrawal Space - 1hb (15.44 m2)

No Asbestos

B00D - R0007 - External Movement (46.96 m2)

| | | | | | | |
|--|------------------|------|--------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 47m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00D/R0007/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - General Learning - 1971 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|--------------------|----------------------------------|------|----------------------------|--------------------|---|--------------------|
| Eaves Linings | Flat AC Sheeting | 50m2 | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4057/B00E/Eaves Linings/S26 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | |
| Gable Verge Lining | Flat AC Sheeting | 20m | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4057/B00E/Gable Verge Lining/S27 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |
| Underfloor Voids | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior

B00E - R0001 - External Movement (1.33 m2)

| | | | | | | |
|----------------------------|--|-----|--------------|--------------------|---|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4057/B00E/R0001/Ceiling Structures/Linings/S14 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00E - R0002 - Movement (2.6 m2)

No Asbestos

B00E - R0003 - Personal Effects Storage (4.04 m2)

No Asbestos

B00E - R0004 - Home Base Store (5.28 m2)

No Asbestos

B00E - R0005 - Home Base (56.92 m2)

No Asbestos

B00E - R0006 - Home Base (56.84 m2)

No Asbestos

B00E - R0007 - Home Base Store (5.26 m2)

No Asbestos

B00E - R0008 - Personal Effects Storage (4.11 m2)

No Asbestos

B00E - R0009 - Movement (2.57 m2)

No Asbestos

B00E - R0010 - External Movement (1.33 m2)

| | | | | | | |
|----------------------------|--|-----|--------------|--------------------|---|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4057/B00E/R0001/Ceiling Structures/Linings/S14 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - General Learning - 1971 - Timber (Timber)

Exterior

Underfloor Voids No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Special Programs Room (47.49 m2)

No Asbestos

B00F - R0002 - Home Base (47.43 m2)

No Asbestos

B00F - R0003 - External Movement (25.27 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00G - General Learning - 1971 - Timber (Timber)

Exterior

| | | | | | | |
|------------------|---|--|--|--|--|-----------------------------|
| Eaves Linings | Flat AC Sheeting 4057/B00G/Eaves Linings/S28 | | | | | No Asbestos Detected |
| Underfloor Voids | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior

B00G - R0001 - Home Base (52.35 m2)

No Asbestos

B00G - R0002 - Home Base (52.36 m2)

No Asbestos

B00G - R0003 - External Movement (33.09 m2)

No Asbestos

B00G - R0004 - Sports Store (32.71 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00H - General Learning - 1971 - Timber (Timber)

Exterior

| | | | | | | |
|------------------|---|--|--|--|--|-----------------------------|
| Eaves Linings | Flat AC Sheeting 4057/B00H/Eaves Linings/S29 | | | | | No Asbestos Detected |
| Underfloor Voids | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior

B00H - R0001 - Home Base (53.59 m2)

| | | | | | | |
|-----------------------|--|-----|------------------------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting 4057/B00H/R0001/Wall Linings Internal/S5 | 4m2 | North facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00H - R0002 - Home Base (53.59 m2)

| | | | | | | |
|-----------------------|--|-----|------------------------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting 4057/B00H/R0001/Wall Linings Internal/S5 | 4m2 | North facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B00H - R0003 - Craft Store (5.88 m2)

No Asbestos

B00H - R0004 - Movement (3.38 m2)

No Asbestos

B00H - R0005 - General Storeroom (9.08 m2)

No Asbestos

B00H - R0006 - Cleaning Supplies (13.47 m2)

No Asbestos

B00H - R0007 - External Movement (34.33 m2)

| | | | | | | |
|----------------------------|---|------|--------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 4057/B00H/R0007/Ceiling Structures/Linings/S4 | 35m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00J - General Learning - 1971 - Brick/Veneer (Brick/Veneer)**Exterior**

| | | | | | | |
|--------------------|---|-----|-------------------------------|--------------------|------------|--|
| Eaves Linings | Flat AC Sheeting 4057/B00J/Eaves Linings/S30 | | | | | No Asbestos Detected |
| Gable Verge Lining | Flat AC Sheeting 4057/B00J/Gable Verge Lining/S31 | 25m | North facing, South facing | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Underfloor Voids | AC Fragments/Debris 4057/B00J/Underfloor Voids/S32 | 2m2 | Variable positions | Minimal Damage (2) | Medium (2) | Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior**B00J - R0001 - External Movement (4.82 m2)**

| | | | | | | |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting 4057/B00J/R0001/Ceiling Structures/Linings/S6 | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) |
|----------------------------|---|-----|--------------|--------------------|---------|---|

B00J - R0002 - Movement (3.06 m2)

No Asbestos

B00J - R0003 - Personal Effects Storage (4.66 m2)

No Asbestos

B00J - R0004 - Home Base Store (6.55 m2)

No Asbestos

B00J - R0005 - Home Base (56.96 m2)

| | | | | | | |
|-----------------------|--|-----|------------------------------|--------------------|---------|--|
| Wall Linings Internal | Flat AC Sheeting 4057/B00J/R0005/Wall Linings Internal/S7 | 4m2 | North facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
|-----------------------|--|-----|------------------------------|--------------------|---------|--|

B00J - R0006 - Home Base (57.44 m2)

| | | | | | | |
|-----------------------|--|-----|--------------|--------------------|---------|--|
| Wall Linings Internal | Flat AC Sheeting 4057/B00J/R0005/Wall Linings Internal/S7 | 2m2 | South facing | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
|-----------------------|--|-----|--------------|--------------------|---------|--|

B00J - R0007 - Home Base Store (6.86 m2)

No Asbestos

B00J - R0008 - Personal Effects Storage (3.71 m2)

No Asbestos

B00J - R0009 - Staff Room Annexe (13 m2)

| | | | | | | |
|-----------------------|--|-----|-------------|--------------------|---------|--|
| Wall Linings Internal | Flat AC Sheeting 4057/B00J/R0005/Wall Linings Internal/S7 | 1m2 | West facing | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
|-----------------------|--|-----|-------------|--------------------|---------|--|

B00J - R0010 - General Storeroom (0.78 m2)

No Asbestos

B00J - R0011 - Cleaning Distributed Store (1.08 m2)

No Asbestos

B00J - R0012 - Movement (2.93 m2)

No Asbestos

B00J - R0013 - General Storeroom (3.31 m2)

No Asbestos

B00J - R0014 - Movement (11.93 m2)

No Asbestos

B00J - R0015 - External Movement (8.06 m2)

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|----------------------|--------|--------------------|--|-------------|--------------------|
| Sample No | | | | | Test Result | |
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00J/R0001/Ceiling Structures/Linings/S6 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00J - R0016 - Personal Effects Storage (3.69 m2)

No Asbestos

B00J - R0017 - Home Base Store (6.86 m2)

No Asbestos

B00J - R0018 - Home Base (57.75 m2)

| | | | | | | |
|--|------------------|-----|--------------|-----------------------------|---------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 2m2 | North facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00J/R0005/Wall Linings Internal/S7 | | | | Chrysotile (white asbestos) | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00K - Pupil Facilities - 1980 - Timber (Timber)

Exterior

| | | | | | | |
|-----------------------------------|---|------|--------------------|---|---------|--------------------|
| Underfloor Voids - Slab on Ground | Non Accessible Area - Area inaccessible No Voids | | | | | |
| Eaves Linings | Flat AC Sheeting | 20m2 | Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4057/B00K/Eaves Linings/S33 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior

B00K - R0001 - Canteen Office/Store (7.22 m2)

No Asbestos

B00K - R0002 - Canteen (22.83 m2)

No Asbestos

B00K - R0003 - External Movement (10.02 m2)

| | | | | | | |
|----------------------------|--|------|--------------|------------------------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4057/B00K/R0003/Ceiling Structures/Linings/S18 | | | Chrysotile (white asbestos) | | |

B00K - R0004 - Canteen Covered Area (69.56 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00L - Pupil Facilities - 1971 - Brick/Block (Brick/Block)

Exterior

| | |
|-----------------------------------|---|
| Underfloor Voids - Slab on Ground | Non Accessible Area - Area inaccessible No Voids |
| Ceiling Voids | No Asbestos Found |
| Eaves Linings | No Asbestos Found |

Interior

B00L - R0001 - Garden Store (15.08 m2)

No Asbestos

B00L - R0002 - Toilets - Boys (56.3 m2)

| | | | | | | |
|---|---------------------|------|--------------|--------------------|------------------------------------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00L/R0002/Partition Walls (Cubicles)/S1 | | | | | Chrysotile (white asbestos) | |

B00L - R0003 - Cleaning Distributed Store (1.3 m2)

No Asbestos

B00L - R0004 - Cleaning Distributed Store (6 m2)

No Asbestos

B00L - R0005 - General Storeroom (5.99 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00M - Pupil Facilities - 1971 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|-----------------------------------|---|--|--|--|--|--|
| Underfloor Voids - Slab on Ground | Non Accessible Area - Area inaccessible No Voids | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior

B00M - R0001 - Toilets - Girls (17.83 m2)

| | | | | | | |
|---|------------------|------|--------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 18m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00M/R0002/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) | |

B00M - R0002 - Toilets - Girls (14.57 m2)

| | | | | | | |
|---|---------------------|-----|--------------|--------------------|------------------------------------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00M/R0002/Partition Walls (Cubicles)/S2 | | | | | Chrysotile (white asbestos) | |

| | | | | | | |
|---|------------------|------|--------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 15m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00M/R0002/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) | |

B00M - R0003 - External Movement (17.77 m2)

| | | | | | | |
|---|---------------------|-----|--------------|--------------------|------------------------------------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00M/R0002/Partition Walls (Cubicles)/S2 | | | | | Chrysotile (white asbestos) | |

| | | | | | | |
|---|------------------|------|--------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 18m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4057/B00M/R0002/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B000 - Building Services - 1980 - Timber (Timber)

Exterior

| | | | | | | |
|-----------------------------------|---|--|--|--|--|-----------------------------|
| Underfloor Voids - Slab on Ground | Non Accessible Area - Area inaccessible No Voids | | | | | |
| Eaves Linings | Flat AC Sheeting 4057/B000/Eaves Linings/S34 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior

B000 - R0001 - General Storeroom (9.37 m2)

| | | | | | | |
|-----------------------|---|-----|--------------|----------------------------|---------|------------------------------------|
| Wall Linings Internal | Compressed AC Sheet 4057/B000/R0002/Wall Linings Internal/S8 | 2m2 | North facing | Some Damage / Unsealed (3) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

B000 - R0002 - General Storeroom (9.51 m2)

| | | | | | | |
|-----------------------|---|-----|--------------|----------------------------|---------|------------------------------------|
| Wall Linings Internal | Compressed AC Sheet 4057/B000/R0002/Wall Linings Internal/S8 | 2m2 | South facing | Some Damage / Unsealed (3) | Low (1) | Low Priority (2-3) |
| | | | | | | Chrysotile (white asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00P - Building Services - 1980 - Brick/Block (Brick/Block)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00P - R0001 - Garden Store (2.18 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00Q - Communal Facilities - 1971 - Steel (Steel)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00Q - R0001 - Movement (8.47 m2)

| | |
|---|-------------------|
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found |
|---|-------------------|

B00Q - R0002 - Toilets - Boys/Girls (1.69 m2)

No Asbestos

B00Q - R0003 - Community Clinic (10.19 m2)

| | |
|---|-------------------|
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found |
|---|-------------------|

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00R - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|-----------------------------------|---|
| Underfloor Voids - Slab on Ground | Non Accessible Area - Area inaccessible No Voids |
| Ceiling Voids | No Asbestos Found |

Interior

B00R - R0001 - Communal Space (169.36 m2)

No Asbestos

B00R - R0002 - Raised Platform (79.45 m2)

No Asbestos

B00R - R0003 - Communal/Performance Store (12.39 m2)

No Asbestos

B00R - R0004 - Chair Storeroom (10.47 m2)

No Asbestos

B00R - R0005 - P.E. Store (16.24 m2)

No Asbestos

B00R - R0006 - Toilet - Lobby (2.58 m2)

No Asbestos

B00R - R0007 - Toilets - Girls (7.25 m2)

No Asbestos

B00R - R0008 - Sound Cupboard (2.03 m2)

No Asbestos

B00R - R0009 - Toilet - Lobby (3.41 m2)

No Asbestos

B00R - R0010 - Toilets - Boys (5.99 m2)

No Asbestos

B00R - R0011 - Cleaning Distributed Store (3.45 m2)

No Asbestos

B00R - R0012 - Plant (1.58 m2)

No Asbestos

B00R - R0013 - Main Switch Board (3.42 m2)

No Asbestos

B00R - R0014 - Access Shower/Toilet/Change (6.91 m2)

No Asbestos

B00R - R0015 - Covered Outdoor Learning Area (188.99 m2)

No Asbestos

B00R - R0016 - Movement (8.44 m2)

No Asbestos

B00R - R0017 - Movement (22.43 m2)

No Asbestos

B00R - R0018 - External Movement (7.5 m2)

No Asbestos

B00R - R0019 - Ramp (12.41 m2)

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10015 - Learning Unit - Standard/Withdrawal : Placement Date - 12/01/1995

Exterior

| | | | |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 11.52 m2 |

Interior

R1 - Entry

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 8 m2 |

R2 - General Learning Space

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 55 m2 |

R3 - Store

| | | | |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 10 m2 |
|---------|---------------|------------------|-------|

OS 601 - D10429 - Learning Unit - Standard/Withdrawal : Placement Date - 27/06/2001

Exterior

| | | | |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 11.52 m2 |

Interior

R1 - Entry

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 8 m2 |

R2 - General Learning Space

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 55 m2 |

R3 - Store

| | | | |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 10 m2 |
|---------|---------------|------------------|-------|

NS 251 - D11368 - Learning Unit - Double E.S.L./Workroom : Placement Date - 30/01/2008

Exterior

No Asbestos Found.

Interior

R1 - Esl

No Asbestos Found.

R2 - Esl

No Asbestos Found.

R3 - Entry

No Asbestos Found.

R4 - Work Space

No Asbestos Found.

OS 602 - D11893 - Learning Unit - Standard With P.A.A. : Placement Date - 5/03/2009

Exterior

No Asbestos Found.

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12248 - Learning Unit - Standard With P.A.A. : Placement Date - 17/01/2014

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D12288 - Learning Unit - Standard/Withdrawal : Placement Date - 15/01/1999

Exterior

| | | | |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 11.52 m2 |

Interior

R1 - Entry

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 8 m2 |

R2 - General Learning Space

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 55 m2 |

R3 - Store

| | | | |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 10 m2 |
|---------|---------------|------------------|-------|

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017