


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bradbury Public School (4403)
Region : South Western Sydney
State Electorate : Campbelltown
Local Government Area : Campbelltown

Initial Survey : Noel Arnold & Associates : 16 - May - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

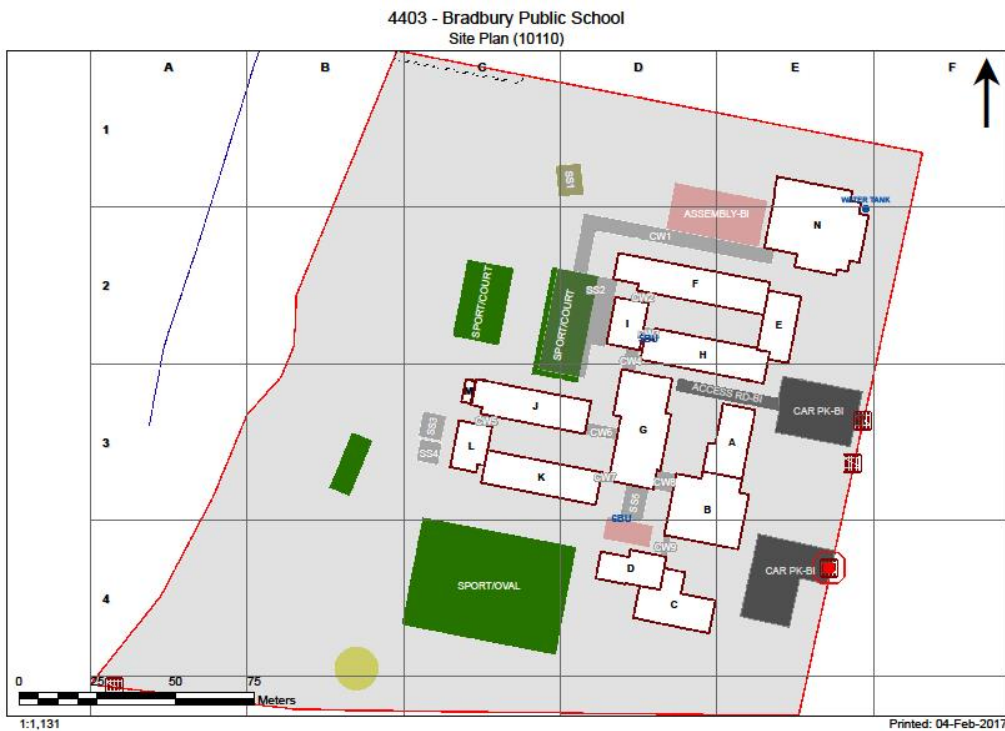

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00C/Eaves Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	North South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00A/Gable Verge Lining/S6				Chrysotile (white asbestos)	

Interior**B00A - R0001 - Home Base (52.78 m2)**

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0002 - Practical Activities - 1hb (16.42 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0003 - Practical Activities - 1hb (16.42 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0004 - Home Base (52.78 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0005 - Toilets - Boys (12.67 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)	

B00A - R0006 - Toilets - Girls (14.94 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)	

B00A - R0007 - Movement (37.96 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0008 - General Storeroom (3.61 m2)

No Asbestos

B00A - R0009 - Movement (16.11 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0010 - Stairs (0.53 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1001 - Practical Activities - 1hb (16.42 m2)						
No Asbestos						
B00A - R1002 - Home Base (52.79 m2)						
No Asbestos						
B00A - R1003 - Home Base (52.79 m2)						
No Asbestos						
B00A - R1004 - Practical Activities - 1hb (16.42 m2)						
No Asbestos						
B00A - R1005 - General Storeroom (12.67 m2)						
No Asbestos						
B00A - R1006 - Plant (14.94 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00A - R1007 - Movement (37.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1008 - Movement (16.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1009 - Stairs (4.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B00A/R1009/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration/Library - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00B - R0001 - Cleaning Supplies (14.64 m2)**

Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4403/B00F/R0009/Floor Coverings Res/Textile/S1	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00B - R0002 - Staff Toilet (7.77 m2)

Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 4403/B00I/R0002/Partition Walls (Cubicles)/S3	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00B - R0003 - Staff Toilet (9.11 m2)

Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 4403/B00I/R0002/Partition Walls (Cubicles)/S3	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00B - R0004 - Staff Toilet (3.34 m2)

Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00B - R0005 - Interview (13.08 m2)

Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00B - R0006 - Distribution Board (0.38 m2)

No Asbestos						Note: No inspection of live electrical installation.
-------------	--	--	--	--	--	--

B00B - R0007 - Staff Room (98.27 m2)

Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00B - R0008 - Cleaning Distributed Store (7.19 m2)

Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4403/B00F/R0009/Floor Coverings Res/Textile/S1	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00B - R0009 - Duplicating Workroom (13.08 m2)

Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00B - R0010 - Clerical Office (13.24 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0011 - Interview (13.26 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0012 - Sick Bay (10.2 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0013 - Principal (23.04 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0014 - Staff Room Annexe (13.3 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0015 - Staff Room Annexe (15.31 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0016 - Security Store (19.3 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4403/B00F/R0009/Floor Coverings Res/Textile/S1	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0017 - Entry Vestibule (14.98 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0018 - Movement (55.32 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0019 - Movement (1.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4403/B00F/R0017/Ceiling Structures/Linings/S2	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0020 - Drinking Facilities (55.14 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0021 - Movement (49.51 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4403/B00F/R0017/Ceiling Structures/Linings/S2	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1001 - Communications Room (29.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4403/B00F/R0017/Ceiling Structures/Linings/S2	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1002 - Toilets - Boys (3.06 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B001/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00B - R1003 - Cleaning Distributed Store (1.67 m2)						
No Asbestos						
B00B - R1004 - Distribution Board (1.78 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R1005 - Toilets - Girls (3.35 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B001/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00B - R1006 - Entry Vestibule (12.06 m2)						
No Asbestos						
B00B - R1007 - Reading Area (262.08 m2)						
No Asbestos						
B00B - R1008 - Library Office/Workroom (19.95 m2)						
No Asbestos						
B00B - R1009 - K.L.A. Store (12.99 m2)						
No Asbestos						
B00B - R1010 - Library Office/Workroom (8.45 m2)						
No Asbestos						
B00B - R1011 - K.L.A. Store (15.15 m2)						
No Asbestos						
B00B - R1012 - Music Store (13.06 m2)						
No Asbestos						
B00B - R1013 - Movement (21.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00C/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - Home Base (52.85 m2)**

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0002 - Practical Activities - 1hb (16.44 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0003 - Practical Activities - 1hb (16.44 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0004 - Home Base (52.46 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0005 - Toilets - Girls (12.1 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00C - R0006 - Toilets - Boys (12.92 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00C - R0007 - Cleaning Distributed Store (0.58 m2)

No Asbestos

B00C - R0008 - General Storeroom (11.25 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0009 - General Assistant/Bulk Store (13.97 m2)

Ceiling Structures/Linings	Vermiculite					
	4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00C - R0010 - Withdrawal Space - 1hb (13.54 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4403/B00F/R0009/Floor Coverings Res/Textile/S1	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0011 - Movement (22.66 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0012 - Movement (37.55 m2)						
Ceiling Structures/Linings	Vermiculite 4403/B00A/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1001 - Special Programs Room (21.53 m2)						
No Asbestos						
B00C - R1002 - General Storeroom (14.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4403/B00F/R0009/Floor Coverings Res/Textile/S1	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1003 - Practical Activities - 1hb (16.44 m2)						
No Asbestos						
B00C - R1004 - Home Base (52.85 m2)						
No Asbestos						
B00C - R1005 - Home Base (52.46 m2)						
No Asbestos						
B00C - R1006 - Practical Activities - 1hb (16.44 m2)						
No Asbestos						
B00C - R1007 - Toilets - Girls (12.13 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 4403/B00I/R0002/Partition Walls (Cubicles)/S3	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1008 - Toilets - Boys (13.19 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 4403/B00I/R0002/Partition Walls (Cubicles)/S3	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1009 - Cleaning Distributed Store (0.58 m2)						
No Asbestos						
B00C - R1010 - Movement (21.91 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4403/B00F/R0017/Ceiling Structures/Linings/S2	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1011 - Movement (37.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4403/B00F/R0017/Ceiling Structures/Linings/S2	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00D/Eaves Linings/S9					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	East West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00D/Gable Verge Lining/S10					Chrysotile (white asbestos)

Interior**B00D - R0001 - Home Base (52.85 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0002 - Practical Activities - 1hb (16.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0003 - Practical Activities - 1hb (16.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0004 - Home Base (52.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0005 - Movement (16.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0006 - Movement (21.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R1001 - Practical Activities - 1hb (16.44 m2)

No Asbestos

B00D - R1002 - Home Base (52.85 m2)

No Asbestos

B00D - R1003 - Home Base (52.85 m2)

No Asbestos

B00D - R1004 - Practical Activities - 1hb (16.44 m2)

No Asbestos

B00D - R1005 - Movement (21.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1968 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Ceiling Hatch	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00E/Ceiling Voids/S11					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	North South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00E/Gable Verge Lining/S12					Chrysotile (white asbestos)

Interior

B00E - R0001 - Duplicating Workroom (10.26 m2)

No Asbestos

B00E - R0002 - Sick Bay (10.37 m2)

No Asbestos

B00E - R0003 - No Access (0.35 m2)

No Asbestos

B00E - R0004 - Toilets - Boys/Girls (3.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00E - R0005 - Practical Activities - 1hb (11.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00E - R0006 - Home Base (75.8 m2)

No Asbestos

B00E - R0007 - General Storeroom (13.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00E - R0008 - Sports Store (8.1 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00E - R0009 - General Storeroom (5.4 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00E - R0010 - Movement (38.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00E - R0011 - Movement (14.63 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	Ceiling Hatch 4403/B00F/Ceiling Voids/S13					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting 4403/B00F/Gable Verge Lining/S14	10m2	North South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00F - R0001 - Home Base (56.9 m2)**

No Asbestos

B00F - R0002 - Home Base Store (3.32 m2)

No Asbestos

B00F - R0003 - Movement (6.37 m2)

No Asbestos

B00F - R0004 - Personal Effects Storage (9.63 m2)

No Asbestos

B00F - R0005 - General Storeroom (3.32 m2)

No Asbestos

B00F - R0006 - Toilets - Boys/Girls (3.68 m2)

No Asbestos

B00F - R0007 - Home Base (54.38 m2)

No Asbestos

B00F - R0008 - Withdrawal Space - 1hb (29.16 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4403/B00F/R0009/Floor Coverings Res/Textile/S1	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00F - R0009 - Withdrawal Space - 1hb (29.55 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4403/B00F/R0009/Floor Coverings Res/Textile/S1	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00F - R0010 - Home Base (55.56 m2)

No Asbestos

B00F - R0011 - Toilets - Boys/Girls (3.68 m2)

No Asbestos

B00F - R0012 - Movement (6.37 m2)

No Asbestos

B00F - R0013 - Distribution Board (0.36 m2)

No Asbestos

Note: No inspection of live electrical installation.

B00F - R0014 - Personal Effects Storage (7.33 m2)

No Asbestos

B00F - R0015 - General Storeroom (3.26 m2)

No Asbestos

B00F - R0016 - General Storeroom (3.26 m2)

No Asbestos

B00F - R0017 - Movement (83.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4403/B00F/R0017/Ceiling Structures/Linings/S2	84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00F - R0018 - Practical Activities - 1hb (10.98 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00F - R0019 - Home Base (78.02 m2)

No Asbestos

B00F - R0020 - Toilets - Boys/Girls (3.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00G/Gable Verge Lining/S15					Chrysotile (white asbestos)

Interior**B00G - R0001 - Canteen Office/Store (2.81 m2)**

No Asbestos

B00G - R0002 - Canteen Office/Store (6.51 m2)

No Asbestos

B00G - R0003 - Staff Toilet (3.12 m2)

No Asbestos

B00G - R0004 - Canteen (43.2 m2)

No Asbestos

B00G - R0005 - Raised Platform (15.93 m2)

No Asbestos

B00G - R0006 - Communal/Performance Store (7.13 m2)

No Asbestos

B00G - R0007 - Distribution Board (0.65 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00G/R0007/Wall Linings Internal/S4					Chrysotile (white asbestos)

B00G - R0008 - Communal Space (139.23 m2)

No Asbestos

B00G - R0009 - Toilets - Girls (9.58 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00G - R0010 - Sports Store (12.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0009/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00G - R0011 - Toilets - Boys (8.97 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00G - R0012 - Movement (132.32 m2)

Ceiling Structures/Linings	Flat AC Sheeting	80m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00G - R0013 - Sports Store (7.18 m2)

No Asbestos

B00G - R0014 - Hall Chair Store (5.41 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00G - R0015 - Movement (11.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00G - R0016 - Movement (37.27 m2)

Register Issue Date : Friday, 07 Jul 2017

4403 - Bradbury Public School

Page 13 of 24

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00G - R0017 - Movement (59.13 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1968 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	Ceiling Hatch	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00H/Ceiling Voids/S17					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	East West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00H/Gable Verge Lining/S16					Chrysotile (white asbestos)

Interior

B00H - R0001 - Home Base (57.21 m2)

No Asbestos

B00H - R0002 - Home Base Store (4.12 m2)

No Asbestos

B00H - R0003 - Movement (8.36 m2)

No Asbestos

B00H - R0004 - Distribution Board (0.36 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0005 - Personal Effects Storage (7.7 m2)

No Asbestos

B00H - R0006 - Home Base Store (4.12 m2)

No Asbestos

B00H - R0007 - Home Base (56.74 m2)

No Asbestos

B00H - R0008 - Home Base (56.58 m2)

No Asbestos

B00H - R0009 - Home Base Store (4.08 m2)

No Asbestos

B00H - R0010 - Movement (8.22 m2)

No Asbestos

B00H - R0011 - Personal Effects Storage (10.2 m2)

No Asbestos

B00H - R0012 - Home Base (57.06 m2)

No Asbestos

B00H - R0013 - Home Base Store (4.08 m2)

No Asbestos

B00H - R0016 - General Assistant/Bulk Store (16.13 m2)

No Asbestos

B00H - R0017 - External Movement (91.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	160m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00H/R0017/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1968 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	North South	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B001/Gable Verge Lining/S19					Chrysotile (white asbestos)	

Interior

B001 - R0001 - Cleaning Distributed Store (5.12 m2)

No Asbestos

B001 - R0002 - Toilets - Girls (31.01 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B001/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B001 - R0003 - Handwashing Facilities (8.74 m2)

No Asbestos

B001 - R0004 - Cleaning Distributed Store (7.04 m2)

No Asbestos

B001 - R0005 - General Storeroom (7.28 m2)

No Asbestos

B001 - R0006 - Handwashing Facilities (8.35 m2)

No Asbestos

B001 - R0007 - Toilets - Boys (31.3 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B001/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B001 - R0008 - Main Switch Board (4.65 m2)

No Asbestos

B001 - R0009 - Movement (31.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1968 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00J/Eaves Linings/S20					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	East West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00J/Gable Verge Lining/S21					Chrysotile (white asbestos)

Interior

B00J - R0001 - Home Base (57.68 m2)

No Asbestos

B00J - R0002 - Home Base Store (6.19 m2)

No Asbestos

B00J - R0003 - Personal Effects Storage (14.72 m2)

No Asbestos

B00J - R0004 - Special Programs Room (56.58 m2)

No Asbestos

B00J - R0005 - Special Programs Store (6.19 m2)

No Asbestos

B00J - R0006 - Home Base (56.58 m2)

No Asbestos

B00J - R0007 - Home Base Store (6.15 m2)

No Asbestos

B00J - R0008 - Personal Effects Storage (14.8 m2)

No Asbestos

B00J - R0009 - Home Base (57.84 m2)

No Asbestos

B00J - R0010 - Home Base Store (6.15 m2)

No Asbestos

B00J - R0011 - Movement (68.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1968 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00K/Eaves Linings/S22					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	East West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00K/Gable Verge Lining/S23					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					

Interior

B00K - R0001 - Home Base (56.69 m2)

No Asbestos

B00K - R0002 - Home Base Store (6.16 m2)

No Asbestos

B00K - R0003 - Personal Effects Storage (14.88 m2)

No Asbestos

B00K - R0004 - Home Base (56.38 m2)

No Asbestos

B00K - R0005 - Home Base Store (6.16 m2)

No Asbestos

B00K - R0006 - Home Base (56.38 m2)

No Asbestos

B00K - R0007 - Home Base Store (6.16 m2)

No Asbestos

B00K - R0008 - Personal Effects Storage (14.88 m2)

No Asbestos

B00K - R0009 - Home Base (57.32 m2)

No Asbestos

B00K - R0010 - Home Base Store (6.16 m2)


No Asbestos

B00K - R0011 - Movement (2.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00K - R0012 - Movement (69.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

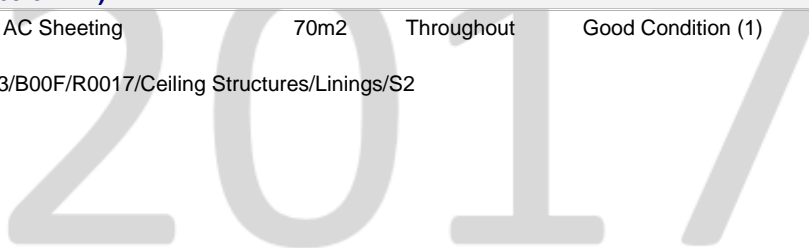

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00L/Eaves Linings/S24					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	North South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00L/Gable Verge Lining/S25					Chrysotile (white asbestos)

Interior**B00L - R0001 - Cleaning Distributed Store (3 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00L - R0002 - Handwashing Facilities (5.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00L - R0003 - Toilets - Boys (36.84 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00L - R0004 - General Storeroom (6.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00L - R0005 - Handwashing Facilities (14.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00L - R0006 - Toilets - Girls (17.89 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00L - R0007 - Toilets - Girls (18.3 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00I/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00L - R0008 - Movement (25.71 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4403/B00F/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Administration - 1968 - Steel (Steel)

Exterior

Ceiling Voids	Non Accessible Area - Keys Never Returned After Used For Nurses Training
Underfloor Voids	Non Accessible Area - Keys Never Returned After Used For Nurses Training

Interior

B00M - R0001 - Entry Vestibule (8.3 m2)

Non Accessible

B00M - R0002 - Staff Toilet (1.61 m2)

Non Accessible

B00M - R0003 - Community Clinic (10.14 m2)

Non Accessible

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - Communal Space (203.15 m2)

No Asbestos

B00N - R0002 - Raised Platform (61.01 m2)

No Asbestos

B00N - R0003 - Ramp (13.63 m2)

No Asbestos

B00N - R0004 - Toilets - Boys (7.42 m2)

No Asbestos

B00N - R0005 - P.E. Store (16.67 m2)

No Asbestos

B00N - R0006 - Movement (2.32 m2)

No Asbestos

B00N - R0007 - Communal/Performance Store (10.81 m2)

No Asbestos

B00N - R0008 - Hall Chair Store (11.26 m2)

No Asbestos

B00N - R0009 - Movement (2.98 m2)

No Asbestos

B00N - R0010 - Plant (0.77 m2)

No Asbestos

B00N - R0011 - Cleaning Distributed Store (8.21 m2)

No Asbestos

B00N - R0012 - Main Switch Board (3.06 m2)

No Asbestos

B00N - R0013 - Toilet - Lobby (3.66 m2)

No Asbestos

B00N - R0014 - Toilets - Girls (10.14 m2)

No Asbestos

B00N - R0015 - Sound Cupboard (2.71 m2)

No Asbestos

B00N - R0016 - Access Shower/Toilet/Change (7.02 m2)

No Asbestos

B00N - R0017 - Movement (5.6 m2)

No Asbestos

B00N - R0018 - Movement (13 m2)

No Asbestos

B00N - R0019 - Covered Outdoor Learning Area (181.29 m2)

No Asbestos

B00N - R0020 - Toilet - Lobby (1.84 m2)

No Asbestos

B00N - R0021 - Canteen (41.7 m2)

No Asbestos

B00N - R0022 - Canteen Office/Store (10.26 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00N - R0023 - External Movement (64.8 m2)

No Asbestos

B00N - R0024 - External Movement (3.27 m2)

No Asbestos

B00N - R0025 - External Movement (6.7 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4403_ASB_030113_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017