


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Barrack Heights Public School (4501)
Region : Illawarra and South East
State Electorate : Shellharbour
Local Government Area : Shellharbour

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : AECOM : 18 - Jun - 2015

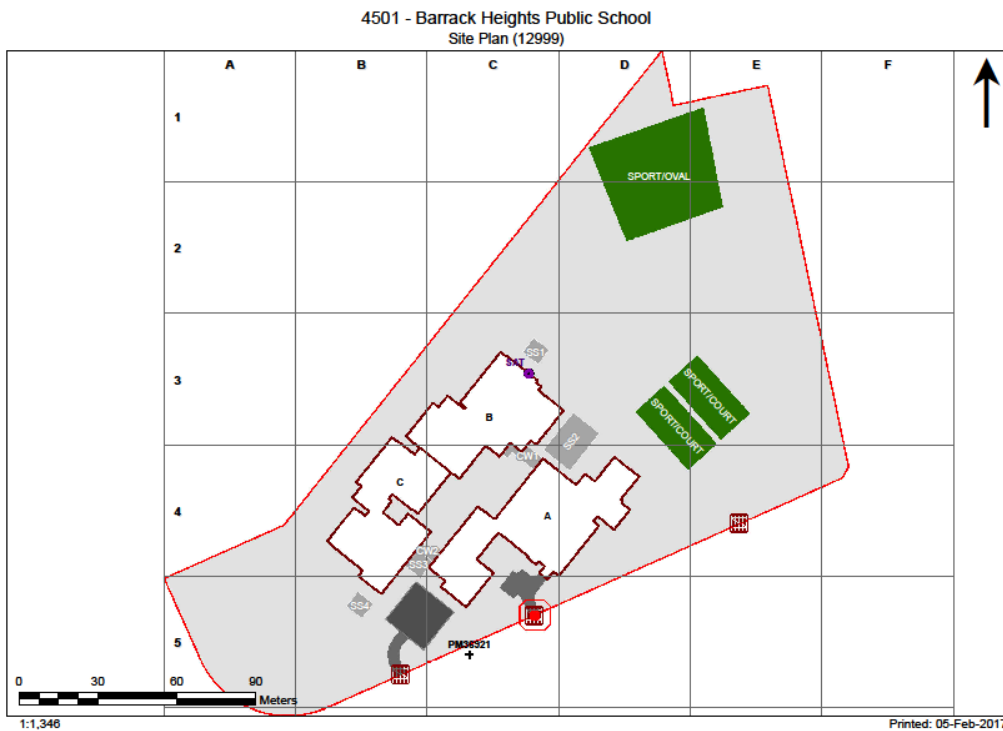

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1974 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible - raked ceilings					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00A - R0001 - Canteen (43.74 m2)**

No Asbestos

B00A - R0002 - Canteen Office/Store (2.7 m2)

No Asbestos

B00A - R0003 - Canteen Office/Store (6.54 m2)

No Asbestos

B00A - R0004 - Staff Toilet (2.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0004/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00A - R0005 - Movement (44.28 m2)

No Asbestos

B00A - R0006 - Movement (122.14 m2)

No Asbestos

B00A - R0009 - Staff Toilet (2.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0010/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0010 - Staff Toilet (2.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0010/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0012 - Movement (38.52 m2)

No Asbestos

B00A - R0013 - Movement (22.98 m2)

No Asbestos

B00A - R0018 - General Storeroom (12.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00A - R0020 - Duplicating Workroom (12.78 m2)

No Asbestos

B00A - R0021 - Staff Room Annexe (12.81 m2)

No Asbestos

B00A - R0022 - Staff Room Annexe (14.25 m2)

No Asbestos

B00A - R0024 - Main Switch Board (9.24 m2)

No Asbestos

B00A - R0025 - Movement (70.33 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00A - R0026 - Raised Platform (42.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00A - R0027 - Toilets - Girls (10.65 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0027/Partition Walls (Cubicles)/S5				Chrysotile (white asbestos)		
B00A - R0028 - Other-Vacant (1.4 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00A - R0029 - General Storeroom (8.9 m2)						
No Asbestos						
B00A - R0030 - Toilets - Boys (11.13 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0027/Partition Walls (Cubicles)/S5				Chrysotile (white asbestos)		
B00A - R0031 - Communal Space (236.58 m2)						
No Asbestos						
B00A - R0032 - Sports Store (12.29 m2)						
No Asbestos						
B00A - R0033 - General Storeroom (12.16 m2)						
No Asbestos						
B00A - R0034 - Hall Chair Store (2.72 m2)						
No Asbestos						
B00A - R0035 - Hall Chair Store (2.72 m2)						
No Asbestos						
B00A - R0036 - Cleaning Distributed Store (2.76 m2)						
No Asbestos						
B00A - R0039 - Movement (57.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00A - R0040 - Movement (18.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0040/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B00A - R0041 - Movement (9.51 m2)						
No Asbestos						
B00A - R0042 - Home Base (58.41 m2)						
Ceiling Structures/Linings	Vermiculite	4501/B00A/R0042/Ceiling Structures/Linings/S6		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0043 - Practical Activities - 1hb (11.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00A - R0044 - Outdoor Learning Area (12.89 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R0045 - Home Base (57.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	4501/B00A/R0042/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0046 - Practical Activities - 1hb (11.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00A - R0047 - Outdoor Learning Area (12.65 m2)						
No Asbestos						
B00A - R0048 - Home Base (57.68 m2)						
Ceiling Structures/Linings	Vermiculite					
	4501/B00A/R0042/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0049 - Practical Activities - 1hb (11.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00A - R0050 - Outdoor Learning Area (12.98 m2)						
No Asbestos						
B00A - R0051 - Cleaning Distributed Store (3.83 m2)						
No Asbestos						
B00A - R0052 - Movement (36.59 m2)						
No Asbestos						
B00A - R0053 - Movement (50.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	4501/B00A/R0042/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0054 - K.L.A. Store (12.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00A - R0055 - General Storeroom (13.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00A - R0056 - Interview (12.71 m2)						
No Asbestos						
B00A - R0057 - Distribution Board (1.21 m2)						
No Asbestos						
Note: No inspection of live electrical installation.						
B00A - R0058 - Movement (26.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	4501/B00A/R0042/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0059 - Toilets - Boys (9.05 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00A/R0027/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
B00A - R0060 - Toilets - Girls (9.2 m2)						

4501 Barrack Heights Public School

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0027/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
B00A - R0061 - Garden Store (12.52 m2)						
No Asbestos						
B00A - R0062 - General Assistant/Bulk Store (12.77 m2)						
No Asbestos						
B00A - R0063 - General Assistant/Bulk Store (11.37 m2)						
No Asbestos						
B00A - R0064 - Stairs (3.77 m2)						
Ceiling Structures/Linings	Vermiculite	4m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
4501/B00A/R0010/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R0065 - Stairs (3.77 m2)						
Ceiling Structures/Linings	Vermiculite	4m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
4501/B00A/R0010/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R0066 - Stairs (3.77 m2)						
Ceiling Structures/Linings	Vermiculite	4m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
4501/B00A/R0010/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R0067 - Stairs (6.18 m2)						
Ceiling Structures/Linings	Vermiculite	7m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
4501/B00A/R0010/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R0068 - Stairs (12.95 m2)						
No Asbestos						
B00A - R0069 - External Movement (141.43 m2)						
No Asbestos						
B00A - R0070 - Stairs (29.57 m2)						
No Asbestos						
B00A - R0071 - Access Shower/Toilet (4.68 m2)						
No Asbestos						
B00A - R0072 - Staff Toilet (3.02 m2)						
No Asbestos						
B00A - R0073 - Movement (19.47 m2)						
No Asbestos						
B00A - R0074 - Principal (22.7 m2)						
No Asbestos						
B00A - R0075 - Clerical/Printing (21.87 m2)						
No Asbestos						
B00A - R0076 - Clerical Office (28.05 m2)						
No Asbestos						
B00A - R0077 - Staff Room (80.18 m2)						
No Asbestos						
B00A - R0078 - Movement (4.89 m2)						
No Asbestos						
B00A - R1001 - Movement (3.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R1011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1002 - General Storeroom (8.91 m2)						
No Asbestos						
B00A - R1003 - Home Base (58.31 m2)						
No Asbestos						
B00A - R1004 - Practical Activities - 1hb (12.05 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1005 - Movement (12.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R1011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1006 - Home Base (57.8 m2)						
No Asbestos						
B00A - R1007 - Practical Activities - 1hb (11.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1008 - Movement (12.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R1011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1009 - Home Base (57.6 m2)						
No Asbestos						
B00A - R1010 - Practical Activities - 1hb (11.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1011 - Movement (12.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R1011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1012 - Movement (90.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1013 - Withdrawal Space - 1hb (6.94 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1014 - Toilets - Girls (12.08 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0027/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
B00A - R1015 - Toilets - Boys (10.5 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0027/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
B00A - R1017 - General Storeroom (15.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1018 - Toilets - Girls (9.19 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0027/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
B00A - R1019 - Toilets - Boys (9.1 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0027/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
B00A - R1020 - Distribution Board (1.21 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R1020/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1021 - Other-Community Use (36.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1022 - Movement (9.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1023 - Other-Community Use (7.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00A/R0017/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1024 - Stairs (29.99 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Library - 1974 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Area inaccessible - raked ceiling.

Underfloor Voids - Slab on Ground
 No Asbestos Found

Interior

B00B - R0001 - Reading Area (230.14 m2)

Ceiling Structures/Linings Vermiculite
 4501/B00B/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0002 - K.L.A. Store (25.01 m2)

Ceiling Structures/Linings Vermiculite
 4501/B00B/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0003 - Communications Room (14.78 m2)

Ceiling Structures/Linings Vermiculite
 4501/B00B/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0004 - Seminar/Study (14.74 m2)

Ceiling Structures/Linings Vermiculite
 4501/B00B/R0001/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0005 - Library Office/Workroom (21.68 m2)

No Asbestos

B00B - R0006 - Library Office/Workroom (8.34 m2)

No Asbestos

B00B - R0007 - K.L.A. Store (12.81 m2)

No Asbestos

B00B - R0008 - Movement (14.53 m2)

No Asbestos

B00B - R0009 - Cleaning Distributed Store (6.73 m2)

No Asbestos

B00B - R0010 - General Storeroom (3.96 m2)

Floor Coverings Res/Textile Vinyl Tiles 4m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4501/B00B/R0010/Floor Coverings Res/Textile/S10 **Chrysotile (white asbestos)**

B00B - R0011 - Craft Store (12.13 m2)

Floor Coverings Res/Textile Vinyl Tiles 13m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4501/B00B/R0010/Floor Coverings Res/Textile/S10 **Chrysotile (white asbestos)**

B00B - R0012 - Movement (6.81 m2)

No Asbestos

B00B - R0013 - Movement (19.77 m2)

Ceiling Structures/Linings Flat AC Sheeting 20m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4501/B00B/R0052/Ceiling Structures/Linings/S12 **Chrysotile (white asbestos)**

B00B - R0014 - Movement (5.47 m2)

No Asbestos

B00B - R0015 - Uniform Shop (14.82 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0016 - Movement (92.75 m2)						
No Asbestos						
B00B - R0017 - Duplicating Workroom (13.14 m2)						
No Asbestos						
B00B - R0018 - Movement (6.4 m2)						
No Asbestos						
B00B - R0019 - Toilets - Girls (12.69 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0020/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00B - R0020 - Toilets - Boys (12.72 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0020/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00B - R0021 - Movement (12.71 m2)						
Ceiling Structures/Linings	Vermiculite					
4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0022 - Movement (21.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0023 - Toilets - Boys (12.74 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0020/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00B - R0024 - Toilets - Girls (10.84 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0020/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00B - R0025 - Distribution Board (0.61 m2)						
				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R0026 - Cleaning Supplies (8.78 m2)						
No Asbestos						
B00B - R0027 - Movement (13.17 m2)						
Ceiling Structures/Linings	Vermiculite					
4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0028 - Special Programs Room (19.75 m2)						
Ceiling Structures/Linings	Vermiculite					
4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0029 - Movement (13.19 m2)						
Ceiling Structures/Linings	Vermiculite					
4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0030 - General Storeroom (3.73 m2)						
No Asbestos						
B00B - R0031 - Home Base (58.82 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0032 - Home Base Store (2.76 m2)						
Ceiling Structures/Linings	Vermiculite					
	4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0033 - Practical Activities - 1hb (11.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)
B00B - R0034 - Movement (12.74 m2)						
No Asbestos						
B00B - R0035 - Home Base (58.35 m2)						
Ceiling Structures/Linings	Vermiculite					
	4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0036 - Home Base Store (2.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0037 - Practical Activities - 1hb (11.58 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)
B00B - R0038 - Movement (12.72 m2)						
No Asbestos						
B00B - R0039 - Movement (12.05 m2)						
No Asbestos						
B00B - R0040 - Special Programs Store (14.07 m2)						
No Asbestos						
B00B - R0041 - General Storeroom (4.88 m2)						
No Asbestos						
B00B - R0042 - Movement (12.37 m2)						
No Asbestos						
B00B - R0043 - Home Base (61.01 m2)						
No Asbestos						
B00B - R0044 - Practical Activities - 1hb (11.82 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)
B00B - R0045 - Movement (13.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00B/R0052/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)
B00B - R0046 - Home Base (58.17 m2)						
No Asbestos						
B00B - R0047 - Withdrawal Space - 1hb (3.29 m2)						
No Asbestos						
B00B - R0048 - Practical Activities - 1hb (11.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0049 - Movement (13.28 m2)						
No Asbestos						
B00B - R0050 - Home Base (57.54 m2)						
No Asbestos						
B00B - R0051 - Practical Activities - 1hb (11.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
B00B - R0052 - Movement (13.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0052/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00B - R0053 - Home Base (57.47 m2)						
No Asbestos						
B00B - R0055 - Practical Activities - 1hb (11.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
B00B - R0056 - Movement (13.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0052/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00B - R0057 - Stairs (3.62 m2)						
Ceiling Structures/Linings	Vermiculite					
4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0058 - Stairs (3.96 m2)						
Ceiling Structures/Linings	Vermiculite					
4501/B00B/R0001/Ceiling Structures/Linings/S9					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0059 - Stairs (3.14 m2)						
No Asbestos						
B00B - R0060 - Stairs (9.72 m2)						
No Asbestos						
B00B - R0061 - Stairs (4.01 m2)						
No Asbestos						
B00B - R0062 - Stairs (3.81 m2)						
No Asbestos						
B00B - R1001 - Movement (4.92 m2)						
No Asbestos						
B00B - R1002 - Movement (13.05 m2)						
No Asbestos						
B00B - R1003 - Movement (15.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
B00B - R1004 - Toilets - Boys (13.02 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0020/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00B - R1005 - Toilets - Girls (10.8 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0020/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00B - R1006 - Distribution Board (0.64 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0052/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00B - R1008 - Movement (99.92 m2)						
No Asbestos						
B00B - R1010 - General Storeroom (19.59 m2)						
No Asbestos						
B00B - R1011 - Home Base (61.61 m2)						
No Asbestos						
B00B - R1012 - Practical Activities - 1hb (11.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
B00B - R1013 - Movement (13.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0052/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00B - R1014 - Home Base (61.65 m2)						
No Asbestos						
B00B - R1015 - Practical Activities - 1hb (11.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0010/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
B00B - R1016 - Movement (13.21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00B/R0052/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00B - R1017 - Stairs (14.82 m2)						
No Asbestos						
B00B - R1018 - Stairs (3.99 m2)						
No Asbestos						
B00B - R1019 - Stairs (3.99 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Area inaccessible - raked ceiling.

Underfloor Voids - Slab on Ground
No Asbestos Found

Interior**B00C - R0001 - Movement (41.32 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

B00C - R0002 - Movement (13.14 m2)

No Asbestos

B00C - R0003 - Special Programs Room (13.47 m2)

No Asbestos

B00C - R0004 - General Storeroom (5.54 m2)

No Asbestos

B00C - R0005 - Movement (13.11 m2)

No Asbestos

B00C - R0006 - Home Base (61.43 m2)

No Asbestos

B00C - R0007 - Practical Activities - 1hb (11.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

B00C - R0008 - Movement (22.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00C - R0009 - Home Base (61.62 m2)

No Asbestos

B00C - R0010 - Practical Activities - 1hb (11.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

B00C - R0011 - Movement (13.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00C - R0012 - Home Base (57.54 m2)

No Asbestos

B00C - R0013 - Practical Activities - 1hb (11.72 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

B00C - R0014 - Movement (26.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00C - R0015 - Home Base (57.87 m2)

No Asbestos

B00C - R0016 - Practical Activities - 1hb (11.63 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
B00C - R0017 - Movement (13.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00C - R0018 - Special Programs Room (9.4 m2)						
No Asbestos						
B00C - R0019 - Cleaning Supplies (12.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
B00C - R0020 - Movement (123.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00C - R0021 - Toilets - Girls (12.8 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0022/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	
B00C - R0022 - Toilets - Boys (12.9 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0022/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	
B00C - R0023 - Movement (6.33 m2)						
No Asbestos						
B00C - R0024 - General Storeroom (12.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
B00C - R0025 - Movement (12.76 m2)						
No Asbestos						
B00C - R0026 - Toilets - Girls (19.33 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0022/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	
B00C - R0027 - Toilets - Boys (19.51 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0022/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	
B00C - R0028 - Distribution Board (0.5 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0028/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)	
B00C - R0029 - Personal Effects Storage (12.92 m2)						
No Asbestos						
B00C - R0031 - Special Programs Room (19.75 m2)						
No Asbestos						
B00C - R0032 - Personal Effects Storage (13.19 m2)						
No Asbestos						
B00C - R0034 - Home Base (71.37 m2)						
No Asbestos						
B00C - R0036 - Toilets - Boys/Girls (2.06 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0036/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00C - R0037 - Practical Activities - 1hb (11.63 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
B00C - R0038 - Movement (26.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00C - R0039 - Home Base (79.6 m2)						
No Asbestos						
B00C - R0040 - Practical Activities - 1hb (11.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
B00C - R0041 - Toilets - Boys/Girls (2.08 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0036/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00C - R0042 - Movement (20.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00C - R0043 - Home Base (76.55 m2)						
No Asbestos						
B00C - R0045 - Toilets - Boys/Girls (2.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0036/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00C - R0046 - Practical Activities - 1hb (11.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
B00C - R0047 - Movement (13.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00C - R0048 - Home Base (76.59 m2)						
No Asbestos						
B00C - R0049 - Practical Activities - 1hb (11.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
B00C - R0050 - Toilets - Boys/Girls (2.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0036/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00C - R0051 - Movement (13.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4501/B00C/R0014/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00C - R0052 - Stairs (3.51 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0053 - Stairs (3.55 m2)						
No Asbestos						
B00C - R0054 - Stairs (3.49 m2)						
No Asbestos						
B00C - R0055 - Stairs (3.57 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017