


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bonnet Bay Public School (4507)
Region : Sydney
State Electorate : Miranda
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 13 - Mar - 2008
Reviewed By : AECOM : 26 - May - 2015

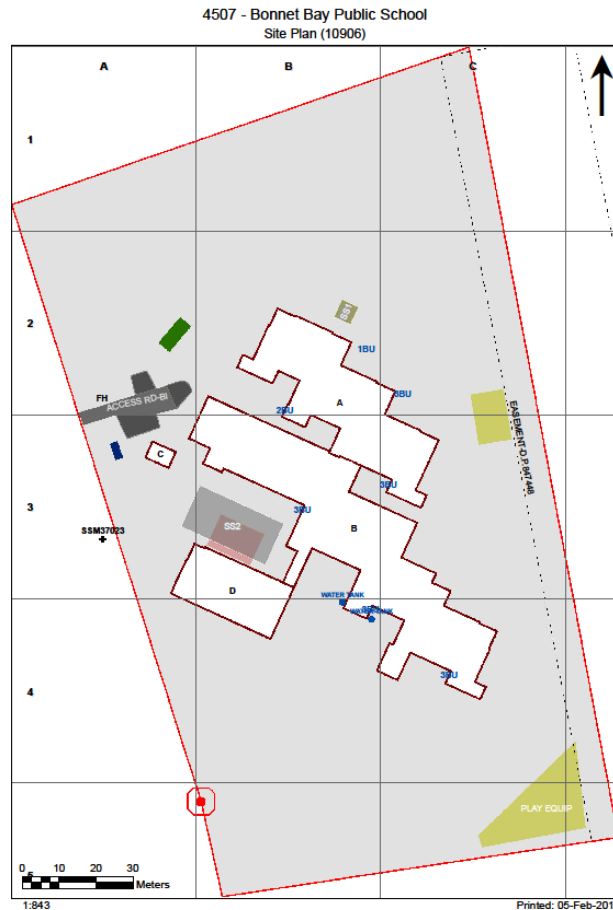

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Pupil Facilities - 1979 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	150m2	All surfaces, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00A/R0012/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Gable Verge Lining	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00A - M0001 - Withdrawal Space - 1hb

No Asbestos

B00A - M0002 - Withdrawal Space - 1hb

No Asbestos

B00A - M0003 - Stairs

No Asbestos

B00A - M0004 - Stairs

No Asbestos

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00A/R0012/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00A - R0002 - Home Base Store

No Asbestos

B00A - R0003 - Withdrawal Space - 1hb

No Asbestos

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - General Storeroom

No Asbestos

B00A - R0006 - Toilets - Boys

No Asbestos

B00A - R0007 - Toilets - Girls

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Practical Activities - 1hb

No Asbestos

B00A - R0010 - General Storeroom

No Asbestos

B00A - R0011 - Home Base

No Asbestos

B00A - R0012 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00A/R0012/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00A - R0013 - Withdrawal Space - 1hb

No Asbestos

B00A - R0014 - Home Base Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0015 - Home Base						
No Asbestos						
B00A - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4507/B00A/R0012/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0017 - Practical Activities - 1hb						
No Asbestos						
B00A - R0018 - Toilets - Boys						
No Asbestos						
B00A - R0019 - General Storeroom						
No Asbestos						
B00A - R0020 - Toilets - Girls						
No Asbestos						
B00A - R0021 - Home Base						
No Asbestos						
B00A - R0022 - Cleaning Distributed Store						
No Asbestos						
B00A - R0023 - Toilets - Boys						
No Asbestos						
B00A - R0024 - Toilets - Girls						
No Asbestos						
B00A - R0025 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R0026 - Home Base Store						
No Asbestos						
B00A - R0027 - Home Base Store						
No Asbestos						
B00A - R0028 - Home Base						
No Asbestos						
B00A - R0029 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4507/B00A/R0012/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0030 - Practical Activities - 1hb						
No Asbestos						
B00A - R0031 - General Storeroom						
No Asbestos						
B00A - R0032 - Outdoor Learning Area						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4507/B00A/R0012/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0033 - Home Base						
No Asbestos						
B00A - R0034 - Home Base Store						
No Asbestos						
B00A - R0035 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R0036 - Toilets - Boys						
No Asbestos						
B00A - R0037 - Toilets - Girls						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0038 - General Storeroom						
No Asbestos						
B00A - R0039 - Stairs						
No Asbestos						
B00A - R0040 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1979 - Brick/Block (Brick/Block)**Exterior**

Gable verge lining	Flat AC Sheeting	50m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00B/Gable Ends/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	200m2	All surfaces, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00B/Eaves Linings/S6					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior**B00B - M0001 - Withdrawal Space - 1hb**

No Asbestos

B00B - M0002 - Stairs

No Asbestos

B00B - R0001 - Outdoor Learning Area

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00B/R0043/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00B - R0002 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	4507/B00B/R0025/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0003 - Withdrawal Space - 1hb

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - General Storeroom

No Asbestos

B00B - R0006 - Toilets - Boys

No Asbestos

B00B - R0007 - Toilets - Girls

No Asbestos

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - Special Programs Room

No Asbestos

B00B - R0010 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00B/R0043/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00B - R0011 - Home Base

No Asbestos

B00B - R0012 - General Storeroom

No Asbestos

B00B - R0013 - Practical Activities - 1hb

No Asbestos

B00B - R0014 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	4507/B00B/R0025/Floor Coverings Res/Textile/S2					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0015 - Withdrawal Space - 1hb						
No Asbestos						
B00B - R0016 - Home Base						
No Asbestos						
B00B - R0017 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4507/B00B/R0043/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00B - R0018 - Practical Activities - 1hb						
No Asbestos						
B00B - R0019 - General Storeroom						
No Asbestos						
B00B - R0020 - Home Base						
No Asbestos						
B00B - R0021 - Cleaning Distributed Store						
No Asbestos						
B00B - R0022 - Toilets - Boys						
No Asbestos						
B00B - R0023 - Toilets - Girls						
No Asbestos						
B00B - R0024 - Withdrawal Space - 1hb						
No Asbestos						
B00B - R0025 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
4507/B00B/R0025/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00B - R0026 - Reading Area						
No Asbestos						
B00B - R0027 - Movement						
No Asbestos						
B00B - R0028 - K.L.A. Store						
No Asbestos						
B00B - R0029 - Library Office/Workroom						
No Asbestos						
B00B - R0030 - Library Office/Workroom						
No Asbestos						
B00B - R0031 - Communications Room						
No Asbestos						
B00B - R0032 - Toilets - Girls						
No Asbestos						
B00B - R0033 - Toilets - Boys						
No Asbestos						
B00B - R0036 - Movement						
No Asbestos						
B00B - R0037 - General Storeroom						
No Asbestos						
B00B - R0038 - Cleaning Distributed Store						
No Asbestos						
B00B - R0039 - Distribution Board						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R0041 - Communal Space						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0042 - Movement						
No Asbestos						
B00B - R0043 - Distribution Board					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4507/B00B/R0043/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00B - R0044 - General Storeroom						
No Asbestos						
B00B - R0045 - Toilets - Girls						
No Asbestos						
B00B - R0046 - Raised Platform						
No Asbestos						
B00B - R0047 - General Storeroom						
No Asbestos						
B00B - R0048 - Toilets - Boys						
No Asbestos						
B00B - R0049 - Movement						
No Asbestos						
B00B - R0050 - Movement						
No Asbestos						
B00B - R0051 - Movement						
No Asbestos						
B00B - R0052 - Cleaning Supplies						
No Asbestos						
B00B - R0053 - P.E. Store						
No Asbestos						
B00B - R0054 - Canteen						
No Asbestos						
B00B - R0055 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R0056 - Canteen Office/Store						
No Asbestos						
B00B - R0057 - Staff Toilet						
No Asbestos						
B00B - R0058 - Canteen Office/Store						
No Asbestos						
B00B - R0059 - Movement						
No Asbestos						
B00B - R0060 - Main Switch Board						
No Asbestos						
B00B - R0061 - General Assistant/Bulk Store						
No Asbestos						
B00B - R0062 - Movement						
No Asbestos						
B00B - R0063 - Movement						
No Asbestos						
B00B - R0064 - Hall Chair Store						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
4507/B00B/R0043/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00B - R0065 - Home Base						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - R0066 - Movement

No Asbestos

B00B - R0067 - Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Building Services - 1979 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Gable Ends	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00C - R0001 - General Storeroom

No Asbestos

B00C - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration/Staff Facilities - 1979 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	100m2	All surfaces, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00B/R0043/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					
Gable Ends	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00D - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00B/R0043/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00D - R0003 - Entry Vestibule

No Asbestos

B00D - R0004 - Interview

No Asbestos

B00D - R0005 - Security Store

No Asbestos

B00D - R0006 - Duplicating Workroom

Wall Linings Internal	Flat AC Sheeting					
	4507/B00D/R0006/Wall Linings Internal/S5					No Asbestos Detected

B00D - R0007 - Cleaning Distributed Store

No Asbestos

B00D - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0009 - Staff Room

No Asbestos

B00D - R0010 - Staff Room Annexe

No Asbestos

B00D - R0011 - Movement

No Asbestos

B00D - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4507/B00B/R0043/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00D - R0013 - Staff Toilet

No Asbestos

B00D - R0014 - Staff Toilet

No Asbestos

B00D - R0015 - Staff Room Annexe

No Asbestos

B00D - R0016 - Principal

No Asbestos

B00D - R0017 - Deputy Principal

No Asbestos

B00D - R0018 - Sick Bay

No Asbestos

B00D - R0019 - Clerical Office/Workroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - R0020 - Movement

No Asbestos

B00D - R0021 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017