


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Braddock Public School (4525)  
**Region :** Western Sydney  
**State Electorate :** Penrith  
**Local Government Area :** Penrith

**Initial Survey :** Noel Arnold & Associates : 13 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 25 - Nov - 2016

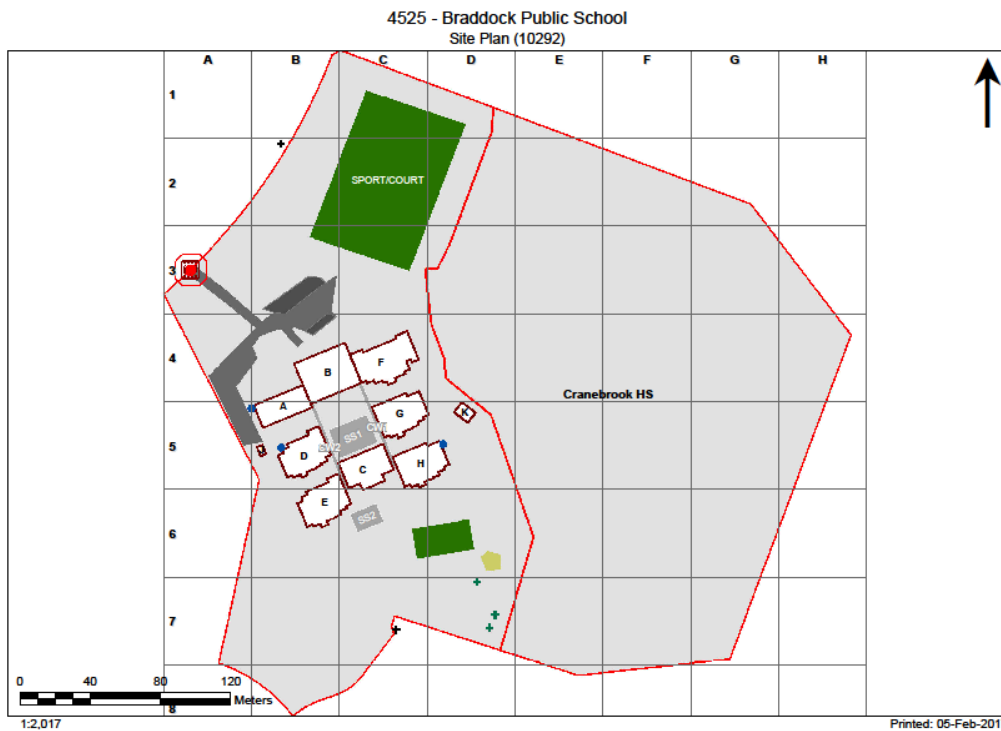

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Other-Community Use - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Gable Verge Lining/S5				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

**Interior**

**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00A - R0002 - Staff Room**

No Asbestos

**B00A - R0003 - Movement**

No Asbestos

**B00A - R0004 - Deputy Principal**

No Asbestos

**B00A - R0005 - Staff Toilet**

No Asbestos

**B00A - R0006 - Staff Toilet**

No Asbestos

**B00A - R0007 - Sick Bay**

No Asbestos

**B00A - R0008 - Principal**

No Asbestos

**B00A - R0009 - Staff Room Annexe**

No Asbestos

**B00A - R0010 - Interview**

No Asbestos

**B00A - R0011 - Other-Community Use**

No Asbestos

**B00A - R0012 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00A - R0013 - Other-Community Use**

No Asbestos

**B00A - R0014 - Other-Community Use**

No Asbestos

**B00A - R0015 - Security Store**

No Asbestos

**B00A - R0016 - Clerical Office**

No Asbestos

**B00A - R0017 - Duplicating Workroom**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Communal Facilities/Pupil Facilities - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Gable Verge Lining/S5				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

**Interior**

**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	176m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00B - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0018/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)	

**B00B - R0003 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0018/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)	

**B00B - R0004 - Raised Platform**

No Asbestos

**B00B - R0005 - Hall Chair Store**

No Asbestos

**B00B - R0006 - Communal Space**

No Asbestos

**B00B - R0007 - Movement**

No Asbestos

**B00B - R0008 - Canteen**

No Asbestos

**B00B - R0009 - Canteen Office/Store**

No Asbestos

**B00B - R0010 - Staff Toilet**

No Asbestos

**B00B - R0011 - Staff Toilet**

No Asbestos

**B00B - R0012 - Hall Chair Store**

No Asbestos

**B00B - R0013 - Sports Store**

No Asbestos

**B00B - R0014 - General Assistant/Bulk Store**

No Asbestos

**B00B - R0015 - Garden Store**

No Asbestos

**B00B - R0016 - General Assistant/Bulk Store**

No Asbestos

**B00B - R0017 - Main Switch Board**

Electrical Backing Board	Resinous Board					No Asbestos Detected
	4525/B00B/R0017/Electrical Backing Board/S6					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0018 - General Assistant/Bulk Store</b>						
No Asbestos						
<b>B00B - R0019 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0018/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0020 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0018/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0021 - Cleaning Supplies</b>						
No Asbestos						
<b>B00B - R0022 - Staff Shower/Change</b>						
No Asbestos						
<b>B00B - R0023 - General Storeroom</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Library/Tiered Learning - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Gable Verge Lining/S5				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

**Interior**

**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00C - R0002 - Withdrawal Space - 1hb**

No Asbestos

**B00C - R0003 - Reading Area**

No Asbestos

**B00C - R0004 - Communications Room**

No Asbestos

**B00C - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00C - R0006 - K.L.A. Store**

No Asbestos

**B00C - R0007 - Library Office/Workroom**

No Asbestos

**B00C - R0008 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00C - R0009 - Seminar/Study**

No Asbestos

**B00C - R0010 - Seminar/Study**

No Asbestos

**B00C - R0011 - P.E. Store**

No Asbestos

**B00C - R0012 - General Storeroom**

No Asbestos

**B00C - R0013 - Covered Outdoor Learning Area**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Gable Verge Lining/S5				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

**Interior**

**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0002 - Home Base**

No Asbestos

**B00D - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00D - R0004 - Home Base**

No Asbestos

**B00D - R0005 - Home Base Store**

No Asbestos

**B00D - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0007 - Home Base Store**

No Asbestos

**B00D - R0008 - Home Base**

No Asbestos

**B00D - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0010 - Withdrawal Space - 1hb**

No Asbestos

**B00D - R0011 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0012 - Home Base**

No Asbestos

**B00D - R0013 - Home Base Store**

No Asbestos

**B00D - R0014 - Staff Room Annexe**

No Asbestos

**B00D - R0015 - General Storeroom**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles					
	4525/B00D/R0015/Floor Coverings Res/Textile/S2					No Asbestos Detected
<b>B00D - R0016 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R0017 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00D - R0018 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0018/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
<b>B00D - R0019 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0018/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
<b>B00D - R0020 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00D - R0021 - Distribution Board</b>						
						Note: No inspection of live electrical installation.
No Asbestos						
<b>B00D - R0022 - Personal Effects Storage</b>						
No Asbestos						
<b>B00D - R0023 - Home Base Store</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Pupil Facilities - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Gable Verge Lining/S5				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

**Interior**

**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00E - R0002 - Home Base**

No Asbestos

**B00E - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00E - R0004 - Home Base**

No Asbestos

**B00E - R0005 - Home Base Store**

No Asbestos

**B00E - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00E - R0007 - Home Base Store**

No Asbestos

**B00E - R0008 - Home Base**

No Asbestos

**B00E - R0009 - Movement**

No Asbestos

**B00E - R0010 - Withdrawal Space - 1hb**

No Asbestos

**B00E - R0011 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00E - R0012 - Home Base**

No Asbestos

**B00E - R0013 - Home Base Store**

No Asbestos

**B00E - R0014 - Staff Room Annexe**

No Asbestos

**B00E - R0015 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4525/B00D/R0015/Floor Coverings Res/Textile/S2					

**B00E - R0016 - Movement**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0017 - Practical Activities - 1hb**

No Asbestos

**B00E - R0018 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0018/Partition Walls (Cubicles)/S3				<b>Chrysotile (white asbestos)</b>		

**B00E - R0019 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0018/Partition Walls (Cubicles)/S3				<b>Chrysotile (white asbestos)</b>		

**B00E - R0020 - Cleaning Distributed Store**

No Asbestos

**B00E - R0021 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0022 - Personal Effects Storage**

No Asbestos

**B00E - R0023 - Home Base Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Gable Verge Lining/S5				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

**Interior**

**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0002 - Home Base**

No Asbestos

**B00F - R0003 - Home Base**

No Asbestos

**B00F - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0005 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0007 - Home Base**

No Asbestos

**B00F - R0008 - Home Base Store**

No Asbestos

**B00F - R0009 - Home Base Store**

No Asbestos

**B00F - R0010 - Practical Activities - 1hb**

No Asbestos

**B00F - R0011 - Home Base**

No Asbestos

**B00F - R0012 - Home Base Store**

No Asbestos

**B00F - R0013 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0014 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0015 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
---------	----------------------	--------	--------------------	--------------------	-------------	------------------

Sample No				Test Result		
-----------	--	--	--	-------------	--	--

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00F - R0016 - Home Base**

No Asbestos

**B00F - R0017 - Home Base Store**

No Asbestos

**B00F - R0018 - Staff Room Annexe**

No Asbestos

**B00F - R0019 - Disabled Toilet**

No Asbestos

**B00F - R0020 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0021 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00F - R0022 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0023 - Toilets - Boys/Girls**

No Asbestos

**B00F - R0024 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00F - R0025 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0018/Partition Walls (Cubicles)/S3				<b>Chrysotile (white asbestos)</b>		

**B00F - R0026 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0018/Partition Walls (Cubicles)/S3				<b>Chrysotile (white asbestos)</b>		

**B00F - R0027 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
4525/B00D/R0015/Floor Coverings Res/Textile/S2				<b>No Asbestos Detected</b>		

**B00F - R0028 - Home Base Store**

No Asbestos

**B00F - R0029 - Withdrawal Space - 1hb**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Gable Verge Lining/S5				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

**Interior**

**B00G - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00G - R0002 - Home Base**

No Asbestos

**B00G - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00G - R0004 - Home Base**

No Asbestos

**B00G - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00G - R0006 - Home Base Store**

No Asbestos

**B00G - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00G - R0008 - Home Base**

No Asbestos

**B00G - R0009 - Withdrawal Space - 1hb**

No Asbestos

**B00G - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00G - R0011 - Home Base**

No Asbestos

**B00G - R0012 - Home Base Store**

No Asbestos

**B00G - R0013 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles				
	4525/B00D/R0015/Floor Coverings Res/Textile/S2				No Asbestos Detected

**B00G - R0014 - Practical Activities - 1hb**

No Asbestos

**B00G - R0015 - Home Base Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00G - R0016 - Cleaning Distributed Store**

No Asbestos

**B00G - R0017 - Distribution Board** Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0018 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	------	------------	--------------------	---------	--------------------

4525/B00D/R0018/Partition Walls (Cubicles)/S3 **Chrysotile (white asbestos)**

**B00G - R0019 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	------	------------	--------------------	---------	--------------------

4525/B00D/R0018/Partition Walls (Cubicles)/S3 **Chrysotile (white asbestos)**

**B00G - R0020 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

4525/B00D/R0001/Ceiling Structures/Linings/S1 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00G - R0021 - Staff Room Annexe**

No Asbestos

**B00G - R0022 - Home Base Store**

No Asbestos

**B00G - R0023 - Personal Effects Storage**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Gable Verge Lining/S5				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00F/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

**Interior**

**B00H - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00H - R0002 - Home Base**

No Asbestos

**B00H - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00H - R0004 - Home Base**

No Asbestos

**B00H - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00H - R0006 - Home Base Store**

No Asbestos

**B00H - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00H - R0008 - Home Base**

No Asbestos

**B00H - R0009 - Withdrawal Space - 1hb**

No Asbestos

**B00H - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4525/B00D/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00H - R0011 - Home Base**

No Asbestos

**B00H - R0012 - Home Base Store**

No Asbestos

**B00H - R0013 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles				
	4525/B00D/R0015/Floor Coverings Res/Textile/S2				No Asbestos Detected

**B00H - R0014 - Practical Activities - 1hb**

No Asbestos

**B00H - R0015 - Home Base Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00H - R0016 - Cleaning Distributed Store**

No Asbestos

**B00H - R0017 - Distribution Board** Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0018 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0018/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	

**B00H - R0019 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0018/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	

**B00H - R0020 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4525/B00D/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00H - R0021 - Staff Room Annexe**

No Asbestos

**B00H - R0022 - Home Base Store**

No Asbestos

**B00H - R0023 - Personal Effects Storage**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities - 1981 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

**Interior**

**B00J - R0001 - General Storeroom**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Other-Community Use - 2006 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00K - R0001 - Other-Community Use**

No Asbestos

**B00K - R0002 - General Storeroom**

No Asbestos

**B00K - R0003 - General Storeroom**

No Asbestos

**B00K - R0004 - Toilets-Unisex**

No Asbestos

**B00K - R0005 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

4525\_ASB\_010713\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017