


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** Gillieston Public School (1982)  
**Region :** Hunter/Central Coast  
**State Electorate :** Maitland  
**Local Government Area :** Maitland

**Initial Survey :** Noel Arnold & Associates : 26 - May - 2008  
**Reviewed By :** Greencap-NAA : 07 - Oct - 2015

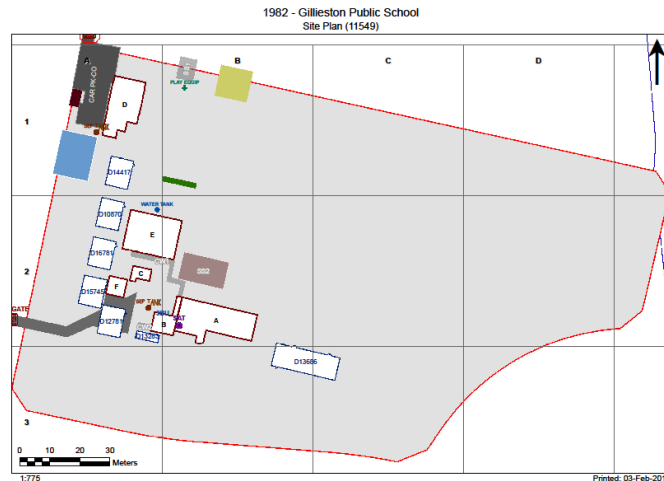

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - Administration/Library - 1912 - Timber (Timber)****Exterior**

|                  |                               |      |                    |                            |   |                       |
|------------------|-------------------------------|------|--------------------|----------------------------|---|-----------------------|
| Eaves Linings    | Flat AC Sheeting              | 30m2 | Throughout         | Good Condition (1)         | Low (1)   | Low Priority (2-3)    |
|                  | 1982/B00D/Eaves Linings/S5    |      |                    |                            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b> |                       |
| Ceiling Voids    | No Asbestos Found             |      |                    |                            |   |                       |
| Underfloor Voids | AC Fragments/Debris           | 5m2  | Variable positions | Some Damage - Unsealed (3) | Low (1)   | Medium Priority (4-5) |
|                  | 1982/B00A/Underfloor Voids/S9 |      |                    |                            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>                               |                       |

**Interior****B00A - R0001 - Special Programs Room**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |  |  |  |  |                             |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S11 |  |  |  |  |                             |

**B00A - R0002 - General Storeroom**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |  |  |  |  |                             |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S11 |  |  |  |  |                             |

**B00A - R0003 - Cleaning Distributed Store**

No Asbestos

**B00A - R0004 - General Storeroom**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet                                     |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |  |  |  |  |                             |

**B00A - R0005 - Staff Toilet**

|                       |  |  |  |  |  |                             |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting                         |  |  |  |  | <b>No Asbestos Detected</b> |
|                       | 1982/B00A/R0005/Wall Linings Internal/S3 |  |  |  |  |                             |

**B00A - R0006 - Movement**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |  |  |  |  |                             |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S11 |  |  |  |  |                             |

**B00A - R0007 - Communications Room**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet                                     |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |  |  |  |  |                             |

**B00A - R0008 - Home Base Store**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |  |  |  |  |                             |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S11 |  |  |  |  |                             |

**B00A - R0009 - Library Office/Workroom**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |  |  |  |  |                             |

| Product                                      | Material Description                            | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|--|---|--------|--------------------|--------------------|-------------|--|
| Sample No                                    |   |        |                    |                    | Test Result |  |
| Floor Coverings Res/Textile                  | Adhesive  |        |                    |                    |             |  |
|  | 1982/B00A/R0010/Floor Coverings Res/Textile/S11 |        |                    |                    |             | <b>No Asbestos Detected</b>                                      |
| <b>B00A - R0010 - Entry Vestibule</b>        |   |        |                    |                    |             |  |
| Floor Coverings Res/Textile                  | Vinyl Tiles (Under Floor Covering/Carpet)       |        |                    |                    |             |  |
|  | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |        |                    |                    |             | <b>No Asbestos Detected</b>                                      |
| Floor Coverings Res/Textile                  | Adhesive  |        |                    |                    |             |  |
|  | 1982/B00A/R0010/Floor Coverings Res/Textile/S11 |        |                    |                    |             | <b>No Asbestos Detected</b>                                      |
| Electrical Backing Board                     | Resinous Board                                  | 1Unit  | South              | Good Condition (1) | Low (1)     | Low Priority (2-3)   |
| <b>Assumed Asbestos - Electrical Hazard</b>  |   |        |                    |                    |             |  |
| <b>B00A - R0011 - Withdrawal Space - 1hb</b> |   |        |                    |                    |             |  |
| Ceiling Structures/Linings                   | Flat AC Sheeting                                | 11m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)   |
|  | 1982/B00D/R0004/Ceiling Structures/Linings/S7   |        |                    |                    |             | <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b> |
| <b>B00A - R0012 - Reading Area</b>           |   |        |                    |                    |             |  |
| Wall Linings Internal                        | Flat AC Sheeting                                | 100m2  | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)   |
|  | 1982/B00A/R0012/Wall Linings Internal/S4        |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>    |
| Ceiling Structures/Linings                   | Flat AC Sheeting                                | 45m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)   |
|  | 1982/B00D/R0004/Ceiling Structures/Linings/S7   |        |                    |                    |             | <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b> |
| Floor Coverings Res/Textile                  | Vinyl Tiles (Under Floor Covering/Carpet)       |        |                    |                    |             |  |
|  | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |        |                    |                    |             | <b>No Asbestos Detected</b>                                      |
| Floor Coverings Res/Textile                  | Adhesive  |        |                    |                    |             |  |
|  | 1982/B00A/R0010/Floor Coverings Res/Textile/S11 |        |                    |                    |             | <b>No Asbestos Detected</b>                                      |
| <b>B00A - R0013 - Reading Area</b>           |   |        |                    |                    |             |  |
| Wall Linings Internal                        | Flat AC Sheeting                                | 120m2  | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)   |
|  | 1982/B00A/R0012/Wall Linings Internal/S4        |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>    |
| Ceiling Structures/Linings                   | Flat AC Sheeting                                | 62m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)   |
|  | 1982/B00D/R0004/Ceiling Structures/Linings/S7   |        |                    |                    |             | <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b> |
| Floor Coverings Res/Textile                  | Vinyl Tiles (Under Floor Covering/Carpet)       |        |                    |                    |             |  |
|  | 1982/B00A/R0010/Floor Coverings Res/Textile/S10 |        |                    |                    |             | <b>No Asbestos Detected</b>                                      |
| Floor Coverings Res/Textile                  | Adhesive  |        |                    |                    |             |  |
|  | 1982/B00A/R0010/Floor Coverings Res/Textile/S11 |        |                    |                    |             | <b>No Asbestos Detected</b>                                      |
| <b>B00A - R0015 - Other</b>                  |   |        |                    |                    |             |  |
| No Asbestos                                  |   |        |                    |                    |             |  |
| <b>B00A - R0016 - External Movement</b>      |   |        |                    |                    |             |  |
| No Asbestos                                  |   |        |                    |                    |             |  |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**

**Exterior**

|                                   |                   |
|-----------------------------------|-------------------|
| Ceiling Voids - Flat Roof         | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

**Interior**

**B00B - R0001 - Toilets - Boys**

|  |                  |     |            |                    |                                    |                    |
|--|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 7m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
| 1982/B00B/R0003/Ceiling Structures/Linings/S12 |                  |     |            |                    | <b>Chrysotile (white asbestos)</b> |                    |

**B00B - R0002 - Toilets - Boys**

|  |                  |     |            |                    |                                    |                    |
|--|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
| 1982/B00B/R0003/Ceiling Structures/Linings/S12 |                  |     |            |                    | <b>Chrysotile (white asbestos)</b> |                    |

**B00B - R0003 - Toilets - Girls**

|  |                  |     |            |                    |                                    |                    |
|--|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 7m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
| 1982/B00B/R0003/Ceiling Structures/Linings/S12 |                  |     |            |                    | <b>Chrysotile (white asbestos)</b> |                    |

**B00B - R0004 - External Movement**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00C - Pupil Facilities - 1950 - Timber (Timber)**

**Exterior**

|                           |                   |
|---------------------------|-------------------|
| Ceiling Voids - Flat Roof | No Asbestos Found |
| Underfloor Voids          | No Asbestos Found |

**Interior**

**B00C - R0001 - Personal Effects Storage**

No Asbestos

**B00C - R0002 - Garden Store**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    | Test Result        |             |                  |

**B00D - Pupil Facilities - 1893 - Brick/Block (Brick/Block)****Exterior**

|                  |                               |      |                    |   |         |                             |
|------------------|-------------------------------|------|--------------------|---|---------|-----------------------------|
| In-fill-panel    | Flat AC Sheeting              | 10m2 | North, West        | Good Condition (1)  | Low (1) | Low Priority (2-3)          |
|                  | 1982/B00D/In-fill-panel/S1    |      |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>                               |         |                             |
| Eaves Linings    | Flat AC Sheeting              | 8m2  | South              | Good Condition (1)  | Low (1) | Low Priority (2-3)          |
|                  | 1982/B00D/Eaves Linings/S5    |      |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b> |         |                             |
| Wall Cladding    | Flat AC Sheeting              |      |                    |   |         | <b>No Asbestos Detected</b> |
|                  | 1982/B00D/Wall Cladding/S6    |      |                    |   |         |                             |
| Ceiling Voids    | No Asbestos Found             |      |                    |   |         |                             |
| Underfloor Voids | AC Fragments/Debris           | 5m2  | Variable positions | Some Damage - Unsealed (3)  | Low (1) | Medium Priority (4-5)       |
|                  | 1982/B00A/Underfloor Voids/S9 |      |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>                               |         |                             |

**Interior****B00D - R0001 - Entry Vestibule**

No Asbestos

**B00D - R0002 - Staff Toilet**

|                            |   |     |            |  |         |                             |
|----------------------------|---|-----|------------|--|---------|-----------------------------|
| Wall Linings Internal      | Flat AC Sheeting                              |     |            |  |         | <b>No Asbestos Detected</b> |
|                            | 1982/B00D/R0002/Wall Linings Internal/S2      |     |            |  |         |                             |
| Ceiling Structures/Linings | Flat AC Sheeting                              | 2m2 | Throughout | Good Condition (1)   | Low (1) | Low Priority (2-3)          |
|                            | 1982/B00D/R0004/Ceiling Structures/Linings/S7 |     |            | <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b> |         |                             |

**B00D - R0003 - Staff Kitchen**

|                            |   |      |            |  |         |                    |
|----------------------------|---|------|------------|--|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 14m2 | Throughout | Good Condition (1)   | Low (1) | Low Priority (2-3) |
|                            | 1982/B00D/R0004/Ceiling Structures/Linings/S7 |      |            | <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b> |         |                    |

**B00D - R0004 - Movement**

|                            |   |      |                   |  |         |                             |
|----------------------------|---|------|-------------------|--|---------|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 10m2 | South, Throughout | Good Condition (1)   | Low (1) | Low Priority (2-3)          |
|                            | 1982/B00D/R0004/Ceiling Structures/Linings/S7 |      |                   | <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b> |         |                             |
| Wall Linings Internal      | Flat AC Sheeting                              |      |                   |  |         | <b>No Asbestos Detected</b> |
|                            | 1982/B00D/R0004/Wall Linings Internal/S8      |      |                   |  |         |                             |

**B00D - R0005 - Shower/Change**

|                       |  |  |  |  |  |                             |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting                         |  |  |  |  | <b>No Asbestos Detected</b> |
|                       | 1982/B00D/R0002/Wall Linings Internal/S2 |  |  |  |  |                             |

**B00D - R0006 - Staff Room Annexe**

|                            |   |      |            |  |         |                    |
|----------------------------|---|------|------------|--|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 13m2 | Throughout | Good Condition (1)   | Low (1) | Low Priority (2-3) |
|                            | 1982/B00D/R0004/Ceiling Structures/Linings/S7 |      |            | <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b> |         |                    |

**B00D - R0007 - Duplicating Workroom**

No Asbestos

**B00D - R0008 - Principal**

No Asbestos

**B00D - R0009 - Movement**

No Asbestos

**B00D - R0010 - Staff Room**

No Asbestos

**B00D - R0011 - External Movement**

No Asbestos

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - R0012 - Security Store**

|                       |                            |     |                         |                    |   |                    |
|-----------------------|----------------------------|-----|-------------------------|--------------------|---|--------------------|
| Wall Linings Internal | Flat AC Sheeting           | 8m2 | North, West, Throughout | Good Condition (1) | Low (1)   | Low Priority (2-3) |
|                       | 1982/B00D/In-fill-panel/S1 |     |                         |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |                    |

**B00D - R0013 - Clerical Office**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00E - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00E - R0001 - External Movement**

No Asbestos

**B00E - R0002 - Practical Activities - 1hb**

No Asbestos

**B00E - R0003 - Home Base Store**

No Asbestos

**B00E - R0004 - Home Base**

No Asbestos

**B00E - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00E - R0006 - Home Base**

No Asbestos

**B00E - R0007 - Home Base Store**

No Asbestos

**B00E - R0008 - Practical Activities - 1hb**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00F - Building Services - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids - Raked Ceiling      No Asbestos Found

Underfloor Voids - Slab on Ground      No Asbestos Found

**Interior**

**B00F - R0001 - General Storeroom**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10870 - Learning Unit - Standard With P.A.A. : Placement Date - 25/02/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 601 - D12781 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

**Exterior**

|             |                     |                  |          |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2  |
| Landing     | Compressed AC Sheet | Assumed Asbestos | 1.2 m2   |
| Eave Lining | Flat AC Sheet       | Assumed Asbestos | 11.52 m2 |

**Interior**

**R1 - Entry**

|                |               |                  |       |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos | 8 m2  |

**R2 - General Learning Space**

|                |               |                  |       |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos | 55 m2 |

**R3 - Store**

|         |               |                  |       |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 10 m2 |
|---------|---------------|------------------|-------|

**OS 840 - D13283 - Girls Toilet : Placement Date - 20/11/2008**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Toilets-Girls**


No Asbestos Found.

**OS 810 - D13686 - FSU/Shelter/Stores : Placement Date - 30/07/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

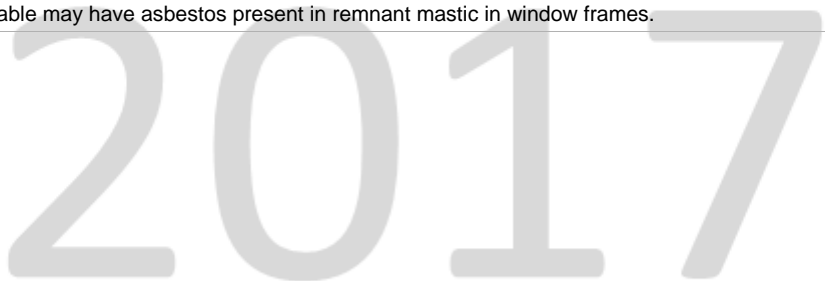

| Product  | Material Description | Extent           | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|------------------|--------------------|--------------------|-------------|------------------|
| Sample No  |                      |                  |                    |                    | Test Result |                  |
| <b>Interior</b>  |                      |                  |                    |                    |             |                  |
| <b>R1 - Canteen</b>  |                      |                  |                    |                    |             |                  |
| No Asbestos Found.   |                      |                  |                    |                    |             |                  |
| <b>R2 - Covered Area</b>   |                      |                  |                    |                    |             |                  |
| No Asbestos Found.   |                      |                  |                    |                    |             |                  |
| <b>R3 - Store</b>  |                      |                  |                    |                    |             |                  |
| No Asbestos Found.   |                      |                  |                    |                    |             |                  |
| <b>R4 - Sports Store</b>   |                      |                  |                    |                    |             |                  |
| No Asbestos Found.   |                      |                  |                    |                    |             |                  |
| <b>R5 - Garden Store</b>   |                      |                  |                    |                    |             |                  |
| No Asbestos Found.   |                      |                  |                    |                    |             |                  |
| <b>R6 - Change Room</b>  |                      |                  |                    |                    |             |                  |
| No Asbestos Found.   |                      |                  |                    |                    |             |                  |
| <b>R7 - Store</b>  |                      |                  |                    |                    |             |                  |
| No Asbestos Found.   |                      |                  |                    |                    |             |                  |
| <b>OS 601 - D14417 - Learning Unit - Standard/Withdrawal : Placement Date - 4/09/2003</b>        |                      |                  |                    |                    |             |                  |
| <b>Exterior</b>  |                      |                  |                    |                    |             |                  |
| Step Treads  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.08 m2          |
| Landing  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.2 m2           |
| Eave Lining  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 11.52 m2         |
| <b>Interior</b>  |                      |                  |                    |                    |             |                  |
| <b>R1 - Entry</b>  |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 8 m2             |
| <b>R2 - General Learning Space</b>   |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 55 m2            |
| <b>R3 - Store</b>  |                      |                  |                    |                    |             |                  |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 10 m2            |
| <b>OS 602 - D15745 - Learning Unit - Standard With P.A.A. : Placement Date - 30/09/2013</b>      |                      |                  |                    |                    |             |                  |
| <b>Exterior</b>  |                      |                  |                    |                    |             |                  |
| Step Treads  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.08 m2          |
| Landing  | Compressed AC Sheet  | Assumed Asbestos |                    |                    |             | 1.2 m2           |
| Eave Lining  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 11.52 m2         |
| <b>Interior</b>  |                      |                  |                    |                    |             |                  |
| <b>R1 - Learning space/withdrawal/entry</b>  |                      |                  |                    |                    |             |                  |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 70 m2            |
| <b>R2 - Home Base Store</b>  |                      |                  |                    |                    |             |                  |
| End wall panel   | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 18 m2            |
| Ceiling  | Flat AC Sheet        | Assumed Asbestos |                    |                    |             | 3 m2             |
| <b>OS 603 - D16781 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 5/12/2012</b>   |                      |                  |                    |                    |             |                  |
| Note: This refurbished demountable may have asbestos present in remnant mastic in window frames. |                      |                  |                    |                    |             |                  |
| <b>Exterior</b>  |                      |                  |                    |                    |             |                  |
| No Asbestos Found.   |                      |                  |                    |                    |             |                  |

| Product                                     | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No                                   |                      |        |                    |                    | Test Result |                  |
| <b>Interior</b>                             |                      |        |                    |                    |             |                  |
| <b>R1 - Learning space/withdrawal/entry</b> |                      |        |                    |                    |             |                  |
| No Asbestos Found.                          |                      |        |                    |                    |             |                  |
| <b>R2 - Home Base Store</b>                 |                      |        |                    |                    |             |                  |
| No Asbestos Found.                          |                      |        |                    |                    |             |                  |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017