


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Goonellabah Public School (2041)  
**Region :** North Coast  
**State Electorate :** Lismore  
**Local Government Area :** Lismore

**Initial Survey :** Noel Arnold & Associates : 12 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 08 - Oct - 2015

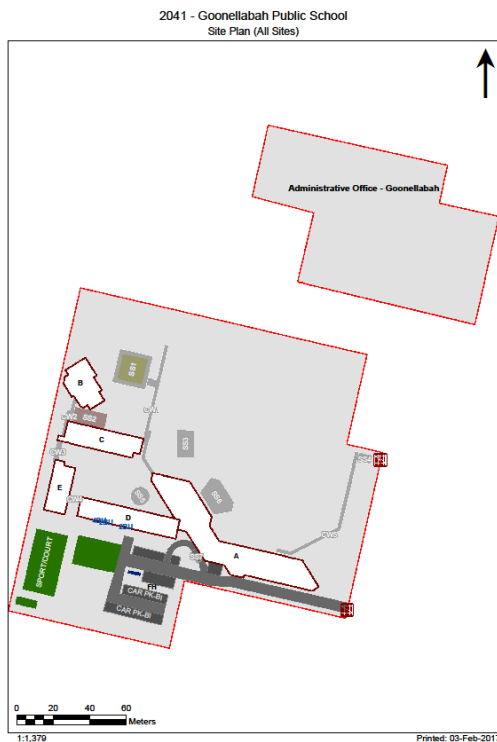

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Library/Administration - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 2041/B00A/Eaves Linings/S9	<b>No Asbestos Detected</b>				
Underfloor Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					

**Interior**

**B00A - R0001 - Plant (4.34 m2)**

No Asbestos

**B00A - R0002 - Special Programs Room (38.53 m2)**

No Asbestos

**B00A - R0003 - Reading Area (227.96 m2)**

No Asbestos

**B00A - R0004 - Security Store (11.58 m2)**

No Asbestos

**B00A - R0005 - Seminar/Study (11.79 m2)**

No Asbestos

**B00A - R0006 - Seminar/Study (15.41 m2)**

No Asbestos

**B00A - R0007 - Library Office/Workroom (26.61 m2)**

No Asbestos

**B00A - R0009 - Movement (26.43 m2)**

No Asbestos

**B00A - R0010 - Security Store (12.18 m2)**

No Asbestos

**B00A - R0011 - Staff Toilet (3.78 m2)**

No Asbestos

**B00A - R0012 - Staff Toilet (3.75 m2)**

No Asbestos

**B00A - R0013 - Deputy Principal (12.15 m2)**

No Asbestos

**B00A - R0014 - Deputy Principal (12.11 m2)**

No Asbestos

**B00A - R0015 - Duplicating Workroom (32.37 m2)**

No Asbestos

**B00A - R0016 - Clerical Office (11.83 m2)**

No Asbestos

**B00A - R0017 - Principal (20.42 m2)**

No Asbestos

**B00A - R0018 - Sick Bay (12.04 m2)**

No Asbestos

**B00A - R0019 - Entry Vestibule (20.07 m2)**

No Asbestos

**B00A - R0020 - Movement (5.6 m2)**

No Asbestos

**B00A - R0021 - Clerical Office (12.96 m2)**

No Asbestos

**B00A - R0022 - Staff Toilet (2.24 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
<b>B00A - R0023 - Canteen (34.01 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Canteen Office/Store (3.24 m2)</b>						
No Asbestos						
<b>B00A - R0025 - Canteen Office/Store (4.7 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Staff Toilet (3.1 m2)</b>						
No Asbestos						
<b>B00A - R0027 - Raised Platform (67.43 m2)</b>						
No Asbestos						
<b>B00A - R0028 - Communal Space (218.61 m2)</b>						
No Asbestos						
<b>B00A - R0029 - Hall Chair Store (5.76 m2)</b>						
No Asbestos						
<b>B00A - R0030 - Hall Chair Store (12.46 m2)</b>						
No Asbestos						
<b>B00A - R0031 - General Assistant/Bulk Store (8.01 m2)</b>						
No Asbestos						
<b>B00A - R0032 - Toilets - Boys (8.13 m2)</b>						
No Asbestos						
<b>B00A - R0037 - Sports Store (20.22 m2)</b>						
No Asbestos						
<b>B00A - R0038 - Garden Store (12.21 m2)</b>						
No Asbestos						
<b>B00A - R0041 - Distribution Board (0.9 m2)</b>						Note: No inspection of live electrical installation.
No Asbestos						
<b>B00A - R0042 - Movement (24.35 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00A/R0042/Ceiling Structures/Linings/S15						<b>Chrysotile (white asbestos)</b>
<b>B00A - R0046 - External Movement (18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2041/B00A/R0046/Ceiling Structures/Linings/S19				<b>No Asbestos Detected</b>
<b>B00A - R0047 - Staff Room (63.73 m2)</b>						
No Asbestos						
<b>B00A - R0048 - Staff Kitchen (11.68 m2)</b>						
No Asbestos						
<b>B00A - R0049 - Distribution Board (6.7 m2)</b>						Note: No inspection of live electrical installation.
Ceiling Structures/Linings	Flat AC Sheeting	2041/B00A/R0056/Ceiling Structures/Linings/S31				<b>No Asbestos Detected</b>
<b>B00A - R0050 - Toilets - Boys (15.26 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2041/B00A/R0056/Ceiling Structures/Linings/S31				<b>No Asbestos Detected</b>
<b>B00A - R0051 - Toilet - Lobby (5.8 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2041/B00A/R0056/Ceiling Structures/Linings/S31				<b>No Asbestos Detected</b>
<b>B00A - R0052 - Toilets - Girls (20.38 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2041/B00A/R0056/Ceiling Structures/Linings/S31				<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0053 - Cleaning Distributed Store (2.37 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	2041/B00A/R0056/Ceiling Structures/Linings/S31					<b>No Asbestos Detected</b>
<b>B00A - R0054 - General Assistant/Bulk Store (16.53 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	2041/B00A/R0056/Ceiling Structures/Linings/S31					<b>No Asbestos Detected</b>
<b>B00A - R0055 - Garden Store (25.3 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	2041/B00A/R0056/Ceiling Structures/Linings/S31					<b>No Asbestos Detected</b>
<b>B00A - R0056 - P.E. Store (31.93 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	2041/B00A/R0056/Ceiling Structures/Linings/S31					<b>No Asbestos Detected</b>
<b>B00A - R0057 - External Movement (299.73 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	2041/B00A/R0056/Ceiling Structures/Linings/S31					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Support Unit - 1981 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00B/Eaves Linings/S10					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior****B00B - R0001 - Movement (8.32 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00B/R0001/Ceiling Structures/Linings/S30					<b>Chrysotile (white asbestos)</b>

**B00B - R0002 - Home Base (56.49 m2)**

No Asbestos

**B00B - R0003 - Home Base Store (4.57 m2)**

No Asbestos

**B00B - R0006 - Withdrawal Space - 1hb (8.31 m2)**

No Asbestos

**B00B - R0009 - Staff Room Annexe (13.61 m2)**

No Asbestos

**B00B - R0012 - Practical Activities - 1hb (12.97 m2)**

No Asbestos

**B00B - R0013 - Home Base - S (57.07 m2)**

No Asbestos

**B00B - R0014 - Home Base Store - S (5.15 m2)**

No Asbestos

**B00B - R0015 - Movement (9.04 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00B/R0015/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

**B00B - R0016 - Movement (13.06 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00B/R0016/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos)</b>

**B00B - R0017 - Home Base (56.18 m2)**

No Asbestos

**B00B - R0018 - Withdrawal Space - 1hb (8.31 m2)**

No Asbestos

**B00B - R0019 - Home Base Store (4.28 m2)**

No Asbestos

**B00B - R0020 - Movement (4.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00B/R0020/Ceiling Structures/Linings/S22					<b>Chrysotile (white asbestos)</b>

**B00B - R0021 - Main Switch Board (3.3 m2)**

No Asbestos

**B00B - R0022 - Movement (7.9 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00B/R0022/Ceiling Structures/Linings/S23					<b>Chrysotile (white asbestos)</b>

**B00B - R0023 - Personal Effects - Pre (20.84 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00B - R0024 - Withdrawal - Pre (30.95 m2)**

No Asbestos

**B00B - R0025 - Staff Toilet - Pre (3.66 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Pupil Facilities - 1973 - Brick/Block (Brick/Block)****Exterior**

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00C - R0001 - Movement (103.02 m2)**

No Asbestos

**B00C - R0002 - Home Base (52.5 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0003 - Practical Activities - 1hb (19.3 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0004 - Distribution Board (0.66 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0005 - Toilets - Boys/Girls (2.61 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0006 - Practical Activities - 1hb (15.36 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0007 - Home Base (85.32 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0008 - Home Base (83.73 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0009 - Practical Activities - 1hb (15.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0010 - Toilets - Boys/Girls (3.04 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00C - R0011 - Cleaning Supplies (11.33 m2)</b>						
No Asbestos						
<b>B00C - R0012 - Disabled Toilet (9.81 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2041/B00C/R0012/Ceiling Structures/Linings/S24					
<b>B00C - R0013 - Movement (8.35 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Movement (87.48 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R1001/Ceiling Structures/Linings/S25				Chrysotile (white asbestos)	
<b>B00C - R1002 - Staff Toilet (3.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00C - R1003 - Cleaning Distributed Store (3.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00C - R1004 - Uniform Shop (15.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00C - R1005 - Interview (15.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00C - R1006 - Withdrawal Space - 1hb (15.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00C - R1007 - General Storeroom (7.28 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00C - R1008 - Home Base (58.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00C - R1009 - Practical Activities - 1hb (18.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2041/B00C/R0010/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R1010 - Distribution Board (0.74 m2)</b>					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1011 - Practical Activities - 1hb (18.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1012 - Home Base (59.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1013 - Home Base (58.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1014 - Practical Activities - 1hb (19.36 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R0010/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R9001 - Movement (37.58 m2)</b>						
No Asbestos						
<b>B00C - R9002 - Distribution Board (6.47 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00C - R9003 - Toilets - Boys (26.66 m2)</b>						
Partition Walls (Cubicles)	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R9003/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R9003/Partition Walls (Cubicles)/S4					<b>Clerical Error - No Sample Taken</b>
<b>B00C - R9004 - Special Programs Room (60.64 m2)</b>						
No Asbestos						
<b>B00C - R9005 - Toilets - Girls (29.3 m2)</b>						
Partition Walls (Cubicles)	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R9003/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00C/R9003/Partition Walls (Cubicles)/S4					<b>Clerical Error - No Sample Taken</b>
<b>B00C - R9006 - Drinking Facilities (8.05 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning/Pupil Facilities - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	West and East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00D/Eaves Linings/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - M0001 - Craft Store (6.5 m2)**

No Asbestos

**B00D - M0002 - General Storeroom (1.28 m2)**

No Asbestos

**B00D - M0003 - Movement (6.34 m2)**

No Asbestos

**B00D - M0004 - Movement (6.33 m2)**

No Asbestos

**B00D - M0005 - Craft Store (8.22 m2)**

No Asbestos

**B00D - R0001 - Movement (143.38 m2)**

No Asbestos

**B00D - R0002 - Music Store (12.49 m2)**

No Asbestos

**B00D - R0003 - Home Base (54.38 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0004 - Home Base Store (6.37 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0005 - Movement (13.76 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0006 - Home Base Store (6.37 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0007 - Home Base (54.46 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0008 - Practical Activities - 1hb (16.2 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0009 - General Storeroom (4.24 m2)**

Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0010 - Home Base Store (3.97 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0011 - Home Base (51.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0012 - General Storeroom (18.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0013 - Movement (15.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0014 - Cleaning Distributed Store (7.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0015 - Distribution Board (2.61 m2)</b>						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0016 - General Storeroom (10.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0019 - General Storeroom (12.45 m2)</b>						
No Asbestos						
<b>B00D - R0020 - Toilets - Boys (43.49 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00D/R0020/Partition Walls (Cubicles)/S32					Chrysotile (white asbestos)
<b>B00D - R0021 - Toilets - Girls (28.25 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00D/R0020/Partition Walls (Cubicles)/S32					Chrysotile (white asbestos)
<b>B00D - R1001 - Movement (116.35 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	116m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00D/R1001/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R1002 - Craft Store (8.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00D/R1016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00D - R1003 - Practical Activities - 1hb (13.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00D/R1016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
<b>B00D - R1004 - Home Base (60.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2041/B00D/R0011/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00D - R1005 - Home Base (55.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2041/B00D/R0011/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00D - R1006 - Home Base Store (6.51 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00D/R1016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2041/B00D/R0011/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00D - R1007 - Movement (6.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2041/B00D/R0011/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00D/R1016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
<b>B00D - R1008 - Home Base (55.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2041/B00D/R0011/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00D - R1009 - Home Base Store (6.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00D/R1016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00D/R1009/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00D - R1010 - Movement (12.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2041/B00D/R0011/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00D/R1016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
<b>B00D - R1011 - Distribution Board (0.6 m2)</b>						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2041/B00D/R0011/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00D - R1012 - Home Base Store (6.49 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00D/R1016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00D/R1012/Ceiling Structures/Linings/S28				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00D - R1013 - Home Base (56.02 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1014 - Home Base (56.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1015 - Home Base Store (6.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00D/R1016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00D - R1016 - Movement (6.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00D/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00D/R1016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1981 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	10m2	West and East	Good Condition (1)	Low (1)	Low Priority (2-3)
2041/B00E/Eaves Linings/S12					Chrysotile (white asbestos)	

**Interior****B00E - R0001 - Staff Room Annexe (23.64 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R0002 - Movement (10.02 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R0003 - Home Base (94.41 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R0004 - Practical Activities - 1hb (14.18 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R0005 - Staff Room Annexe (13.82 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R0006 - Staff Room Annexe (13.68 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R0007 - Withdrawal Space - 1hb (15.01 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R0008 - General Storeroom (73.21 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R0009 - Distribution Board (0.86 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R1001 - Home Base (52.15 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R1002 - Practical Activities - 1hb (41.85 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00E - R1003 - Home Base Store (4.67 m2)**

Ceiling Structures/Linings	Vermiculite	2041/B00E/R0003/Ceiling Structures/Linings/S7		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R1004 - Home Base (52.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1005 - Movement (17.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1006 - Home Base Store (4.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1007 - Staff Toilet (4.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1008 - Staff Toilet (4.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1009 - Distribution Board (1.09 m2)</b>						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1010 - Cleaning Distributed Store (2.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1011 - Practical Activities - 1hb (27.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2041/B00D/R1016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00E - R1012 - Home Base (58.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00E/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1013 - Movement (9.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2041/B00C/R0010/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017