


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Georges River College Oatley Senior Campus (8284)  
**Region :** Sydney  
**State Electorate :** Oatley  
**Local Government Area :** Kogarah

**Initial Survey :** Noel Arnold & Associates : 12 - Mar - 2008  
**Reviewed By :** Grencap-NAA : 13 - Aug - 2014

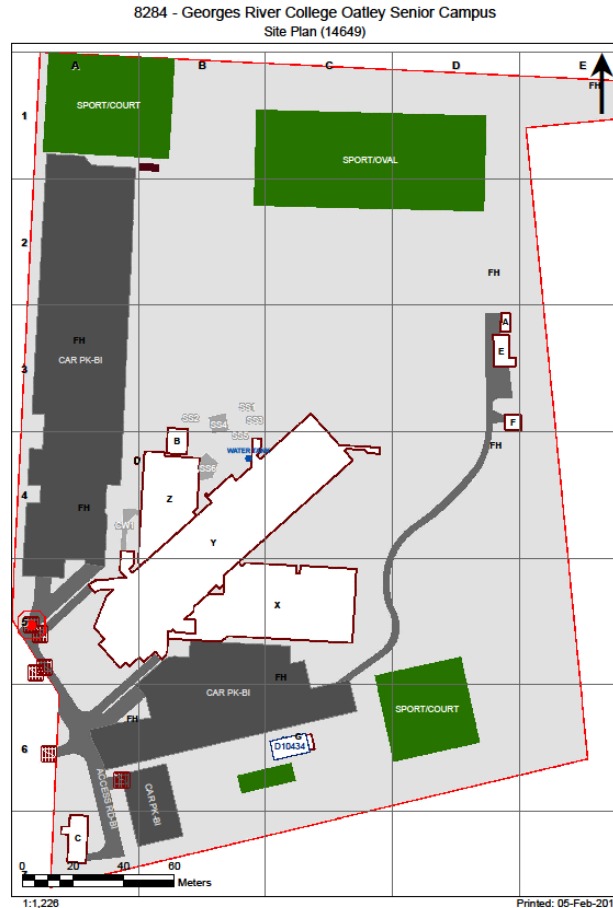

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - Building Services - 2000 - Steel (Steel)**

**Exterior**

|                                   |                   |
|-----------------------------------|-------------------|
| Underfloor Voids - Slab on Ground | No Asbestos Found |
| Ceiling Voids                     | No Asbestos Found |

**Interior**

**B00A - R0001 - Plant**

No Asbestos

**B00A - R0002 - Staff - Toilet**

|  |                  |     |              |                    |                                    |                    |
|--|------------------|-----|--------------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal                    | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
| 8284/B00A/R0002/Wall Linings Internal/S4 |                  |     |              |                    | <b>Chrysotile (white asbestos)</b> |                    |

**B00A - R0003 - Staff - Toilet**

|  |                  |     |              |                    |                                    |                    |
|--|------------------|-----|--------------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal                    | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
| 8284/B00A/R0002/Wall Linings Internal/S4 |                  |     |              |                    | <b>Chrysotile (white asbestos)</b> |                    |

**B00A - R0004 - Garden Store Room**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - Art - 2000 - Brick/Block (Brick/Block)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00B - R0001 - Kiln Space**

No Asbestos

**B00B - R0002 - Tafe Utilised**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00C - Other-Community Use - 2001 - Brick/Veneer (Brick/Veneer)****Exterior**

|                                   |                   |
|-----------------------------------|-------------------|
| Ceiling Voids                     | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

**Interior****B00C - R0001 - Other-Vacant**

No Asbestos

**B00C - R0002 - Other-Vacant**

No Asbestos

**B00C - R0003 - Other-Vacant**

No Asbestos

**B00C - R0004 - Other-Vacant**

|   |                  |      |              |   |         |                    |
|---|------------------|------|--------------|---|---------|--------------------|
| Ceiling Structures/Linings                    | Flat AC Sheeting | 24m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 8284/B00C/R0004/Ceiling Structures/Linings/S2 |                  |      |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00C - R0005 - General Storeroom**

|   |                  |     |              |   |         |                    |
|---|------------------|-----|--------------|---|---------|--------------------|
| Ceiling Structures/Linings                    | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 8284/B00C/R0004/Ceiling Structures/Linings/S2 |                  |     |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00C - R0006 - General Storeroom**

|   |                  |     |            |   |         |                    |
|---|------------------|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings                    | Flat AC Sheeting | 3m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 8284/B00C/R0004/Ceiling Structures/Linings/S2 |                  |     |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00C - R0007 - Laundry**

|  |             |  |  |  |                             |  |
|--|-------------|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile                    | Vinyl Tiles |  |  |  |                             |  |
| 8284/B00C/R0007/Floor Coverings Res/Textile/S3 |             |  |  |  | <b>No Asbestos Detected</b> |  |

**B00C - R0008 - Staff - Toilet**

No Asbestos

**B00C - R0009 - Movement**

No Asbestos

**B00C - R0010 - Other-Vacant**

No Asbestos

**B00C - R0011 - Staff Kitchen**

|  |             |  |  |  |                             |  |
|--|-------------|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile                    | Vinyl Tiles |  |  |  |                             |  |
| 8284/B00C/R0007/Floor Coverings Res/Textile/S3 |             |  |  |  | <b>No Asbestos Detected</b> |  |

**B00C - R0012 - External Movement**

|   |                  |      |            |   |         |                    |
|---|------------------|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings                    | Flat AC Sheeting | 10m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 8284/B00C/R0004/Ceiling Structures/Linings/S2 |                  |      |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00C - R0013 - External Movement**

No Asbestos

**B00C - Room+1 - awning**

|   |                  |      |              |   |         |                    |
|---|------------------|------|--------------|---|---------|--------------------|
| Ceiling Structures/Linings                    | Flat AC Sheeting | 10m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 8284/B00C/R0004/Ceiling Structures/Linings/S2 |                  |      |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - Building Services - 2001 - Brick/Block (Brick/Block)**

**Exterior**

|                                   |                   |
|-----------------------------------|-------------------|
| Ceiling Voids                     | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

**Interior**

**B00D - R0001 - Plant**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00E - Building Services - 2002 - Steel (Steel)**

**Exterior**

|                                   |                   |
|-----------------------------------|-------------------|
| Ceiling Voids                     | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

**Interior**

**B00E - R0001 - General Storeroom**

No Asbestos

**B00E - R0002 - General Storeroom**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00F - Building Services - 2002 - Metal Shed (Metal Shed)**

**Exterior**

|                                   |                   |
|-----------------------------------|-------------------|
| Ceiling Voids                     | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

**Interior**

**B00F - R0001 - General Storeroom**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00G - Building Services - 2002 - Steel (Steel)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00G - R0001 - General Storeroom**

No Asbestos

**B00G - R0002 - General Storeroom**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00X - General Learning/Multi Purpose Facilities - 1978 - Brick/Block (Brick/Block)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00X - M9001 - Stairs**

No Asbestos

**B00X - M9002 - Movement**

No Asbestos

**B00X - M9004 - Performing Arts Changeroom**

No Asbestos

**B00X - R0001 - Movement**

No Asbestos

**B00X - R0005 - General Learning Space**

No Asbestos

**B00X - R0006 - General Learning Space**

No Asbestos

**B00X - R0007 - Materials Workshop - Type 3**

No Asbestos

**B00X - R0008 - Resource/Project Store**

No Asbestos

**B00X - R0009 - External Movement**

No Asbestos

**B00X - R0010 - Movement**

No Asbestos

**B00X - R0011 - Wood Technology Bay**

No Asbestos

**B00X - R0012 - Plant**

No Asbestos

**B00X - R0013 - Distribution Board Cupboard**

Note: No inspection of live electrical installation.

No Asbestos

**B00X - R0014 - Communications Cupboard**

No Asbestos

**B00X - R0015 - Toilets - Boys**

No Asbestos

**B00X - R0016 - Toilets - Girls**

No Asbestos

**B00X - R0017 - Laundry**

No Asbestos

**B00X - R0018 - Fitness Laboratory**

No Asbestos

**B00X - R0019 - Wood Technology Bay**

No Asbestos

**B00X - R0020 - General Storeroom**

No Asbestos

**B00X - R0021 - Plant**

No Asbestos

**B00X - R0022 - Movement**

No Asbestos

**B00X - R0023 - No Access**

| Product | Material Description                               | Extent | Location Reference | Material Condition | Risk Status  | Control Priority |
|---------|--|--------|--------------------|--------------------|--|------------------|
|         | Sample No  |        |                    |                    |  | Test Result      |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0024 - Stairs</b>                       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0025 - Shower/Change</b>                |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0026 - Plant</b>                        |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0027 - General Learning Space</b>       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0028 - Shower/Change</b>                |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0029 - Stairs</b>                       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0030 - Toilets - Boys</b>               |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0031 - Plant</b>                        |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0032 - Distribution Board Cupboard</b>  |        |                    |                    | Note: No inspection of live electrical installation. |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0033 - Toilets - Girls</b>              |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0034 - Movement</b>                     |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0035 - Dust Extraction Space</b>        |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0036 - General Learning Space</b>       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R0037 - General Learning Space</b>       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1001 - Movement</b>                     |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1002 - General Learning Space</b>       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1003 - Senior Study</b>                 |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1004 - General Storeroom</b>            |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1005 - External Movement</b>            |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1006 - General Learning Space</b>       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1007 - General Learning Space</b>       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1008 - General Learning Space</b>       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1009 - Stairs</b>                       |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1010 - Shared Learning Space</b>        |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |
|         | <b>B00X - R1011 - Cleaning Store - Distributed</b> |        |                    |                    |  |                  |
|         | No Asbestos  |        |                    |                    |  |                  |

| Product   | Material Description | Extent | Location Reference | Material Condition                                   | Risk Status | Control Priority |
|---|----------------------|--------|--------------------|--|-------------|------------------|
| Sample No   |                      |        |                    |  | Test Result |                  |
| <b>B00X - R1012 - Staff - Toilet</b>              |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R1013 - Plant</b>                       |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R1014 - Distribution Board Cupboard</b> |                      |        |                    | Note: No inspection of live electrical installation. |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R1015 - Staff - Toilet</b>              |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R1016 - Movement</b>                    |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R1017 - External Movement</b>           |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9001 - Plant</b>                       |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9002 - Plant</b>                       |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9003 - Music Learning Space</b>        |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9004 - General Learning Space</b>      |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9005 - General Learning Space</b>      |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9006 - Performance Workshop</b>        |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9007 - Stairs</b>                      |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9008 - Multi-Purpose Space</b>         |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9009 - Practice/Seminar</b>            |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9010 - Music Store</b>                 |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9011 - Sport Equipment Store</b>       |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9012 - Sport Equipment Store</b>       |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9013 - Sport Equipment Store</b>       |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9014 - Chair Store</b>                 |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9015 - Movement</b>                    |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9016 - Movement</b>                    |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9017 - General Learning Space</b>      |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9018 - Movement</b>                    |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9019 - Movement</b>                    |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00X - R9021 - Stairs</b>                      |                      |        |                    |  |             |                  |

| Product  | Material Description | Extent | Location Reference | Material Condition                                   | Risk Status                 | Control Priority   |
|--|----------------------|--------|--------------------|--|-----------------------------|--------------------|
| Sample No  |                      |        |                    |  | Test Result                 |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9022 - External Movement</b>            |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9023 - Toilets - Girls</b>              |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9025 - Plant</b>                        |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9026 - Distribution Board Cupboard</b>  |                      |        |                    | Note: No inspection of live electrical installation. |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9027 - Toilets - Boys</b>               |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9028 - Movement</b>                     |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9029 - Stairs</b>                       |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9030 - External Movement</b>            |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9031 - External Movement</b>            |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9032 - External Movement</b>            |                      |        |                    |  |                             |                    |
| Ceiling Structures/Linings                         | Flat AC Sheeting     | 58m2   | Throughout         | Minimal Damage (2)                                   | Low (1)                     | Low Priority (2-3) |
| 8284/B00X/R9032/Ceiling Structures/Linings/S7      |                      |        |                    |  | Chrysotile (white asbestos) |                    |
| <b>B00X - R9033 - External Movement</b>            |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9034 - External Movement</b>            |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9035 - Other-Vacant</b>                 |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9036 - Cleaning Store - Distributed</b> |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9038 - Fitness Laboratory</b>           |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9039 - Movement</b>                     |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9040 - Movement</b>                     |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9041 - Control Room</b>                 |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9042 - Performance Workshop</b>         |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9043 - Stage</b>                        |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9044 - Performing Arts Store</b>        |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9045 - Distribution Board Cupboard</b>  |                      |        |                    | Note: No inspection of live electrical installation. |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9046 - Movement</b>                     |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |
| <b>B00X - R9047 - Performing Arts Changeroom</b>   |                      |        |                    |  |                             |                    |
| No Asbestos  |                      |        |                    |  |                             |                    |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

| B00X - Room+1 - Movement                       |                  |       |                  |                    |                             |                    |
|--|------------------|-------|------------------|--------------------|-----------------------------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 100m2 | Outside X R 9008 | Good Condition (1) | Low (1)                     | Low Priority (2-3) |
| 8284/B00X/Room+1/Ceiling Structures/Linings/S5 |                  |       |                  |                    | Chrysotile (white asbestos) |                    |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
|         | Sample No            |        |                    |                    |             | Test Result      |

**B00Y - General Learning/Staff Facilities - 1978 - Brick/Block (Brick/Block)****Exterior**

|                                   |                   |
|-----------------------------------|-------------------|
| Ceiling Voids                     | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

**Interior****B00Y - M9001 - Stairs**

No Asbestos

**B00Y - M9002 - General Storeroom**

No Asbestos

**B00Y - R0001 - Performance Workshop**

No Asbestos

**B00Y - R0003 - Other-Commercial**

No Asbestos

**B00Y - R0004 - Movement**

No Asbestos

**B00Y - R0005 - Plant**

No Asbestos

**B00Y - R0006 - Movement**

No Asbestos

**B00Y - R0007 - General Storeroom**

No Asbestos

**B00Y - R0008 - General Learning Space**

No Asbestos

**B00Y - R0009 - General Learning Space**

No Asbestos

**B00Y - R0010 - Lift**

No Asbestos

**B00Y - R0011 - General Learning Space**

No Asbestos

**B00Y - R0012 - Control Room**

No Asbestos

**B00Y - R0013 - General Learning Space**

No Asbestos

**B00Y - R0014 - Movement**

No Asbestos

**B00Y - R0015 - General Learning Space**

No Asbestos

**B00Y - R0016 - General Learning Space**

No Asbestos

**B00Y - R0017 - General Learning Space**

No Asbestos

**B00Y - R0019 - Other-Commercial**

No Asbestos

**B00Y - R0020 - Other-Commercial**

No Asbestos

**B00Y - R0021 - Other-Commercial**

No Asbestos

**B00Y - R0022 - Other-Commercial**

No Asbestos

| Product   | Material Description | Extent | Location Reference | Material Condition                                   | Risk Status | Control Priority |
|---|----------------------|--------|--------------------|--|-------------|------------------|
| Sample No   |                      |        |                    |  | Test Result |                  |
| <b>B00Y - R0023 - Other-Commercial</b>            |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0024 - Movement</b>                    |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0025 - Multi-Purpose Space</b>         |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0026 - Movement</b>                    |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0027 - Stairs</b>                      |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0028 - Stairs</b>                      |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0029 - External Movement</b>           |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0030 - External Stairs</b>             |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0031 - Lift</b>                        |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0032 - General Storeroom</b>           |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0033 - General Storeroom</b>           |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0034 - Toilets-Disabled</b>            |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0035 - Toilets - Girls</b>             |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0036 - Toilets - Boys</b>              |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0037 - Distribution Board Cupboard</b> |                      |        |                    | Note: No inspection of live electrical installation. |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0038 - Plant</b>                       |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0039 - Stairs</b>                      |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0040 - Distribution Board Cupboard</b> |                      |        |                    | Note: No inspection of live electrical installation. |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0041 - Tafe Utilised</b>               |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0042 - Tafe Utilised</b>               |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0043 - Tafe Utilised</b>               |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0044 - Tafe Utilised</b>               |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0045 - Tafe Utilised</b>               |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0046 - Tafe Utilised</b>               |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0047 - Tafe Utilised</b>               |                      |        |                    |  |             |                  |
| No Asbestos                                       |                      |        |                    |  |             |                  |
| <b>B00Y - R0048 - Tafe Utilised</b>               |                      |        |                    |  |             |                  |

| Product   | Material Description                              | Extent | Location Reference | Material Condition | Risk Status | Control Priority                                     |
|-----------|---|--------|--------------------|--------------------|-------------|--|
| Sample No |   |        |                    |                    | Test Result |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0049 - Tafe Utilised</b>               |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0050 - Tafe Utilised</b>               |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0051 - Tafe Utilised</b>               |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0053 - External Movement</b>           |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0054 - Stairs</b>                      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0055 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0056 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0057 - External Movement</b>           |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0058 - Stairs</b>                      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0060 - Plant</b>                       |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0061 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0062 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0063 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0064 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0065 - External Movement</b>           |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0066 - External Movement</b>           |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0067 - External Stairs</b>             |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0068 - External Stairs</b>             |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0069 - External Movement</b>           |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0070 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0071 - Stairs</b>                      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0072 - Distribution Board Cupboard</b> |        |                    |                    |             | Note: No inspection of live electrical installation. |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0073 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0074 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R0075 - Shower/Change</b>               |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status  | Control Priority |
|---|----------------------|--------|--------------------|--------------------|--|------------------|
| Sample No   |                      |        |                    |                    | Test Result  |                  |
| <b>B00Y - R0076 - Shower/Change</b>               |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0077 - Movement</b>                    |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0078 - Performing Arts Store</b>       |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0079 - Staff Study</b>                 |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0080 - Staff Study</b>                 |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0081 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0082 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0083 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0084 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0085 - No Access</b>                   |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0086 - Communications Cupboard</b>     |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0087 - Plant</b>                       |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0088 - General Learning Space</b>      |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0089 - General Learning Space</b>      |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0090 - Computer Learning Space</b>     |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R0091 - Movement</b>                    |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1001 - Plant</b>                       |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1002 - Plant</b>                       |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1003 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1004 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1005 - Chemical Store</b>              |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1006 - Distribution Board Cupboard</b> |                      |        |                    |                    | Note: No inspection of live electrical installation. |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1007 - Senior Study</b>                |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1008 - External Stairs</b>             |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1009 - Preparation</b>                 |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R1010 - Chemical Store</b>              |                      |        |                    |                    |  |                  |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority                                |
|---------|----------------------|--------|--------------------|--------------------|-------------|---|
|         | Sample No            |        |                    |                    |             | Test Result                                     |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1011 - Growing/Breeding</b>          |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1012 - Science Laboratory</b>        |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1013 - Science Laboratory</b>        |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1014 - General Learning Space</b>    |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1015 - General Learning Space</b>    |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1016 - General Learning Space</b>    |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1017 - General Learning Space</b>    |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1018 - External Stairs</b>           |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1019 - Plant</b>                     |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1020 - Plant</b>                     |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1021 - Duplicating Workroom</b>      |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1022 - Interview/Office - Type 1</b> |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1023 - Interview/Office - Type 1</b> |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1024 - Interview/Office - Type 1</b> |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1025 - Interview/Office - Type 1</b> |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1026 - Staff Study</b>               |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1027 - Commonroom</b>                |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1028 - Plant</b>                     |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1029 - Movement</b>                  |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1030 - Stairs</b>                    |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1031 - Plant</b>                     |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1032 - Movement</b>                  |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1033 - Movement</b>                  |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1034 - Staff Kitchen</b>             |
|         |                      |        |                    |                    |             | No Asbestos                                     |
|         |                      |        |                    |                    |             | <b>B00Y - R1035 - External Movement</b>         |
|         |                      |        |                    |                    |             | No Asbestos                                     |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No                                       |                      |        |                    |                    | Test Result |                  |
| <b>B00Y - R1036 - Movement</b>                  |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1037 - Lift</b>                      |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1038 - Interview/Office - Type 1</b> |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1039 - Stairs</b>                    |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1040 - Stairs</b>                    |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1041 - Movement</b>                  |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1042 - Movement</b>                  |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1043 - External Movement</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1044 - Stairs</b>                    |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1045 - External Stairs</b>           |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1046 - External Movement</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1047 - External Movement</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1048 - External Movement</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1049 - Stairs</b>                    |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1050 - External Stairs</b>           |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1051 - Art Entry/Display</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1052 - Stairs</b>                    |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1053 - Movement</b>                  |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1054 - Toilets-Disabled</b>          |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1055 - Toilets - Girls</b>           |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1056 - Toilets - Boys</b>            |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1057 - Staff Kitchen</b>             |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1058 - Staff Kitchen</b>             |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1059 - External Movement</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R1062 - General Storeroom</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                     |                      |        |                    |                    |             |                  |
| <b>B00Y - R2001 - Senior Study</b>              |                      |        |                    |                    |             |                  |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status  | Control Priority |
|---|----------------------|--------|--------------------|--------------------|--|------------------|
| Sample No   |                      |        |                    |                    | Test Result  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2002 - General Learning Space</b>      |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2003 - General Learning Space</b>      |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2004 - General Learning Space</b>      |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2005 - General Learning Space</b>      |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2006 - External Stairs</b>             |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2007 - General Learning Space</b>      |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2008 - General Storeroom</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2009 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2010 - Toilets-Disabled</b>            |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2011 - Toilets - Boys</b>              |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2012 - Toilets - Girls</b>             |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2013 - Distribution Board Cupboard</b> |                      |        |                    |                    | Note: No inspection of live electrical installation. |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2014 - Plant</b>                       |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2015 - Lift</b>                        |                      |        |                    |                    |  |                  |
| Floor Coverings Res/Textile                       | Vinyl Tiles          |        |                    |                    |  |                  |
| 8284/B00Y/R2015/Floor Coverings Res/Textile/S1    |                      |        |                    |                    | <b>No Asbestos Detected</b>                          |                  |
| <b>B00Y - R2016 - Movement</b>                    |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2017 - Stairs</b>                      |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2018 - Plant</b>                       |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2019 - Movement</b>                    |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2020 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2021 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2022 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2023 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2024 - External Stairs</b>             |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |
| <b>B00Y - R2025 - External Movement</b>           |                      |        |                    |                    |  |                  |
| No Asbestos                                       |                      |        |                    |                    |  |                  |

| Product                                      | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No                                    |                      |        |                    |                    | Test Result |                  |
| <b>B00Y - R2026 - External Stairs</b>        |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R2027 - Plant</b>                  |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8002 - Stairs</b>                 |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8003 - Movement</b>               |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8004 - External Movement</b>      |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8005 - External Stairs</b>        |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8006 - External Movement</b>      |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8007 - External Movement</b>      |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8008 - Shared Learning Space</b>  |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8009 - Darkroom Space</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8010 - Senior Seminar</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8011 - Senior Seminar</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8012 - General Learning Space</b> |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8013 - General Storeroom</b>      |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8014 - General Learning Space</b> |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8015 - Multi Media Workshop</b>   |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8016 - Seminar</b>                |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8017 - Toilets-Disabled</b>       |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8018 - Movement</b>               |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8019 - Toilets - Girls</b>        |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8020 - Toilets - Boys</b>         |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8021 - General Assistants</b>     |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8022 - Plant</b>                  |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8023 - Movement</b>               |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8024 - General Storeroom</b>      |                      |        |                    |                    |             |                  |
| No Asbestos                                  |                      |        |                    |                    |             |                  |
| <b>B00Y - R8025 - Movement</b>               |                      |        |                    |                    |             |                  |

| Product   | Material Description                              | Extent | Location Reference | Material Condition | Risk Status | Control Priority                                     |
|-----------|---|--------|--------------------|--------------------|-------------|--|
| Sample No |   |        |                    |                    | Test Result |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8026 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8027 - Senior Seminar</b>              |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8028 - General Learning Space</b>      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8029 - General Learning Space</b>      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8030 - Plant</b>                       |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8031 - Stairs</b>                      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8032 - General Learning Space</b>      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8033 - General Learning Space</b>      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8034 - General Learning Space</b>      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8035 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8036 - Lift</b>                        |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8039 - No Access</b>                   |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8040 - Distribution Board Cupboard</b> |        |                    |                    |             | Note: No inspection of live electrical installation. |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8041 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8042 - Plant</b>                       |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8043 - Darkroom Space</b>              |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8044 - Resources Space</b>             |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8045 - Maintenance Bulk Store</b>      |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8046 - Plant</b>                       |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8047 - Lift</b>                        |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8048 - General Storeroom</b>           |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8049 - Plant</b>                       |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R8050 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R9001 - Movement</b>                    |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |
|           | <b>B00Y - R9002 - Plant</b>                       |        |                    |                    |             |  |
|           | No Asbestos                                       |        |                    |                    |             |  |

| Product  | Material Description | Extent | Location Reference | Material Condition                                   | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--|-------------|------------------|
| Sample No  |                      |        |                    |  | Test Result |                  |
| <b>B00Y - R9004 - Plant</b>                        |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9006 - General Learning Space</b>       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9007 - General Learning Space</b>       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9008 - General Learning Space</b>       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9009 - Distribution Board Cupboard</b>  |                      |        |                    | Note: No inspection of live electrical installation. |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9010 - Cleaning Store - Distributed</b> |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9011 - Lift</b>                         |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9012 - External Movement</b>            |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9014 - Computer Learning Space</b>      |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9015 - General Storeroom</b>            |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9016 - Maintenance Bulk Store</b>       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9017 - Senior Study</b>                 |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9018 - Toilets-Disabled</b>             |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9019 - General Learning Space</b>       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9020 - General Storeroom</b>            |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9021 - Computer Learning Space</b>      |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9022 - Movement</b>                     |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9023 - General Storeroom</b>            |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9024 - Toilets - Girls</b>              |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9025 - Toilets - Boys</b>               |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9026 - Distribution Board Cupboard</b>  |                      |        |                    | Note: No inspection of live electrical installation. |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9027 - Plant</b>                        |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9028 - Stairs</b>                       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9029 - Movement</b>                     |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9030 - Stairs</b>                       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Y - R9031 - Main Area</b>                    |                      |        |                    |  |             |                  |

| Product | Material Description                          | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|---------|---|--------|--------------------|--------------------|-------------|--------------------|
|         | <b>Sample No</b>                              |        |                    |                    |             | <b>Test Result</b> |
|         |   |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9032 - Movement</b>                |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9033 - Staff Study</b>             |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9034 - Staff Study</b>             |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9035 - Librarian</b>               |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9036 - Seminar</b>                 |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9037 - Seminar</b>                 |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9038 - Seminar</b>                 |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9039 - No Access</b>               |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9040 - Computer Learning Space</b> |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9041 - Stairs</b>                  |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9042 - Multi-Purpose Space</b>     |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9043 - Maintenance Bulk Store</b>  |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9044 - External Movement</b>       |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9045 - Movement</b>                |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9046 - Ramp</b>                    |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9047 - External Movement</b>       |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9048 - External Stairs</b>         |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9049 - External Stairs</b>         |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9050 - External Stairs</b>         |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9052 - Movement</b>                |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9053 - Maintenance Bulk Store</b>  |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9054 - General Storeroom</b>       |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9055 - Stairs</b>                  |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9056 - No Access</b>               |        |                    |                    |             | No Asbestos        |
|         | <b>B00Y - R9057 - General Learning Space</b>  |        |                    |                    |             | No Asbestos        |



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

B00Y - R9058 - Commonroom

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00Z - Administration/General Learning - 1978 - Brick/Block (Brick/Block)**

**Exterior**

|                     |                     |     |             |                    |         |                    |
|---------------------|---------------------|-----|-------------|--------------------|---------|--------------------|
| service Panel Cover | Compressed AC Sheet | 5m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
|---------------------|---------------------|-----|-------------|--------------------|---------|--------------------|

**Assumed Asbestos - Item not found 22/04/2014**

|                                   |                   |
|-----------------------------------|-------------------|
| Underfloor Voids - Slab on Ground | No Asbestos Found |
|-----------------------------------|-------------------|

|               |                   |
|---------------|-------------------|
| Ceiling Voids | No Asbestos Found |
|---------------|-------------------|

**Interior**

**B00Z - R0001 - Movement**

No Asbestos

**B00Z - R0002 - Leading Teacher**

No Asbestos

**B00Z - R0003 - Plant**

No Asbestos

**B00Z - R0004 - Clinic - Boys**

No Asbestos

**B00Z - R0005 - Toilets - Boys**

No Asbestos

**B00Z - R0006 - Toilets - Girls**

No Asbestos

**B00Z - R0007 - Clinic - Girls**

No Asbestos

**B00Z - R0008 - Leading Teacher**

No Asbestos

**B00Z - R0009 - Deputy Principal Office**

No Asbestos

**B00Z - R0010 - Interview/Office - Type 1**

No Asbestos

**B00Z - R0011 - External Movement**

No Asbestos

**B00Z - R0012 - Stairs**

No Asbestos

**B00Z - R0013 - Administration - Clerical**

No Asbestos

**B00Z - R0014 - Leading Teacher**

No Asbestos

**B00Z - R0015 - Stairs**

No Asbestos

**B00Z - R0016 - General Storeroom**

No Asbestos

**B00Z - R0017 - Interview/Meeting**

No Asbestos

**B00Z - R0018 - Interview/Meeting**

No Asbestos

**B00Z - R0019 - Principal Office**

No Asbestos

**B00Z - R0020 - Public Entry**

No Asbestos

**B00Z - R0021 - General Storeroom**

No Asbestos

| Product  | Material Description | Extent | Location Reference | Material Condition                                   | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--|-------------|------------------|
| Sample No  |                      |        |                    |  | Test Result |                  |
| <b>B00Z - R0022 - General Storeroom</b>            |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0023 - Cleaning Store - Distributed</b> |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0024 - Staff - Toilet</b>               |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0025 - Plant</b>                        |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0026 - Distribution Board Cupboard</b>  |                      |        |                    | Note: No inspection of live electrical installation. |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0027 - Movement</b>                     |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0028 - Staff Kitchen</b>                |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0029 - External Stairs</b>              |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0031 - Cleaning Store - Distributed</b> |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R0033 - External Stairs</b>              |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1001 - Movement</b>                     |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1002 - Toilets-Disabled</b>             |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1003 - Pantry</b>                       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1004 - Laundry</b>                      |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1005 - Senior Study</b>                 |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1006 - Kitchen - Type 1</b>             |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1007 - Pantry</b>                       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1008 - General Learning Space</b>       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1009 - General Learning Space</b>       |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1010 - Food/Research Space</b>          |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1011 - General Storeroom</b>            |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1012 - Staff - Toilet</b>               |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1013 - Plant</b>                        |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1014 - Distribution Board Cupboard</b>  |                      |        |                    | Note: No inspection of live electrical installation. |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1015 - Staff - Toilet</b>               |                      |        |                    |  |             |                  |
| No Asbestos  |                      |        |                    |  |             |                  |
| <b>B00Z - R1016 - Movement</b>                     |                      |        |                    |  |             |                  |

| Product  | Material Description | Extent | Location Reference | Material Condition  | Risk Status  | Control Priority   |
|--|----------------------|--------|--------------------|---|--|--------------------|
| Sample No  |                      |        |                    |   | Test Result  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R1017 - External Movement</b>            |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R1018 - Cleaning Store - Distributed</b> |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R1019 - Stairs</b>                       |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R1020 - External Movement</b>            |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R1021 - External Stairs</b>              |                      |        |                    |   |  |                    |
| Balustrate In-fill Panels                          | Compressed AC Sheet  | 10m2   | North facing       | Good Condition (1)  | Low (1)  | Low Priority (2-3) |
| 8284/B00Z/R1021/Balustrate In-fill Panels/S6       |                      |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |  |                    |
| <b>B00Z - R9002 - Resources Store</b>              |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9003 - Art Learning Space</b>           |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9004 - Visual Arts Workshop</b>         |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9005 - Art Learning Space</b>           |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9006 - Art Learning Space</b>           |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9007 - Movement</b>                     |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9008 - Communications Cupboard</b>      |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9009 - Cleaning Store - Distributed</b> |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9010 - Plant</b>                        |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9011 - Distribution Board Cupboard</b>  |                      |        |                    |   | Note: No inspection of live electrical installation. |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9012 - Toilets - Girls</b>              |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9013 - Other-Vacant</b>                 |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9014 - Plant</b>                        |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9015 - External Stairs</b>              |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9016 - External Movement</b>            |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9017 - Cleaning Store - Distributed</b> |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9018 - Plant</b>                        |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9019 - External Movement</b>            |                      |        |                    |   |  |                    |
| No Asbestos  |                      |        |                    |   |  |                    |
| <b>B00Z - R9020 - External Movement</b>            |                      |        |                    |   |  |                    |

| Product                              | Material Description                | Extent | Location Reference | Material Condition | Risk Status | Control Priority            |
|--------------------------------------|-------------------------------------|--------|--------------------|--------------------|-------------|-----------------------------|
| Sample No                            |                                     |        |                    |                    | Test Result |                             |
| No Asbestos                          |                                     |        |                    |                    |             |                             |
| <b>B00Z - R9021 - Stairs</b>         |                                     |        |                    |                    |             |                             |
| No Asbestos                          |                                     |        |                    |                    |             |                             |
| <b>B00Z - R9022 - Toilets - Boys</b> |                                     |        |                    |                    |             |                             |
| No Asbestos                          |                                     |        |                    |                    |             |                             |
| <b>B00Z - R9023 - Other-Vacant</b>   |                                     |        |                    |                    |             |                             |
| No Asbestos                          |                                     |        |                    |                    |             |                             |
| <b>B00Z - R9024 - Movement</b>       |                                     |        |                    |                    |             |                             |
| No Asbestos                          |                                     |        |                    |                    |             |                             |
| <b>B00Z - R9025 - Plant</b>          |                                     |        |                    |                    |             |                             |
| Hot water boiler                     | Rope gasket                         |        |                    |                    |             |                             |
|                                      | 8284/B00Z/R9025/Hot water boiler/S8 |        |                    |                    |             | <b>No Asbestos Detected</b> |
| <b>B00Z - R9026 - Movement</b>       |                                     |        |                    |                    |             |                             |
| No Asbestos                          |                                     |        |                    |                    |             |                             |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

### Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 760 - D10434 - Woodwork/Store : Placement Date - 7/04/2003

#### Exterior

|             |                     |                  |  |          |
|-------------|---------------------|------------------|--|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos |  | 1.08 m2  |
| Landing     | Compressed AC Sheet | Assumed Asbestos |  | 1.2 m2   |
| Eave Lining | Flat AC Sheet       | Assumed Asbestos |  | 17.28 m2 |

#### Interior

##### R1 - Woodwork

|                |               |                  |  |       |
|----------------|---------------|------------------|--|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos |  | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos |  | 91 m2 |

##### R2 - Store

|                |               |                  |  |       |
|----------------|---------------|------------------|--|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos |  | 18 m2 |
| Ceiling        | Flat AC Sheet | Assumed Asbestos |  | 18 m2 |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017