


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lake Albert Public School (2357)
Region : Riverina
State Electorate : Wagga Wagga
Local Government Area : Wagga Wagga

Initial Survey : Noel Arnold & Associates : 16 - Dec - 2009
Reviewed By : Grencap-NAA : 18 - Feb - 2015

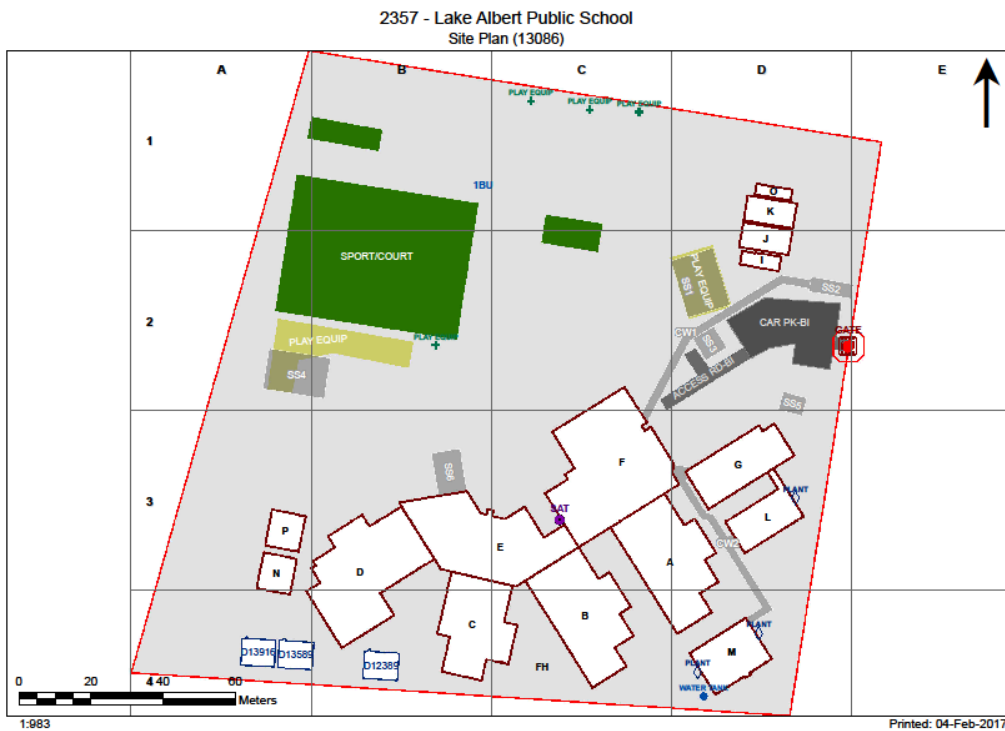

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - General Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|------------------|---|------|------------|--------------------|---------|------------------------------------|
| Awnings | Compressed AC Sheet | 50m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00F/Awnings/S13 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | Non Accessible Area - Height Restriction | | | | | |
| Underfloor Voids | Non Accessible Area - Area inaccessible | | | | | |

Interior**B00A - M0001 - Withdrawal Space - 1hb**

No Asbestos

B00A - R0001 - Movement

| | | | | | | |
|----------------------------|--|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 18m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |

B00A - R0002 - Withdrawal Space - 1hb

No Asbestos

B00A - R0003 - Cleaning Supplies

| | | | | | | |
|--------------------------------|--|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | No Asbestos Detected |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | | |

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

| | | | | | | |
|----------------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |

B00A - R0004 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

B00A - R0005 - Movement

No Asbestos

B00A - R0007 - Home Base

No Asbestos

B00A - R0008 - Home Base Store

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

B00A - R0009 - Home Base Store

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 25m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

B00A - R0010 - Staff Study

No Asbestos

B00A - R0011 - Movement

| | | | | | | |
|----------------------------|--|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |

B00A - R0012 - Home Base

No Asbestos

B00A - R0013 - Movement

| | | | | | | |
|----------------------------|--|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|

| Sample No | Test Result |
|-----------|-------------|
|-----------|-------------|

B00A - R0014 - Home Base

| | | | | | | |
|--|------------------|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 60m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | | Chrysotile (white asbestos) |

B00A - R0015 - Withdrawal Space - 1hb

No Asbestos

B00A - R0016 - Movement

| | | | | | | |
|--|------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | | Chrysotile (white asbestos) |

B00A - R0017 - Home Base

| | | | | | | |
|--|------------------|------|-------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 40m2 | North, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | | Chrysotile (white asbestos) |

B00A - R0018 - Home Base Store

No Asbestos

B00A - R0019 - Home Base Store

| | | | | | | |
|--|------------------|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 30m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | | Chrysotile (white asbestos) |

B00A - R0020 - Practical Activities

| | | | | | | |
|--|-------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00A/R0021/Floor Coverings Res/Textile/S9 | | | | | | No Asbestos Detected |

B00A - R0021 - Movement

| | | | | | | |
|--|-------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00A/R0021/Floor Coverings Res/Textile/S9 | | | | | | No Asbestos Detected |

B00A - R0022 - Movement

| | | | | | | |
|--|------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 19m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | | Chrysotile (white asbestos) |

B00A - R0023 - Kiln Space

| | | | | | | |
|--|-------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00A/R0021/Floor Coverings Res/Textile/S9 | | | | | | No Asbestos Detected |

B00A - R0025 - General Storeroom


| | | | | | | |
|--|------------------|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | | Chrysotile (white asbestos) |

B00A - R0026 - Disabled Toilet

No Asbestos

B00A - R0028 - Disabled Toilet

| | | | | | | |
|--|---------------------|-----|------------|--------------------|---------|------------------------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0028/Partition Walls (Cubicles)/S10 | | | | | | Chrysotile (white asbestos) |

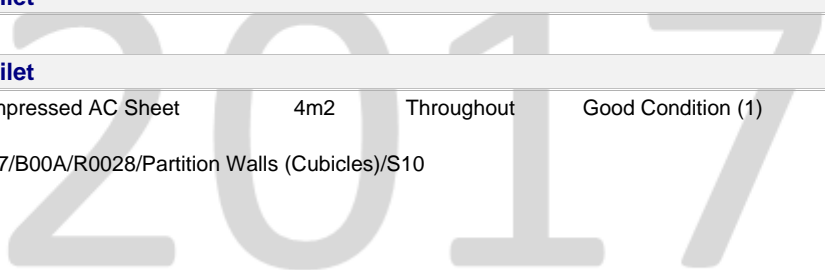

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00B - General Learning - 1980 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|------------------|---|------|------------|--------------------|---------|--|
| Awnings | Flat AC Sheeting 2357/B00F/Awnings/S13 | 80m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Ceiling Voids | Non Accessible Area - Height Restriction | | | | | |
| Underfloor Voids | Non Accessible Area - Area inaccessible | | | | | |

Interior

B00B - M0001 - Withdrawal Space - 1hb

No Asbestos

B00B - R0001 - Movement

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 18m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Assumed Asbestos - Assumed Asbestos |
|----------------------------|------------------|------|------------|--------------------|---------|--|

B00B - R0002 - Withdrawal Space - 1hb

No Asbestos

B00B - R0003 - Cleaning Supplies

| | | | | | | |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | | No Asbestos Detected |
|-----------------------------|---|--|--|--|--|-----------------------------|

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|--|
| Wall Linings Internal | Flat AC Sheeting | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | |

| | | | | | | |
|----------------------------|------------------|-----|------------|--------------------|---------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Assumed Asbestos - Assumed Asbestos |
|----------------------------|------------------|-----|------------|--------------------|---------|--|

B00B - R0004 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------|--|-----|------------|--------------------|---------|--|
| Wall Linings Internal | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | |

B00B - R0005 - Movement

No Asbestos

B00B - R0007 - Special Programs Room

No Asbestos

B00B - R0008 - Home Base Store

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|--|
| Wall Linings Internal | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | |

B00B - R0009 - Home Base Store

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|--|
| Wall Linings Internal | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | |

B00B - R0010 - Computer Resource

No Asbestos

B00B - R0011 - Movement

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Assumed Asbestos - Assumed Asbestos |
|----------------------------|------------------|------|------------|--------------------|---------|--|

B00B - R0012 - Home Base

No Asbestos

B00B - R0013 - Movement

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Assumed Asbestos - Assumed Asbestos |
|----------------------------|------------------|------|------------|--------------------|---------|--|

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|------------------------------------|--------------------|
| Sample No | | | | | Test Result | |
| B00B - R0014 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0015 - Withdrawal Space - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0016 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00B - R0017 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0018 - Home Base Store | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 30m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) | |
| B00B - R0019 - Home Base Store | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 30m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) | |
| B00B - R0020 - Practical Activities | | | | | | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00G/R0012/Floor Coverings Res/Textile/S6 | | | | | No Asbestos Detected | |
| B00B - R0021 - Movement | | | | | | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00G/R0012/Floor Coverings Res/Textile/S6 | | | | | No Asbestos Detected | |
| B00B - R0022 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 19m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00B - R0023 - Practical Activities | | | | | | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00A/R0021/Floor Coverings Res/Textile/S9 | | | | | No Asbestos Detected | |
| B00B - R0025 - Craft Store | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) | |
| B00B - R0026 - Toilets - Girls | | | | | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0028/Partition Walls (Cubicles)/S10 | | | | | Chrysotile (white asbestos) | |
| B00B - R0028 - Toilets - Boys | | | | | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0028/Partition Walls (Cubicles)/S10 | | | | | Chrysotile (white asbestos) | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - General Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|------------------|---|------|------------|--------------------|---------|------------------------------------|
| Awnings | Flat AC Sheeting | 60m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00F/Awnings/S13 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | Non Accessible Area - Height Restriction | | | | | |
| Underfloor Voids | Non Accessible Area - Area inaccessible | | | | | |

Interior**B00C - R0001 - Movement**

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 19m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Assumed Asbestos - Assumed Asbestos |

B00C - R0002 - General Storeroom

No Asbestos

B00C - R0003 - Cleaning Supplies

| | | | | | | |
|-----------------------------|--|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | | No Asbestos Detected |

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

| | | | | | | |
|----------------------------|------------------|-----|------------|--------------------|---------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Assumed Asbestos - Assumed Asbestos |

B00C - R0004 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

B00C - R0005 - Movement

No Asbestos

B00C - R0007 - Home Base

No Asbestos

B00C - R0008 - Home Base Store

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 45m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

B00C - R0009 - General Storeroom

No Asbestos

B00C - R0010 - Movement

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Assumed Asbestos - Assumed Asbestos |

B00C - R0011 - Home Base

No Asbestos

B00C - R0012 - Home Base Store

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 25m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

B00C - R0013 - Withdrawal Space - 1hb

No Asbestos

B00C - R0014 - Movement

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | | | | | | Assumed Asbestos - Assumed Asbestos |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|------------------------------------|--------------------|
| Sample No | | | | | Test Result | |
| B00C - R0015 - Home Base - M | | | | | | |
| No Asbestos | | | | | | |
| B00C - R0016 - Home Base Store - S | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 40m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) | |
| B00C - R0017 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00C - R0018 - Practical Activities | | | | | | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00A/R0021/Floor Coverings Res/Textile/S9 | | | | | No Asbestos Detected | |
| B00C - R0019 - Toilets - Girls | | | | | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0028/Partition Walls (Cubicles)/S10 | | | | | Chrysotile (white asbestos) | |
| B00C - R0021 - Toilets - Boys | | | | | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00A/R0028/Partition Walls (Cubicles)/S10 | | | | | Chrysotile (white asbestos) | |
| B00C - R0023 - General Storeroom | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 30m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00D - General Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

| | |
|------------------|---|
| Ceiling Voids | Non Accessible Area - Height Restriction |
| Underfloor Voids | Non Accessible Area - Area inaccessible |

Interior**B00D - M0001 - Withdrawal Space - 1hb**

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 18m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|

Assumed Asbestos - Assumed Asbestos**B00D - R0001 - Toilets - Boys**

| | | | | | | |
|----------------------------|---------------------|-----|------------|--------------------|---------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|----------------------------|---------------------|-----|------------|--------------------|---------|--------------------|

2357/B00A/R0028/Partition Walls (Cubicles)/S10

Chrysotile (white asbestos)**B00D - R0004 - Toilets - Girls**

| | | | | | | |
|----------------------------|---------------------|-----|------------|--------------------|---------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|----------------------------|---------------------|-----|------------|--------------------|---------|--------------------|

2357/B00A/R0028/Partition Walls (Cubicles)/S10

Chrysotile (white asbestos)**B00D - R0005 - Kiln Room**

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|

Assumed Asbestos - Assumed AsbestosFloor Coverings
Res/Textile

Vinyl Sheet

2357/B00D/R0026/Floor Coverings Res/Textile/S11

No Asbestos Detected**B00D - R0006 - Movement**

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|

Assumed Asbestos - Assumed Asbestos**B00D - R0007 - General Storeroom**Floor Coverings
Res/Textile

Vinyl Sheet

2357/B00G/R0012/Floor Coverings Res/Textile/S6

No Asbestos Detected

Wall Linings Internal

Flat AC Sheeting

40m2

Throughout

Good Condition (1)

Low (1)

Low Priority (2-3)

2357/B00A/R0019/Wall Linings Internal/S8

Chrysotile (white asbestos)

Ceiling Structures/Linings

Flat AC Sheeting

6m2

Throughout

Good Condition (1)

Low (1)

Low Priority (2-3)

Assumed Asbestos - Assumed Asbestos**B00D - R0008 - Withdrawal Space - 1hb**

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|

Assumed Asbestos - Assumed Asbestos**B00D - R0009 - Movement**

| | | | | | | |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 28m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|----------------------------|------------------|------|------------|--------------------|---------|--------------------|

Assumed Asbestos - Assumed AsbestosFloor Coverings
Res/Textile

Vinyl Sheet

2357/B00D/R0026/Floor Coverings Res/Textile/S11

No Asbestos Detected**B00D - R0011 - Home Base Store**

| | | | | | | |
|-----------------------|------------------|------|------------|--------------------|---------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 40m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|-----------------------|------------------|------|------------|--------------------|---------|--------------------|

2357/B00A/R0019/Wall Linings Internal/S8

Chrysotile (white asbestos)

Ceiling Structures/Linings

Flat AC Sheeting

6m2

Throughout

Good Condition (1)

Low (1)

Low Priority (2-3)

Assumed Asbestos - Assumed Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|--|--------|--------------------|--------------------|------------------------------------|--------------------|
| Sample No | | | | Test Result | | |
| B00D - R0012 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 57m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0013 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 28m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0014 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 55m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0015 - Home Base Store | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 48m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0016 - Home Base Store | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 40m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0017 - Withdrawal Space - 1hb | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 16m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0018 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 57m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0019 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0020 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 62m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0021 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0022 - Withdrawal Space - 1hb | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0023 - Home Base Store | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 25m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed Asbestos | | | | | | |
| B00D - R0024 - Home Base Store | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|---|--------|--------------------|--------------------|--|--------------------|
| Sample No | | | | Test Result | | |
| Wall Linings Internal | Flat AC Sheeting | 25m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| B00D - R0025 - Music Store | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 25m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 2357/B00D/R0026/Floor Coverings Res/Textile/S11 | | | | No Asbestos Detected | |
| B00D - R0026 - Practical Activities | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 50m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 2357/B00D/R0026/Floor Coverings Res/Textile/S11 | | | | No Asbestos Detected | |
| B00D - R0027 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 64m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| B00D - R0028 - External Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 16m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| B00D - R0029 - Withdrawal Space - 1hb | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 19m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| B00D - R0030 - Cleaning Supplies | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | No Asbestos Detected | |
| Wall Linings Internal | Flat AC Sheeting | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| B00D - R0031 - Distribution Board Cupboard | | | | | | |
| | | | | | Note: No inspection of live electrical installation. | |
| Wall Linings Internal | Flat AC Sheeting | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | Chrysotile (white asbestos) | |
| B00D - R0032 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| B00D - R0034 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 24m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Assumed Asbestos | | | | | |
| B00D - R0035 - Practical Activities - 1hb | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|----------------------------|----------------------|--------|--------------------|--------------------|-------------|--------------------|
| Sample No | | | | | Test Result | |
| Ceiling Structures/Linings | Flat AC Sheeting | 36m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |

Assumed Asbestos - Assumed Asbestos

| | | | | | | |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 2357/B00D/R0026/Floor Coverings Res/Textile/S11 | | | | | No Asbestos Detected |

B00D - R0036 - External Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|--|--------|--------------------|--------------------|-------------|------------------------------------|
| Sample No | | | | | Test Result | |
| B00E - Library - 1980 - Brick/Block (Brick/Block) | | | | | | |
| Exterior | | | | | | |
| Awnings | Flat AC Sheeting | 50m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00F/Awnings/S13 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | Non Accessible Area - Height Restriction | | | | | |
| Underfloor Voids | Non Accessible Area - Area inaccessible | | | | | |
| Interior | | | | | | |
| B00E - R0001 - Main Switchroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| Electrical Mounting Board | Resinous Board | | | | | No Asbestos Detected |
| | 2357/B00E/R0001/Electrical Mounting Board/S14 | | | | | |
| B00E - R0002 - Special Programs Room | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 47m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0003 - Cleaning Supplies | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Sheet | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0004 - Cleaning Supplies Store | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 10m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0005 - Library Office/Workroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 18m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0006 - Security Store | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0007 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 256m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0008 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0009 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0010 - Reading Area | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 241m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00E - R0011 - General Storeroom | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|--|--------|--------------------|--------------------|------------------------------------|--------------------|
| Sample No | | | | | Test Result | |
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | No Asbestos Detected | |
| Ceiling Structures/Linings | Flat AC Sheeting | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) | |
| B00E - R0012 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) | |
| B00E - R0013 - Library Office/Workroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) | |
| B00E - R0014 - Plant | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) | |
| B00E - R0015 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 18m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) | |
| B00E - R0016 - External Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - Communal Facilities/Pupil Facilities - 1980 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|------------------|---|------|------------|--------------------|---------|------------------------------------|
| Awnings | Compressed AC Sheet | 60m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00F/Awnings/S13 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | Non Accessible Area - Height Restriction | | | | | |
| Underfloor Voids | Non Accessible Area - Area inaccessible | | | | | |

Interior

B00F - R0002 - Canteen

| | | | | | | |
|-----------------------------|--|------|----------------------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 39m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 20m2 | North, West, Upper portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | No Asbestos Detected |
| | 2357/B00G/R0012/Floor Coverings Res/Textile/S6 | | | | | |

B00F - R0003 - Canteen Office/Store

| | | | | | | |
|-----------------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | No Asbestos Detected |
| | 2357/B00G/R0012/Floor Coverings Res/Textile/S6 | | | | | |

B00F - R0004 - Staff Toilet

| | | | | | | |
|----------------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |

B00F - R0005 - Canteen Office/Store

| | | | | | | |
|-----------------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | No Asbestos Detected |
| | 2357/B00G/R0012/Floor Coverings Res/Textile/S6 | | | | | |

B00F - R0006 - General Storeroom

| | | | | | | |
|-----------------------------|--|------|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | No Asbestos Detected |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 24m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |

B00F - R0007 - Movement

| | | | | | | |
|----------------------------|--|-------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 125m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |

B00F - R0008 - Stage

| | | | | | | |
|----------------------------|--|------|----------------------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 71m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 15m2 | North, East, Upper portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|--|--------|-----------------------------|--------------------|--|------------------------------------|
| Sample No | | | | | Test Result | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 2357/B00G/R0012/Floor Coverings Res/Textile/S6 | | | | | No Asbestos Detected |
| B00F - R0009 - Distribution Board Cupboard | | | | | Note: No inspection of live electrical installation. | |
| No Asbestos | | | | | | |
| B00F - R0010 - Special Programs Room | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 32m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00F - R0011 - P.E. Store | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | | No Asbestos Detected |
| Ceiling Structures/Linings | Flat AC Sheeting | 31m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00F - R0012 - Toilets - Girls | | | | | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0028/Partition Walls (Cubicles)/S10 | | | | | Chrysotile (white asbestos) |
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00F - R0013 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0014 - Toilets - Boys | | | | | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0028/Partition Walls (Cubicles)/S10 | | | | | Chrysotile (white asbestos) |
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00F - R0015 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00F - R0016 - Communal Space | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 188m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 50m2 | North, South, Upper portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0019/Wall Linings Internal/S8 | | | | | Chrysotile (white asbestos) |
| B00F - R0017 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00A/R0001/Ceiling Structures/Linings/S12 | | | | | Chrysotile (white asbestos) |
| B00F - R0019 - Covered Outdoor Learning Area | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00G - Administration/Staff Facilities - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|---------------|----------------------------|------|--------------|--------------------|---|--------------------|
| Eaves Linings | Corrugated AC Sheeting | 40m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00G/Eaves Linings/S1 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

Interior

B00G - R0001 - Principal

| | | | | | | |
|---------------|----------------------------------|----|----------------------|--------------------|---|--------------------|
| In-fill-panel | Compressed AC Sheet | 2m | North, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00G/R0001/In-fill-panel/S4 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00G - R0002 - Staff Toilet

| | | | | | | |
|-----------------------------|--|-----|------------|--------------------|------------------------------------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00G/R0002/Floor Coverings Res/Textile/S2 | | | | Chrysotile (white asbestos) | |

B00G - R0003 - Cleaning Supplies

| | | | | | | |
|-----------------------------|--|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | No Asbestos Detected | |

B00G - R0004 - Deputy Principal

| | | | | | | |
|---------------|----------------------------------|----|----------------------|--------------------|---|--------------------|
| In-fill-panel | Compressed AC Sheet | 2m | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00G/R0001/In-fill-panel/S4 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00G - R0005 - Staff Room Annexe

| | | | | | | |
|---------------|----------------------------------|----|----------------------|--------------------|---|--------------------|
| In-fill-panel | Compressed AC Sheet | 2m | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00G/R0001/In-fill-panel/S4 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00G - R0006 - Staff Room Annexe

| | | | | | | |
|---------------|----------------------------------|----|----------------------|--------------------|---|--------------------|
| In-fill-panel | Compressed AC Sheet | 2m | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00G/R0001/In-fill-panel/S4 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00G - R0007 - Ancillary Staff

| | | | | | | |
|---------------|----------------------------------|----|----------------------|--------------------|---|--------------------|
| In-fill-panel | Compressed AC Sheet | 2m | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00G/R0001/In-fill-panel/S4 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00G - R0008 - Staff Toilet

| | | | | | | |
|-----------------------------|--|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | No Asbestos Detected | |

B00G - R0009 - Staff Toilet

| | | | | | | |
|-----------------------------|--|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2357/B00G/R0003/Floor Coverings Res/Textile/S3 | | | | No Asbestos Detected | |

B00G - R0010 - Staff Room

| | | | | | | |
|---------------|----------------------------------|----|-----------------------------|--------------------|---|--------------------|
| In-fill-panel | Compressed AC Sheet | 7m | North, South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2357/B00G/R0001/In-fill-panel/S4 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

| | | | | | | |
|-----------------------------|--|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 2357/B00G/R0010/Floor Coverings Res/Textile/S7 | | | | No Asbestos Detected | |

B00G - R0011 - Movement

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|------------------------|--------|----------------------|---|--|--------------------|
| Sample No | | | | | Test Result | |
| Ceiling Structures/Linings | Corrugated AC Sheeting | 45m2 | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00G/Eaves Linings/S1 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00G - R0012 - Sick Bay | | | | | | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00G/R0012/Floor Coverings Res/Textile/S6 | | | | No Asbestos Detected | | |
| B00G - R0015 - Duplicating Workroom | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 33m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00G/R0002/Floor Coverings Res/Textile/S2 | | | | Chrysotile (white asbestos) | | |
| In-fill-panel | Compressed AC Sheet | 4m | North, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2357/B00G/R0001/In-fill-panel/S4 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00G - R0016 - Distribution Board Cupboard | | | | | Note: No inspection of live electrical installation. | |
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| 2357/B00G/R0016/Floor Coverings Res/Textile/S5 | | | | No Asbestos Detected | | |
| B00G - R0017 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00G - R0019 - Clerical Office | | | | | | |
| Non Accessible | | | | | | |
| B00G - R0020 - Entry Vestibule | | | | | | |
| Non Accessible | | | | | | |
| B00G - R0021 - Movement | | | | | | |
| Non Accessible | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B001 - Building Services - 2000 - Steel (Steel)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B001 - R0001 - Garden Store

No Asbestos

B001 - R0002 - Personal Effects Storage

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00J - Building Services - 2001 - Steel (Steel)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00J - R0001 - Chair Store

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00K - Other - 2007 - Metal Shed (Metal Shed)

Exterior

No Asbestos No Asbestos Found

Interior

B00K - R0001 - Store

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00L - General Learning/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00L - R0001 - Other

No Asbestos

B00L - R0002 - Special Programs Room

No Asbestos

B00L - R0003 - Special Programs Store

No Asbestos

B00L - R0004 - Special Programs Store

No Asbestos

B00L - R0005 - Special Programs Room

No Asbestos

B00L - R0006 - Special Programs Store

No Asbestos

B00L - R0007 - Movement

No Asbestos

B00L - R0008 - Main Switch Board

No Asbestos

B00L - R0009 - External Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00M - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00M - R0001 - Practical Activities

No Asbestos

B00M - R0002 - Home Base

No Asbestos

B00M - R0003 - Home Base Store

No Asbestos

B00M - R0004 - Practical Activities

No Asbestos

B00M - R0005 - Home Base

No Asbestos

B00M - R0006 - Home Base Store

No Asbestos

B00M - R0007 - Withdrawal Space - 2hb

No Asbestos

B00M - R0008 - External Movement

No Asbestos

B00M - R0009 - Main Switch Board

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00N - General Learning - 2011 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

| | |
|-----------------|-------------------|
| Ceiling Void | No Asbestos Found |
| Underfloor Void | No Asbestos Found |

Interior

B00N - R0001 - External Movement

No Asbestos

B00N - R0002 - Home Base

No Asbestos

B00N - R0003 - Practical Activities

No Asbestos

B00N - R0004 - Home Base Store

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B000 - Storage - 2014 - Metal Shed (Metal Shed)

Exterior

| | |
|-----------------|-------------------|
| Ceiling Void | No Asbestos Found |
| Underfloor Void | No Asbestos Found |

Interior

B000 - R0001 - Other - Regional Use

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00P - General Learning - 2016 - Steel (Steel)

Exterior

| | |
|-----------------|-------------------|
| Ceiling Void | No Asbestos Found |
| Underfloor Void | No Asbestos Found |

Interior

B00P - R0001 - External Movement

No Asbestos

B00P - R0002 - Home Base

No Asbestos

B00P - R0003 - Staff Kitchen

No Asbestos

B00P - R0004 - Home Base Store

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Build+1 - Metal shed

Exterior

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D12389 - Learning Unit - Standard/Withdrawal : Placement Date - 21/05/2008

Exterior

| | | | |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 11.52 m2 |

Interior

R1 - Entry

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 8 m2 |

R2 - General Learning Space

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 55 m2 |

R3 - Store

| | | | |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 10 m2 |
|---------|---------------|------------------|-------|

OS 602 - D13589 - Learning Unit - Standard With P.A.A. : Placement Date - 9/11/2006

Exterior

| | | | |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 11.52 m2 |

Interior

R1 - Learning space/withdrawal/entry

| | | | |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 70 m2 |
|---------|---------------|------------------|-------|

R2 - Home Base Store

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 3 m2 |

OS 601 - D13916 - Learning Unit - Standard/Withdrawal : Placement Date - 11/12/2014

Exterior

| | | | |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 11.52 m2 |

Interior

R1 - Entry

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 8 m2 |

R2 - General Learning Space

| | | | |
|----------------|---------------|------------------|-------|
| End wall panel | Flat AC Sheet | Assumed Asbestos | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | 55 m2 |

R3 - Store

| | | | |
|---------|---------------|------------------|-------|
| Ceiling | Flat AC Sheet | Assumed Asbestos | 10 m2 |
|---------|---------------|------------------|-------|

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017