


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lake Heights Public School (4011)
Region : Illawarra and South East
State Electorate : Wollongong
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 14 - Apr - 2008
Reviewed By : Greencap-NAA : 02 - Aug - 2016

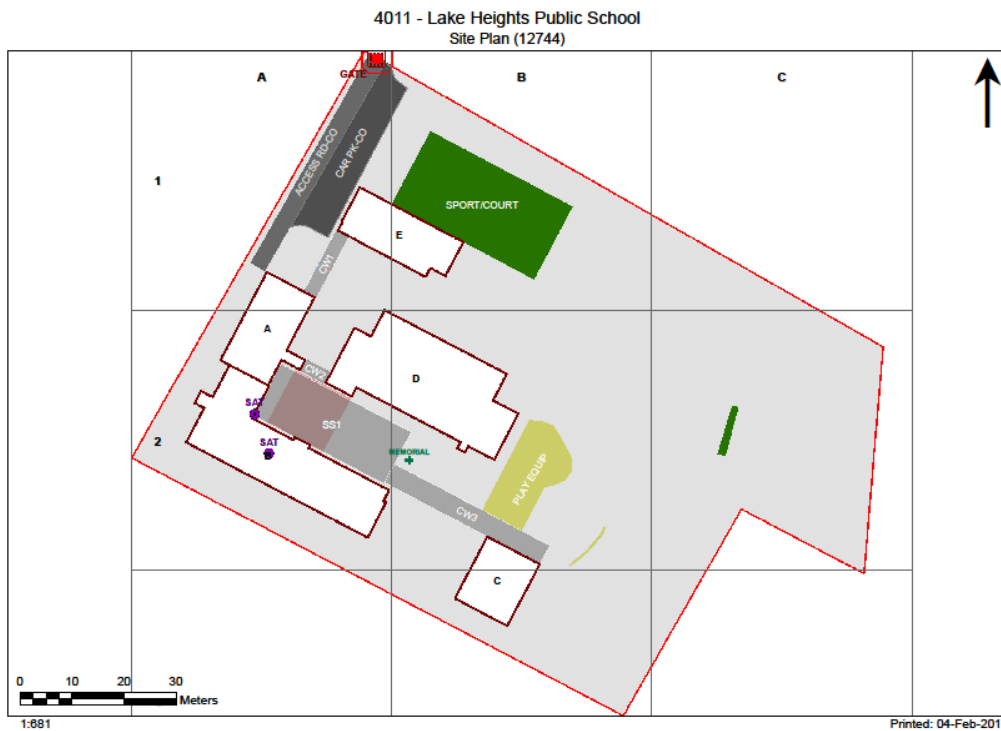

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1962 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00A/Eaves Linings/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height Restriction

Interior

B00A - R0001 - Home Base

No Asbestos

B00A - R0002 - Home Base Store

No Asbestos

B00A - R0003 - Personal Effects Storage

No Asbestos

B00A - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4011/B00A/R0004/Floor Coverings Res/Textile/S6				No Asbestos Detected	

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Home Base Store

No Asbestos

B00A - R0007 - Movement


No Asbestos

B00A - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00A/R0009/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R9001 - General Storeroom

Pillar Packers	Flat AC Sheeting	1m2	Variable positions	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	4011/B00A/R9001/Pillar Packers/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Variable positions	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	4011/B00A/R9001/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

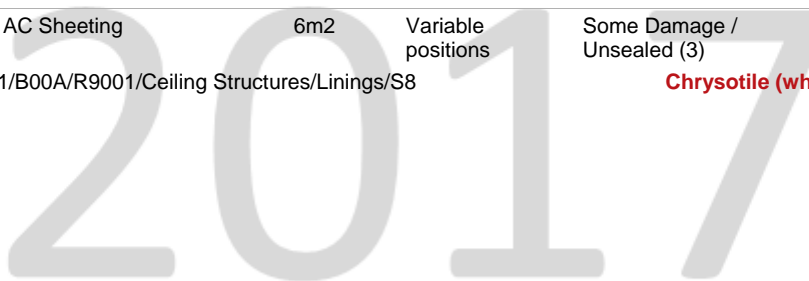

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Staff Facilities - 1956 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00B/Eaves Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00B - R0002 - Cleaning Supplies

No Asbestos

B00B - R0003 - Interview

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00B/R0019/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Electrical Mounting Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00B/R0019/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Floor Coverings Res/Textile	Vinyl Tiles				
	4011/B00B/R0008/Floor Coverings Res/Textile/S5				No Asbestos Detected

B00B - R0009 - Canteen

No Asbestos

B00B - R0010 - Uniform Shop

No Asbestos

B00B - R0011 - Staff Toilet

No Asbestos

B00B - R0012 - Reading Area

No Asbestos

B00B - R0013 - Reading Area

No Asbestos

B00B - R0014 - Library Office/Workroom

No Asbestos

B00B - R0015 - Library Office/Workroom

No Asbestos

B00B - R0016 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00B/R0019/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0019 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4011/B00B/R0019/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0020 - Movement						
No Asbestos						
B00B - R0021 - Staff Toilet						
No Asbestos						
B00B - R0023 - Staff Room						
No Asbestos						
B00B - R0024 - External Movement						
No Asbestos						
B00B - R0025 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4011/B00B/R0019/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0026 - Personal Effects Storage						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4011/B00B/R0019/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0027 - Principal						
No Asbestos						
B00B - R0028 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00C - R0001 - Entry Vestibule

No Asbestos

B00C - R0002 - Principal

No Asbestos

B00C - R0003 - Clerical Office/Workroom

No Asbestos

B00C - R0004 - Staff Toilet

No Asbestos

B00C - R0005 - Security Store

No Asbestos

B00C - R0006 - Access Shower/Toilet/Change

No Asbestos

B00C - R0007 - Staff Room

No Asbestos

B00C - R0008 - Cleaning Distributed Store

No Asbestos

B00C - R0009 - Staff Kitchen

No Asbestos

B00C - R0010 - Sick Bay

No Asbestos

B00C - R0011 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Communal Facilities - 1959 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00D/Eaves Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00D - R0001 - General Storeroom

No Asbestos

B00D - R0002 - Staff Toilet

No Asbestos

B00D - R0003 - Withdrawal Space - 1hb

No Asbestos

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Home Base

No Asbestos

B00D - R0006 - Home Base

No Asbestos

B00D - R0007 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles				
	4011/B00D/R0012/Floor Coverings Res/Textile/S2	No Asbestos Detected			

B00D - R0008 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles				
	4011/B00D/R0012/Floor Coverings Res/Textile/S2	No Asbestos Detected			

B00D - R0009 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles				
	4011/B00D/R0012/Floor Coverings Res/Textile/S2	No Asbestos Detected			

B00D - R0010 - Home Base

No Asbestos

B00D - R0011 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles				
	4011/B00D/R0012/Floor Coverings Res/Textile/S2	No Asbestos Detected			

B00D - R0012 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles				
	4011/B00D/R0012/Floor Coverings Res/Textile/S2	No Asbestos Detected			

B00D - R0013 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles				
	4011/B00D/R0012/Floor Coverings Res/Textile/S2	No Asbestos Detected			

B00D - R0015 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00D/R0015/Ceiling Structures/Linings/S3			Chrysotile (white asbestos)		

B00D - R0016 - Covered Outdoor Learning Area

No Asbestos

B00D - R0017 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Pupil Facilities - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00E/Eaves Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00E - R0001 - Sports Store

In-fill-panel	Flat AC Sheeting	6m	West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	4011/B00E/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00E/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00E/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0004 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00E/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0005 - Staff Toilet


Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00E/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0006 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00E/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0010 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4011/B00E/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

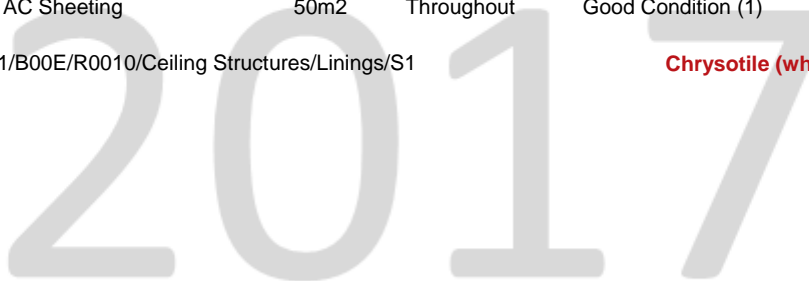

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4011_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017