


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Leichhardt Public School (7423)  
**Region :** Sydney  
**State Electorate :** Balmain  
**Local Government Area :** Leichhardt

**Initial Survey :** Noel Arnold & Associates : 30 - Oct - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

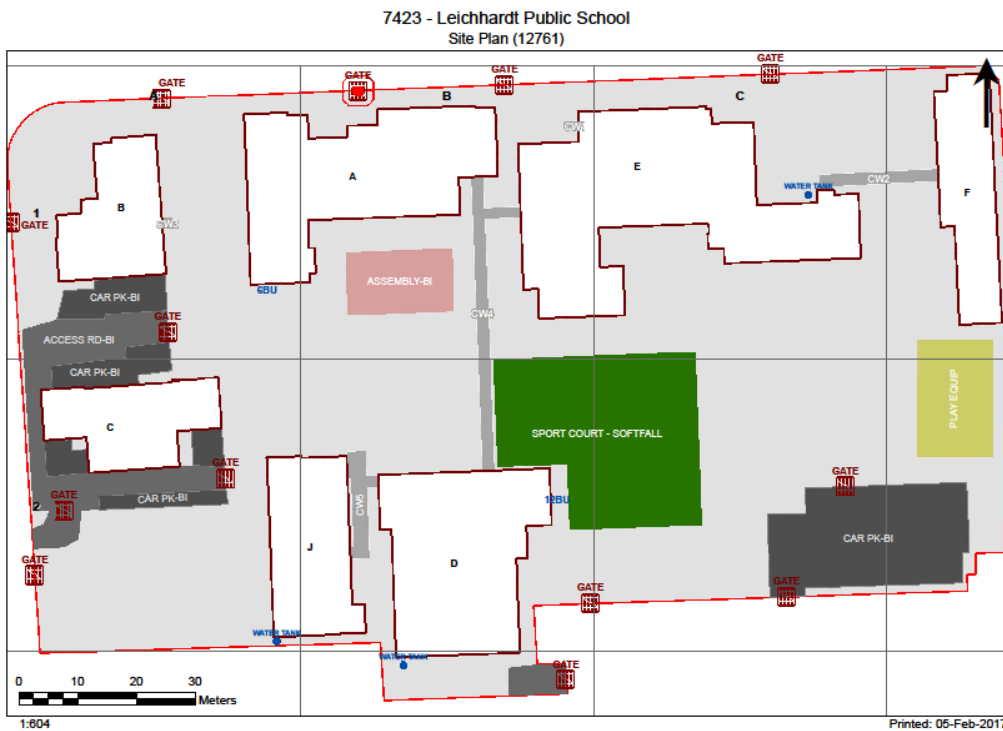

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Library - 1897 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00A - M0001 - General Storeroom**

Ceiling Structures/Linings	Compressed AC Sheet	11m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00A - M0002 - Seminar/Study**

Ceiling Structures/Linings	Compressed AC Sheet	20m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00A - M0003 - Stairs**

No Asbestos

**B00A - M1001 - General Storeroom**

No Asbestos

**B00A - R0001 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Sheet					
7423/B00A/R0001/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>	

**B00A - R0002 - Cleaning Distributed Store**

Non Accessible

**B00A - R0003 - Movement**

No Asbestos

**B00A - R0004 - Movement**

No Asbestos

**B00A - R0005 - Movement**

No Asbestos

**B00A - R0006 - Movement**

Ceiling Structures/Linings	Compressed AC Sheet	40m2	Ceiling half of room	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00A - R0007 - Staff Room**

No Asbestos

**B00A - R0008 - Movement**

No Asbestos

**B00A - R0009 - Staff Room Annexe**

No Asbestos

**B00A - R0010 - Deputy Principal**

No Asbestos

**B00A - R0011 - Interview**

No Asbestos

**B00A - R0012 - Principal**

No Asbestos

**B00A - R0013 - Security Store**

No Asbestos

**B00A - R0014 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0015 - Movement**

No Asbestos

**B00A - R0016 - Cleaning Distributed Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	<b>B00A - R0017 - Movement</b>					
	No Asbestos					
	<b>B00A - R0018 - Library Office/Workroom</b>					
	No Asbestos					
	<b>B00A - R0022 - Security Store</b>					
	No Asbestos					
	<b>B00A - R0023 - Cleaning Distributed Store</b>					
	No Asbestos					
	<b>B00A - R0024 - Entry Vestibule</b>					
	No Asbestos					
	<b>B00A - R0025 - Movement</b>					
	No Asbestos					
	<b>B00A - R0026 - Staff Toilet</b>					
	No Asbestos					
	<b>B00A - R0027 - Staff Toilet</b>					
	No Asbestos					
	<b>B00A - R0028 - Clerical Office</b>					
	No Asbestos					
	<b>B00A - R0029 - Movement</b>					
	No Asbestos					
	<b>B00A - R0030 - Sick Bay</b>					
	No Asbestos					
	<b>B00A - R0031 - Duplicating Workroom</b>					
	No Asbestos					
	<b>B00A - R0032 - Toilets - Boys/Girls</b>					
	No Asbestos					
	<b>B00A - R0033 - Movement</b>					
	No Asbestos					
	<b>B00A - R0034 - Community Clinic</b>					
	No Asbestos					
	<b>B00A - R0035 - Special Programs Room</b>					
	No Asbestos					
	<b>B00A - R0037 - Home Base</b>					
	No Asbestos					
	<b>B00A - R0038 - Home Base</b>					
	No Asbestos					
	<b>B00A - R0039 - Movement</b>					
	No Asbestos					
	<b>B00A - R0040 - Stairs</b>					
	No Asbestos					
	<b>B00A - R1001 - Home Base</b>					
	No Asbestos					
	<b>B00A - R1002 - Home Base</b>					
	No Asbestos					
	<b>B00A - R1003 - Practical Activities - 1hb</b>					
	No Asbestos					
	<b>B00A - R1004 - General Storeroom</b>					
	No Asbestos					
	<b>B00A - R1005 - Home Base</b>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Compressed AC Sheet	49.48m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
<b>B00A - R1006 - Home Base</b>						
Ceiling Structures/Linings	Compressed AC Sheet	49.14m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
<b>B00A - R1007 - Home Base</b>						
Ceiling Structures/Linings	Compressed AC Sheet	49.91m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
<b>B00A - R1008 - Security Store</b>						
Ceiling Structures/Linings	Compressed AC Sheet	11.84m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
<b>B00A - R1009 - Movement</b>						
Ceiling Structures/Linings	Compressed AC Sheet	59.77m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
<b>B00A - R1010 - Movement</b>						
No Asbestos						
<b>B00A - R1011 - General Storeroom</b>						
No Asbestos						
<b>B00A - R1012 - Home Base</b>						
No Asbestos						
<b>B00A - R1013 - Home Base</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Other-Dse Admin - 1891 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Compressed AC Sheet	50m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	---------------------	------	-------	--------------------	---------	--------------------

**Assumed Asbestos - No Access - Eaves too high to sample**

Underfloor Voids	Non Accessible Area - No Access point found to enter underfloor voids internal or external of building					
------------------	---	--	--	--	--	--

Ceiling Voids	No Asbestos Found					
---------------	-------------------	--	--	--	--	--

**Interior**

**B00B - R0001 - Other - Regional Use**

No Asbestos

**B00B - R0002 - Other - Regional Use**

No Asbestos

**B00B - R0003 - Other - Regional Use**

No Asbestos

**B00B - R0004 - Other - Regional Use**

No Asbestos

**B00B - R0005 - Other - Regional Use**

Floor Coverings Res/Textile	Vinyl Tiles				
7423/B00B/R0005/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B00B - R0008 - Other - Regional Use**

No Asbestos

**B00B - R0009 - Other - Regional Use**

Ceiling Structures/Linings	Compressed AC Sheet	7.65m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	--------	---------	--------------------	---------	--------------------

7423/B00A/M0002/Ceiling Structures/Linings/S2

**Chrysotile (white asbestos)**

**B00B - R0011 - Other - Regional Use**

No Asbestos

**B00B - R0013 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)				
7423/B00B/R0013/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>

**B00B - R0014 - Home Base**

No Asbestos

**B00B - R0015 - Practical Activities**

No Asbestos

**B00B - R0016 - Stairs**

No Asbestos

**B00B - R1001 - Other - Regional Use**

No Asbestos

**B00B - R1002 - Other - Regional Use**

No Asbestos

**B00B - R1003 - Other - Regional Use**

No Asbestos

**B00B - R1004 - Other - Regional Use**

No Asbestos

**B00B - R1005 - Other - Regional Use**

No Asbestos

**B00B - R1006 - Other - Regional Use**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R1007 - Other - Regional Use</b>						
No Asbestos						
<b>B00B - R1008 - Other - Regional Use</b>						
No Asbestos						
<b>B00B - R1009 - Stairs</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Other-Dse Admin - 1909 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00C - R0001 - Other - Regional Use**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00C/R0001/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	

**B00C - R0002 - Other - Regional Use**

No Asbestos

**B00C - R0003 - Other - Regional Use**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00C/R0001/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	

**B00C - R0004 - Other - Regional Use**

No Asbestos

**B00C - R0005 - Other - Regional Use**

No Asbestos

**B00C - R0006 - Other - Regional Use**

No Asbestos

**B00C - R0007 - Other - Regional Use**

No Asbestos

**B00C - R0008 - Other - Regional Use**

No Asbestos

**B00C - R0009 - Other - Regional Use**

No Asbestos

**B00C - R0010 - Other - Regional Use**

No Asbestos

**B00C - R0011 - Other - Regional Use**

No Asbestos

**B00C - R0012 - Other - Regional Use**

No Asbestos

**B00C - R0013 - Other - Regional Use**

No Asbestos

**B00C - R0014 - Other - Regional Use**

No Asbestos

**B00C - R0015 - Other - Regional Use**

No Asbestos

**B00C - R0016 - Other - Regional Use**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1982 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

**Interior**

**B00D - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	15.76m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00E/R0018/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

**B00D - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	14.92m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00E/R0018/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

**B00D - R0003 - Movement**

No Asbestos

**B00D - R0004 - Sports Store**

No Asbestos

**B00D - R0005 - Garden Store**

No Asbestos

**B00D - R0006 - Movement**

No Asbestos

**B00D - R0007 - Hall Chair Store**

No Asbestos

**B00D - R0008 - Communal Space**

No Asbestos

**B00D - R0009 - Main Switch Board**

No Asbestos

**B00D - R0010 - P.E. Store**

No Asbestos

**B00D - R0011 - Plant**

No Asbestos

**B00D - R0012 - Security Store**

No Asbestos

**B00D - R0013 - Movement**

No Asbestos

**B00D - R0014 - Hall Chair Store**

No Asbestos

**B00D - R0015 - Staff Toilet**

No Asbestos

**B00D - R0016 - Canteen Office/Store**

No Asbestos

**B00D - R0017 - Canteen Office/Store**

No Asbestos

**B00D - R0018 - Canteen**

No Asbestos

**B00D - R0019 - Raised Platform**

No Asbestos

**B00D - R0020 - Plant**

No Asbestos

**B00D - R0021 - Distribution Board**

Note: No inspection of live electrical installation.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00D - R0022 - Movement**

No Asbestos

**B00D - R0023 - Movement**

No Asbestos

**B00D - R0024 - General Assistant/Bulk Store**

Floor Coverings Res/Textile Vinyl Sheet

7423/B00D/R0024/Floor Coverings Res/Textile/S10

**No Asbestos Detected**

**B00D - R0025 - Cleaning Supplies**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Support Unit - 1883 - Brick/Block (Brick/Block)**

**Exterior**

Awnings	Flat AC Sheeting 7423/B00E/Awnings/S7	2m2	North-West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	50m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Eaves too high to sample &gt; 6m - EWP</b>
Ceiling Voids	Non Accessible Area - Limited access - No safe access into manhole as > 5m high in middle of rooms					
Underfloor Void	No Asbestos Found					

**Interior**

**B00E - R0001 - Plant**

Electrical Backing Board	Resinous Board 7423/B00E/R0001/Electrical Backing Board/S12					<b>No Asbestos Detected</b>
--------------------------	--	--	--	--	--	-----------------------------

**B00E - R0002 - General Storeroom**

No Asbestos

**B00E - R0003 - Movement**

No Asbestos

**B00E - R0004 - Personal Effects Storage**

No Asbestos

**B00E - R0005 - Home Base**

No Asbestos

**B00E - R0006 - Laundry - Type 2**

No Asbestos

**B00E - R0007 - Practical Activities - M - 1hb**

No Asbestos

**B00E - R0008 - Home Base - M**

No Asbestos

**B00E - R0009 - Personal Effects Storage**

No Asbestos

**B00E - R0010 - Movement**

No Asbestos

**B00E - R0011 - Sick Bay**

No Asbestos

**B00E - R0012 - Disabled Toilet**

No Asbestos

**B00E - R0013 - Movement**

No Asbestos

**B00E - R0014 - Home Base - M**

No Asbestos

**B00E - R0015 - Practical Activities - M - 1hb**

No Asbestos

**B00E - R0016 - Cleaning Distributed Store**

Non Accessible

**B00E - R0017 - Duplicating Workroom**

No Asbestos

**B00E - R0018 - Staff Toilet**

Partition Walls (Cubicles)	Compressed AC Sheet	NA	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
7423/B00E/R0018/Partition Walls (Cubicles)/S5						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Compressed AC Sheet 7423/B00E/R0018/Wall Linings Internal/S6					No Asbestos Detected
<b>B00E - R0019 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 7423/B00E/R0018/Partition Walls (Cubicles)/S5	2m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Compressed AC Sheet 7423/B00E/R0018/Wall Linings Internal/S6					No Asbestos Detected
<b>B00E - R0020 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 7423/B00E/R0018/Partition Walls (Cubicles)/S5	1.5m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0021 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00E - R0022 - Practical Activities - M - 1hb</b>						
No Asbestos						
<b>B00E - R0023 - Movement</b>						
No Asbestos						
<b>B00E - R0024 - Security Store</b>						
No Asbestos						
<b>B00E - R0025 - Home Base</b>						
No Asbestos						
<b>B00E - R0026 - Home Base</b>						
No Asbestos						
<b>B00E - R0027 - Movement</b>						
No Asbestos						
<b>B00E - R0028 - Home Base</b>						
No Asbestos						
<b>B00E - R0029 - Home Base</b>						
No Asbestos						
<b>B00E - R0030 - Movement</b>						
No Asbestos						
<b>B00E - R0031 - General Storeroom</b>						
No Asbestos						
<b>B00E - R0032 - Plant</b>						
No Asbestos						
<b>B00E - R0033 - Movement</b>						
No Asbestos						
<b>B00E - R0034 - Home Base</b>						
No Asbestos						
<b>B00E - R0035 - Home Base</b>						
No Asbestos						
<b>B00E - R0036 - Movement</b>						
No Asbestos						
<b>B00E - R0037 - Personal Effects Storage</b>						
No Asbestos						
<b>B00E - R0038 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00E - R0039 - Entry Vestibule</b>						
Ceiling Structures/Linings	Compressed AC Sheet 7423/B00A/M0002/Ceiling Structures/Linings/S2	1.55m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0040 - Home Base - M</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00E - R1001 - Personal Effects Storage**

Ceiling Structures/Linings	Compressed AC Sheet	7.74m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00E - R1002 - Withdrawal Space - 1hb**

Ceiling Structures/Linings	Compressed AC Sheet	10.02m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00E/R0018/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

**B00E - R1003 - Home Base**

Ceiling Structures/Linings	Compressed AC Sheet	53.87m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00E - R1004 - Home Base**

Ceiling Structures/Linings	Compressed AC Sheet	51.5m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00E - R1005 - Home Base**

Ceiling Structures/Linings	Compressed AC Sheet	51.22m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00E - R1006 - Plant**

No Asbestos

**B00E - R1007 - Movement**

Ceiling Structures/Linings	Compressed AC Sheet	2.74m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00E - R1008 - Personal Effects Storage**

Ceiling Structures/Linings	Compressed AC Sheet	13.19m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00E - R1009 - Distribution Board** Note: No inspection of live electrical installation.


No Asbestos

**B00E - R1010 - Practical Activities - 1hb**

Ceiling Structures/Linings	Compressed AC Sheet	39.13m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00E - R1011 - Movement**

Ceiling Structures/Linings	Compressed AC Sheet	61.17m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

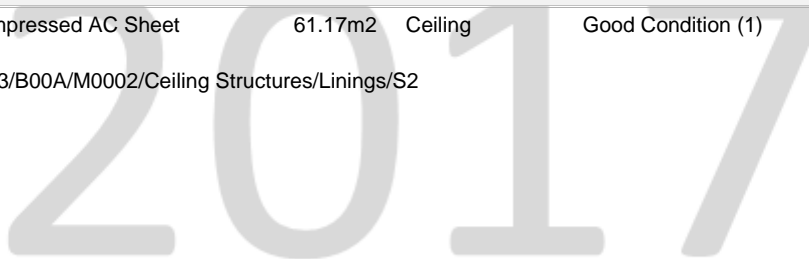

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1928 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00F - R0001 - Home Base**

No Asbestos

**B00F - R0002 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0003 - Practical Activities - 1hb**

No Asbestos

**B00F - R0004 - Movement**

No Asbestos

**B00F - R0005 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet					
7423/B00F/R0005/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>	

**B00F - R0006 - Home Base**

No Asbestos

**B00F - R0007 - Movement**

No Asbestos

**B00F - R0008 - Movement**

No Asbestos

**B00F - R0009 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00E/R0018/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

**B00F - R0010 - Staff Toilet**

No Asbestos

**B00F - R0011 - Cleaning Distributed Store**

No Asbestos

**B00F - R0012 - Distribution Board**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board					
7423/B00F/R0012/Electrical Backing Board/S13					<b>No Asbestos Detected</b>	

**B00F - R0013 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00E/R0018/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

**B00F - R0014 - Practical Activities - 1hb**

No Asbestos

**B00F - R0015 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0016 - Home Base**

No Asbestos

**B00F - R1001 - General Storeroom**

No Asbestos

**B00F - R1002 - Personal Effects Storage**

No Asbestos

**B00F - R1003 - General Storeroom**

Ceiling Structures/Linings	Compressed AC Sheet	9.52m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R1004 - Practical Activities - 1hb</b>						
Ceiling Structures/Linings	Compressed AC Sheet	14.84m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1005 - Withdrawal Space - 1hb</b>						
Ceiling Structures/Linings	Compressed AC Sheet	12.71m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1006 - Home Base</b>						
Ceiling Structures/Linings	Compressed AC Sheet	63.6m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
7423/B00A/M0002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R9001 - Plant</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00J - Library/General Learning - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior****B00J - R0001 - Movement**

No Asbestos

**B00J - R0002 - Staff Toilet**

No Asbestos

**B00J - R0003 - Cleaning Distributed Store**

No Asbestos

**B00J - R0004 - Main Switch Board**

No Asbestos

**B00J - R0005 - K.L.A. Store**

No Asbestos

**B00J - R0006 - Communications Room**

No Asbestos

**B00J - R0007 - Library Office/Workroom**

No Asbestos

**B00J - R0008 - Reading Area**

No Asbestos

**B00J - R0009 - External Movement**

No Asbestos

**B00J - R0010 - Plant**

No Asbestos

**B00J - R1001 - Home Base**

No Asbestos

**B00J - R1002 - Home Base Store**

No Asbestos

**B00J - R1003 - Practical Activities - 1hb**

No Asbestos

**B00J - R1004 - Withdrawal Space - 1hb**

No Asbestos

**B00J - R1005 - Home Base**

No Asbestos

**B00J - R1006 - Home Base Store**

No Asbestos

**B00J - R1007 - Practical Activities - 1hb**

No Asbestos

**B00J - R1008 - Withdrawal Space - 2hb**

No Asbestos

**B00J - R1009 - Home Base**

No Asbestos

**B00J - R1010 - Home Base Store**

No Asbestos

**B00J - R1011 - Practical Activities - 1hb**

No Asbestos

**B00J - R1013 - External Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017