


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Padstow Park Public School (2826)  
**Region :** South Western Sydney  
**State Electorate :** East Hills  
**Local Government Area :** Bankstown

**Initial Survey :** Noel Arnold & Associates : 29 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 28 - Aug - 2015

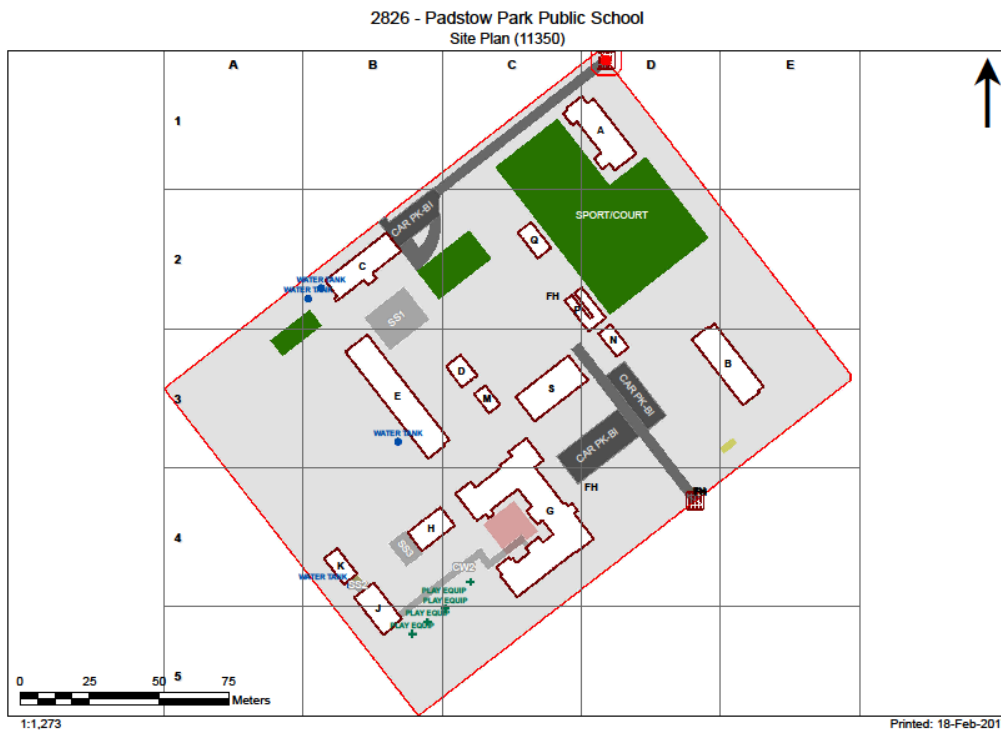

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1948 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 2826/B00B/Eaves Linings/S6	60m2	Variable positions	Some Damage - Unsealed (3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	Low (1)	Medium Priority (4-5)
Ceiling Voids	Fibre Cement Pipe 2826/B00A/Ceiling Voids/S10	16m	West	Some Damage - Unsealed (3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	Low (1)	Low Priority (2-3)
Underfloor Voids	AC Fragments/Debris 2826/B00A/Underfloor Voids/S11	1m2	Variable positions	Poor Condition - Extensive Damage (4) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	Low (1)	Low Priority (2-3)

**Interior**

**B00A - R0001 - Community Clinic**

No Asbestos

**B00A - R0002 - Staff Toilet**

No Asbestos

**B00A - R0004 - Cleaning Distributed Store**

No Asbestos

**B00A - R0005 - General Storeroom**

No Asbestos

**B00A - R0006 - General Storeroom**

No Asbestos

**B00A - R0007 - Clerical Office**

Ceiling Structures/Linings Flat AC Sheeting  
2826/B00A/R0021/Ceiling Structures/Linings/S12 **No Asbestos Detected**

Floor Coverings Res/Textile Vinyl Sheet  
2826/B00A/R0007/Floor Coverings Res/Textile/S18 **No Asbestos Detected**

**B00A - R0008 - Movement**

No Asbestos

**B00A - R0009 - Personal Effects Storage**

No Asbestos

**B00A - R0010 - Movement**

No Asbestos

**B00A - R0011 - Movement**

No Asbestos

**B00A - R0012 - General Storeroom**

No Asbestos

**B00A - R0013 - General Storeroom**

No Asbestos

**B00A - R0014 - Withdrawal Space - 1hb**

No Asbestos

**B00A - R0015 - Home Base Store**

No Asbestos

**B00A - R0016 - Home Base**

No Asbestos

**B00A - R0017 - General Storeroom**

No Asbestos

**B00A - R0018 - Withdrawal Space - 1hb**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0019 - Home Base Store</b>						
No Asbestos						
<b>B00A - R0020 - Home Base</b>						
No Asbestos						
<b>B00A - R0021 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	2826/B00A/R0021/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
<b>B00A - R0022 - Movement</b>						
No Asbestos						
<b>B00A - R0023 - Stairs</b>						
No Asbestos						
<b>B00A - R1001 - Hall Chair Store</b>						
No Asbestos						
<b>B00A - R1002 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00A - R1003 - Drinking Facilities</b>						
No Asbestos						
<b>B00A - R1004 - General Storeroom</b>						
No Asbestos						
<b>B00A - R1005 - Home Base</b>						
No Asbestos						
<b>B00A - R1006 - Home Base Store</b>						
No Asbestos						
<b>B00A - R1007 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00A - R1008 - Personal Effects Storage</b>						
No Asbestos						
<b>B00A - R1009 - Home Base</b>						
No Asbestos						
<b>B00A - R1010 - Home Base Store</b>						
No Asbestos						
<b>B00A - R1011 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00A - R1012 - Personal Effects Storage</b>						
No Asbestos						
<b>B00A - R1014 - Stairs</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00A/R1016/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00A - R1015 - Movement</b>						
No Asbestos						
<b>B00A - R1016 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00A/R1016/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - General Learning - 1948 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/Eaves Linings/S6				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0001 - Personal Effects Storage**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0002 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	2m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0007/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	2m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0007/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	

**B00B - R0004 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	2m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0007/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	

**B00B - R0005 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	2m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0007/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	

**B00B - R0006 - Personal Effects Storage**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0008 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration/Staff Facilities - 1948 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00P/Eaves Linings/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00C/Gable Verge Lining/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00C - R0018 - Principal**

No Asbestos

**B00C - R0019 - Staff Room Annexe**

No Asbestos

**B00C - R0020 - Security Store**

No Asbestos

**B00C - R0021 - Movement**

No Asbestos

**B00C - R0022 - Entry Vestibule**

No Asbestos

**B00C - R0023 - Security Store**

No Asbestos

**B00C - R0024 - Movement**

No Asbestos

**B00C - R0025 - Staff Room**

No Asbestos

**B00C - R0026 - Movement**

No Asbestos

**B00C - R0027 - Duplicating Workroom**

No Asbestos

**B00C - R0028 - Cleaning Distributed Store**

No Asbestos

**B00C - R0029 - Staff Toilet**

No Asbestos

**B00C - R0030 - Disabled Toilet**

No Asbestos

**B00C - R0031 - Clerical Office/Workroom**

No Asbestos

**B00C - R0032 - Sick Bay**

No Asbestos

**B00C - R0033 - Deputy Principal**

No Asbestos

**B00C - R0034 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1948 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00P/Eaves Linings/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00D - R0001 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting					
	2826/B00D/R0006/Ceiling Structures/Linings/S14					<b>No Asbestos Detected</b>

**B00D - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	2826/B00D/R0006/Ceiling Structures/Linings/S14					<b>No Asbestos Detected</b>

**B00D - R0003 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting					
	2826/B00D/R0006/Ceiling Structures/Linings/S14					<b>No Asbestos Detected</b>

**B00D - R0004 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting					
	2826/B00D/R0006/Ceiling Structures/Linings/S14					<b>No Asbestos Detected</b>

**B00D - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	2826/B00D/R0006/Ceiling Structures/Linings/S14					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00E - General Learning/Library - 1948 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/Eaves Linings/S6				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00E - R0001 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0011/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0005 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0007/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0011/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0006 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0007/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0011/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0007 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	Behind Heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0007/Wall Linings Internal/S1				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0011/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0008 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0011/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0009 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0011/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0010 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0011/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0011 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00E/R0011/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0012 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00E - R0013 - Home Base Store**

No Asbestos

**B00E - R0014 - Home Base**

No Asbestos

**B00E - R0015 - Home Base Store**

No Asbestos

**B00E - R0016 - Home Base**

No Asbestos

**B00E - R0017 - Withdrawal Space - 1hb**

No Asbestos

**B00E - R0018 - Practical Activities - 1hb**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning/Communal Facilities - 1928 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00B/Eaves Linings/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00C/Gable Verge Lining/S9			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00G - R0001 - Staff Toilet**

No Asbestos

**B00G - R0002 - Personal Effects Storage**

No Asbestos

**B00G - R0003 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0004 - Seminar/Study**

No Asbestos

**B00G - R0005 - Communal Space**

No Asbestos

**B00G - R0006 - Raised Platform**

No Asbestos

**B00G - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00M/R0001/Ceiling Structures/Linings/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R0008 - Home Base**

No Asbestos

**B00G - R0009 - Movement**

No Asbestos

**B00G - R0010 - Seminar/Study**

No Asbestos

**B00G - R0011 - Movement**

No Asbestos

**B00G - R0012 - General Storeroom**

No Asbestos

**B00G - R0013 - P.E. Store**

No Asbestos

**B00G - R0014 - Movement**

No Asbestos

**B00G - R0016 - Movement**

No Asbestos

**B00G - R0017 - Cleaning Distributed Store**

No Asbestos

**B00G - R0018 - Sports Store**

No Asbestos

**B00G - R0019 - Personal Effects Storage**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	6m2	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2826/B00G/R0020/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00G - R0020 - Practical Activities - 1hb</b>						
Wall Linings Internal	Flat AC Sheeting	4m2	West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2826/B00G/R0020/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00G - R0021 - Home Base</b>						
No Asbestos						
<b>B00G - R0022 - Home Base</b>						
No Asbestos						
<b>B00G - R0023 - Movement</b>						
No Asbestos						
<b>B00G - R0024 - Deputy Principal</b>						
No Asbestos						
<b>B00G - R0025 - Home Base</b>						
No Asbestos						
<b>B00G - R0026 - Home Base</b>						
No Asbestos						
<b>B00G - R0027 - Movement</b>						
No Asbestos						
<b>B00G - R0028 - Movement</b>						
No Asbestos						
<b>B00G - R0029 - Movement</b>						
No Asbestos						
<b>B00G - R0030 - Personal Effects Storage</b>						
No Asbestos						
<b>B00G - R0031 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2826/B00M/R0001/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00G - R0032 - General Storeroom</b>						
No Asbestos						
<b>B00G - R0033 - Movement</b>						
No Asbestos						
<b>B00G - R0034 - Movement</b>						
No Asbestos						
<b>B00G - R0035 - Stairs</b>						
No Asbestos						
<b>B00G - R1001 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2826/B00G/R1001/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
<b>B00G - R1002 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2826/B00G/R1001/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
<b>B00G - R1003 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2826/B00G/R1001/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
<b>B00G - R1004 - Personal Effects Storage</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00G - R1005 - Home Base</b>						
No Asbestos						
<b>B00G - R1006 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00G - R1007 - General Storeroom</b>						
No Asbestos						
<b>B00G - R1008 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2826/B00G/R1001/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00G - R1009 - Movement</b>						
No Asbestos						
<b>B00G - R1010 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00G - R1011 - Home Base</b>						
No Asbestos						
<b>B00G - R1012 - Home Base</b>						
No Asbestos						
<b>B00G - R1013 - Movement</b>						
No Asbestos						
<b>B00G - R1014 - Movement</b>						
No Asbestos						
<b>B00G - R1015 - Stairs</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 1948 - Timber (Timber)**

**Exterior**

Eaves Linings	No Asbestos Found
Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00H - R0001 - Home Base**

No Asbestos

**B00H - R0002 - Home Base**

No Asbestos

**B00H - R0003 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities - 1948 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	15m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00J/Eaves Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	Non Accessible Area - No Manhole to access ceiling void					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00J - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00J/R0001/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00J - R0002 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00J/R0001/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00J - R0003 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 1948 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00J/Eaves Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	Non Accessible Area - No Manhole access to ceiling void					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00K - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00J/R0001/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Building Services - 1928 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00P/Eaves Linings/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	Non Accessible Area - No Manhole access to void					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00M - R0001 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00M/R0001/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00M - R0002 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00M/R0001/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Communal Facilities - 1948 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 2826/B00P/Eaves Linings/S8	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	Non Accessible Area - No Manhole access to void					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00N - R0001 - P.E. Store**

Ceiling Structures/Linings	Flat AC Sheeting 2826/B00N/R0001/Ceiling Structures/Linings/S17	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00P - Pupil Facilities - 1948 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00P/Eaves Linings/S8			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Non Accessible Area - No Manhole access to void					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00P - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00N/R0001/Ceiling Structures/Linings/S17			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00P - R0002 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00N/R0001/Ceiling Structures/Linings/S17			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00P - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00N/R0001/Ceiling Structures/Linings/S17			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Q - Building Services - 1948 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00P/Eaves Linings/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	Non Accessible Area - No Manhole access to void					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00Q - R0001 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00N/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00Q - R0002 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2826/B00N/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00S - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00S - R0001 - External Movement**

No Asbestos

**B00S - R0002 - Reading Area**

No Asbestos

**B00S - R0003 - Library Office/Workroom**

No Asbestos

**B00S - R0004 - Communications Room**

No Asbestos

**B00S - R0005 - K.L.A. Store**

No Asbestos

**B00S - R0006 - Staff Toilet**

No Asbestos

**B00S - R0007 - Toilet - Lobby**

No Asbestos

**B00S - R0008 - Cleaning Distributed Store**

No Asbestos

**B00S - R0009 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

2826\_ASB\_221112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017