


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Parkes Public School (2835)
Region : Western NSW
State Electorate : Orange
Local Government Area : Parkes

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : : 30 - Mar - 2015

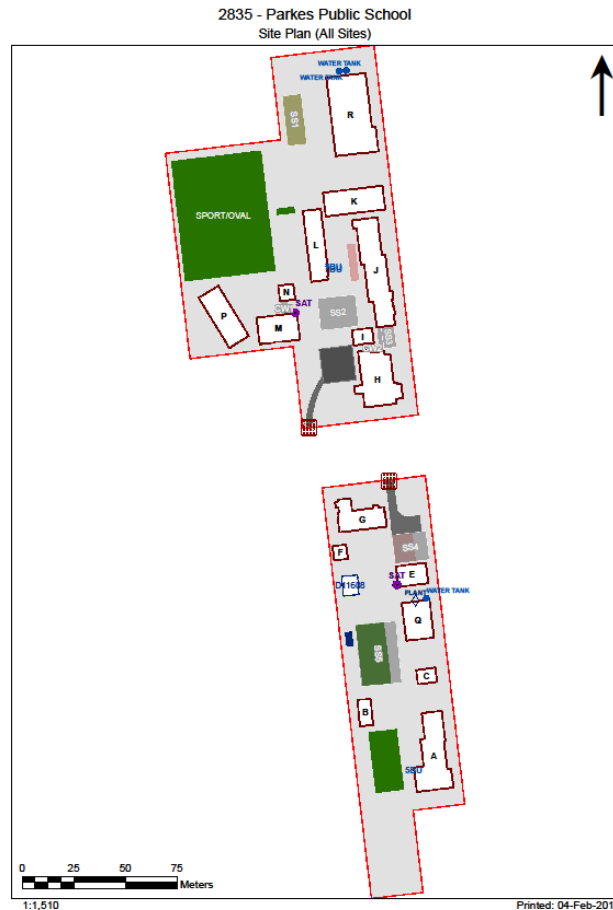

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Support Unit - 1918 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting 2835/B00A/Wall Cladding/S1					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00A - R0001 - Staff Room**

Wall Linings Internal	Flat AC Sheeting 2835/B00A/R0030/Wall Linings Internal/S30					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Toilet - P

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00A/R0030/Wall Linings Internal/S30					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - External Movement

No Asbestos

B00A - R0012 - Movement

No Asbestos

B00A - R0015 - Withdrawal Space - 1hb

No Asbestos

B00A - R0016 - Staff Room Annexe

No Asbestos

B00A - R0017 - Movement

No Asbestos

B00A - R0018 - Cleaning Distributed Store

No Asbestos

B00A - R0019 - External Movement

No Asbestos

B00A - R0020 - External Stairs

No Asbestos

B00A - R0021 - Practical Activities

No Asbestos

B00A - R0022 - Home Base

No Asbestos

B00A - R0023 - Withdrawal Space - 2hb

No Asbestos

B00A - R0024 - Home Base Store

No Asbestos

B00A - R0025 - Home Base Store

No Asbestos

B00A - R0027 - Home Base

Wall Linings Internal	Flat AC Sheeting 2835/B00A/R0030/Wall Linings Internal/S30					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00A - R0028 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting		2835/B00A/R0030/Wall Linings Internal/S30			No Asbestos Detected
B00A - R0029 - Home Base						
No Asbestos						
B00A - R0030 - Practical Activities						
Wall Linings Internal	Flat AC Sheeting		2835/B00A/R0030/Wall Linings Internal/S30			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Raked ceiling
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground

Interior**B00B - R0001 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00B/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00B - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00B/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 2835/B00B/R0002/Wall Linings Internal/S4	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0003 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00B/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00B - R0004 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00B/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00B - R0005 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00B/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 2835/B00B/R0002/Wall Linings Internal/S4	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0006 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00B/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 2835/B00B/R0002/Wall Linings Internal/S4	15m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0007 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00B/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1913 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - External Movement

No Asbestos

B00C - R0002 - Craft Store

Wall Linings Internal	Flat AC Sheeting	10m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00C/R0002/Wall Linings Internal/S2					Chrysotile (white asbestos)	

B00C - R0003 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1913 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - No access to underfloor void. No key available to padlocked hatch

Interior

B00E - R0001 - Computer Resource

Wall Linings Internal	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00E/R0001/Wall Linings Internal/S31					Chrysotile (white asbestos)	

B00E - R0002 - Special Programs Room

No Asbestos

B00E - R0003 - Staff Room Annexe

No Asbestos

B00E - R0004 - General Storeroom

No Asbestos

B00E - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00F/R0005/Ceiling Structures/Linings/S32			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Flat Roof	Non Accessible Area - Flt ceiling					
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground					

Interior**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00F/R0005/Ceiling Structures/Linings/S32			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00F/R0005/Ceiling Structures/Linings/S32			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0003 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00F/R0005/Ceiling Structures/Linings/S32			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0004 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00F/R0005/Ceiling Structures/Linings/S32			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0005 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00F/R0005/Ceiling Structures/Linings/S32			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Administration/General Learning - 1935 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Heightrestricted 4.5m high					

Interior

B00G - R0001 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00G/R0006/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

B00G - R0002 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00G/R0006/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

B00G - R0003 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00G/R0006/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

B00G - R0004 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00G/R0006/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

B00G - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00G/R0006/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	0.2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00G/R0006/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

Window infill	Compressed AC Sheet 2835/B00G/R0005/Window infill/S28					No Asbestos Detected
---------------	--	--	--	--	--	-----------------------------

B00G - R0006 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00G/R0006/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

B00G - R0007 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00G/R0006/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

B00G - R0008 - General Storeroom

No Asbestos						
-------------	--	--	--	--	--	--

B00G - R1001 - External Movement

No Asbestos						
-------------	--	--	--	--	--	--

B00G - R1003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	1.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height restricted approx 4.5m high						

B00G - R1004 - Entry Vestibule

No Asbestos						
-------------	--	--	--	--	--	--

B00G - R1005 - Principal

No Asbestos						
-------------	--	--	--	--	--	--

B00G - R1006 - General Storeroom

No Asbestos						
-------------	--	--	--	--	--	--

B00G - R1010 - Home Base

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R1011 - Handwashing Facilities						
No Asbestos						
B00G - R1012 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting					
	2835/B00G/R1012/Ceiling Structures/Linings/S29					No Asbestos Detected
B00G - R1013 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting					
	2835/B00G/R1013/Wall Linings Internal/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	2835/B00G/R1012/Ceiling Structures/Linings/S29					No Asbestos Detected
B00G - R1014 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting					
	2835/B00G/R1013/Wall Linings Internal/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	2835/B00G/R1012/Ceiling Structures/Linings/S29					No Asbestos Detected
B00G - R1015 - Cleaning Distributed Store						
No Asbestos						
B00G - R1017 - External Movement						
No Asbestos						
B00G - R1018 - Home Base						
No Asbestos						
B00G - R1019 - Movement						
No Asbestos						
B00G - R1020 - Movement						
No Asbestos						
B00G - R1021 - Stairs						
No Asbestos						
B00G - R2001 - Movement						
No Asbestos						
B00G - R2002 - Home Base						
No Asbestos						
B00G - R2003 - Home Base						
No Asbestos						
B00G - R2004 - Home Base						
No Asbestos						
B00G - R2005 - Handwashing Facilities						
No Asbestos						
B00G - R2006 - Withdrawal Space - 1hb						
No Asbestos						
B00G - R2007 - Stairs						
Stair infill	Compressed AC Sheet	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Unable to sample without destructive

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Support Unit - 1935 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting 2835/B00H/Wall Cladding/S8	80m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids - Packing to Floor Joists	Packing 2835/B00H/Underfloor Voids - Packing to Floor Joists/S22	0.2m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	Flat AC Sheeting 2835/B00H/Underfloor Voids/S23				No Asbestos Detected	
Ceiling Voids	AC Fragments/Debris 2835/B00H/Ceiling Voids/S25	1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting 2835/B00H/Gable Verge Lining/S26	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

Interior**B00H - R0001 - Home Base**

No Asbestos

B00H - R0002 - Home Base - S

No Asbestos

B00H - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00H/Wall Cladding/S8	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00H - R0004 - Movement

No Asbestos

B00H - R0005 - Cleaning Distributed Store

No Asbestos

B00H - R0006 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 2835/B00H/R0015/Wall Linings Internal/S24				No Asbestos Detected	
-----------------------	---	--	--	--	-----------------------------	--

B00H - R0007 - Staff Room Annexe

No Asbestos

B00H - R0008 - Toilet - P

Wall Linings Internal	Flat AC Sheeting 2835/B00H/R0015/Wall Linings Internal/S24				No Asbestos Detected	
-----------------------	---	--	--	--	-----------------------------	--

B00H - R0009 - Home Base

No Asbestos

B00H - R0010 - General Storeroom

No Asbestos

B00H - R0011 - General Storeroom

No Asbestos

B00H - R0012 - Movement

No Asbestos

B00H - R0013 - Practical Activities - S - 1hb

No Asbestos

B00H - R0014 - Laundry - S

Wall Linings Internal	Flat AC Sheeting 2835/B00H/R0015/Wall Linings Internal/S24				No Asbestos Detected	
-----------------------	---	--	--	--	-----------------------------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0015 - Toilet - S						
Wall Linings Internal	Flat AC Sheeting					
	2835/B00H/R0015/Wall Linings Internal/S24					No Asbestos Detected
B00H - R0016 - Toilet - S						
Wall Linings Internal	Flat AC Sheeting					
	2835/B00H/R0015/Wall Linings Internal/S24					No Asbestos Detected
B00H - R0017 - Practical Activities - S - 1hb						
Wall Linings Internal	Flat AC Sheeting					
	2835/B00H/R0015/Wall Linings Internal/S24					No Asbestos Detected
B00H - R0018 - Plant						
No Asbestos						
B00H - R0019 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00H - R0020 - Movement						
No Asbestos						
B00H - R0021 - Movement						
No Asbestos						
B00H - R0022 - Sports Store						
No Asbestos						
B00H - R0023 - General Storeroom						
No Asbestos						
B00H - R0024 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00H/Wall Cladding/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Shed - 1995 - Brick/Steel Frame (Brick/Steel Frame)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B001 - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 2835/B00J/Eaves Linings/S21	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 2835/B00J/Gable Verge Lining/S20					No Asbestos Detected
Underfloor Voids	Non Accessible Area - Access point blocked by pavers and fixed panel.					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Raked ceiling.					

Interior**B00J - R0001 - Home Base**

No Asbestos

B00J - R0002 - Home Base Store

No Asbestos

B00J - R0003 - Personal Effects Storage

No Asbestos

B00J - R0004 - Home Base Store

No Asbestos

B00J - R0005 - Home Base

No Asbestos

B00J - R0006 - Home Base

No Asbestos

B00J - R0007 - Home Base Store

No Asbestos

B00J - R0008 - Personal Effects Storage

No Asbestos

B00J - R0009 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
2835/B00J/R0025/Ceiling Structures/Linings/S9						

B00J - R0010 - Home Base Store

No Asbestos

B00J - R0011 - Home Base

No Asbestos

B00J - R0012 - Withdrawal Space - 1hb

No Asbestos

B00J - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
2835/B00J/R0025/Ceiling Structures/Linings/S9						

B00J - R0014 - Staff Toilet

No Asbestos

B00J - R0015 - General Storeroom

No Asbestos

B00J - R0016 - Main Switch Board

Electrical Backing Board	Resinous Board	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
2835/B00J/R0024/Electrical Mounting Board/S19						

B00J - R0017 - Staff Room Annexe

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R0018 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00J/R0025/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00J - R0019 - Clerical Office/Workroom						
No Asbestos						
B00J - R0020 - Movement						
No Asbestos						
B00J - R0021 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00J/R0021/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
B00J - R0022 - Cleaning Distributed Store						
No Asbestos						
B00J - R0024 - Distribution Board						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00J/R0024/Wall Linings Internal/S18					Chrysotile (white asbestos)	
Electrical Mounting Board	Resinous Board	0.2m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00J/R0024/Electrical Mounting Board/S19					Chrysotile (white asbestos)	
B00J - R0025 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	146m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2835/B00J/R0025/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1969 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00K/Eaves Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00K/Gable Verge Lining/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Raked ceiling					
Underfloor Voids - Slab on Ground	Non Accessible Area - Concrete slab on ground construction.					

Interior

B00K - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2835/B00J/R0025/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00K - R0002 - Toilets - Boys/Girls

No Asbestos

B00K - R0003 - Home Base Store - P

No Asbestos

B00K - R0004 - Home Base - P

No Asbestos

B00K - R0005 - Personal Effects - P

No Asbestos

B00K - R0006 - Home Base - P

No Asbestos

B00K - R0007 - Personal Effects - P

No Asbestos

B00K - R0008 - Home Base Store - P

No Asbestos

B00K - R0009 - Toilets - Boys/Girls

No Asbestos

B00K - R0010 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Communal Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 2835/B00L/Eaves Linings/S15	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 2835/B00L/Gable Verge Lining/S14	20m2	North, South	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Cladding	Flat AC Sheeting 2835/B00L/Wall Cladding/S13					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area - Raked ceiling					
Underfloor Voids	No Asbestos Found					

Interior**B00L - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00J/R0025/Ceiling Structures/Linings/S9	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00L - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00L/R0003/Ceiling Structures/Linings/S11	NA	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 2835/B00L/R0003/Partition Walls (Cubicles)/S12	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00L - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00J/R0025/Ceiling Structures/Linings/S9	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00L - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00L/R0003/Ceiling Structures/Linings/S11	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 2835/B00L/R0003/Partition Walls (Cubicles)/S12	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00L - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00J/R0025/Ceiling Structures/Linings/S9	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00L - R0008 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00J/R0025/Ceiling Structures/Linings/S9	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00L - R0009 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00J/R0025/Ceiling Structures/Linings/S9	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00L - R0010 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00J/R0025/Ceiling Structures/Linings/S9	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00L - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2835/B00J/R0025/Ceiling Structures/Linings/S9	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - R0012 - Practical Activities

No Asbestos

B00L - R0013 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Library - 1995 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Concrete slab on ground construction.

Interior

B00M - R0001 - Distribution Board Note: No inspection of live electrical installation.

No Asbestos

B00M - R0002 - Communications Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0003 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0004 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Tiered Learning - 1995 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Concrete slab on ground construction.

Interior

B00N - R0001 - Plant

No Asbestos

B00N - R0002 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0003 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0004 - Cleaning Distributed Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Administration - 1995 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Concrete slab on ground construction.

Interior

B00P - R0001 - Clerical Office

No Asbestos

B00P - R0002 - Sick Bay

No Asbestos

B00P - R0003 - Staff Toilet

No Asbestos

B00P - R0004 - Staff Room Annexe

No Asbestos

B00P - R0005 - Deputy Principal

No Asbestos

B00P - R0006 - Deputy Principal

No Asbestos

B00P - R0007 - Staff Room

No Asbestos

B00P - R0008 - Main Switch Board

No Asbestos

B00P - R0009 - Cleaning Distributed Store

No Asbestos

B00P - R0010 - Staff Toilet

No Asbestos

B00P - R0011 - Staff Toilet

No Asbestos

B00P - R0012 - Staff Toilet

No Asbestos

B00P - R0013 - Security Store

No Asbestos

B00P - R0014 - Principal

No Asbestos

B00P - R0015 - Duplicating Workroom

No Asbestos

B00P - R0016 - Movement

No Asbestos

B00P - R0017 - External Movement

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Movement No Asbestos Found

Interior

B00Q - R0001 - Home Base

No Asbestos

B00Q - R0002 - Home Base

No Asbestos

B00Q - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00Q - R0004 - Home Base Store

No Asbestos

B00Q - R0005 - Practical Activities

No Asbestos

B00Q - R0006 - Withdrawal Space - 2hb

No Asbestos

B00Q - R0007 - Practical Activities

No Asbestos

B00Q - R0008 - Home Base Store

No Asbestos

B00Q - R0009 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00R - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Concrete slab on ground construction.
Ceiling Voids - Raked Ceiling	Non Accessible Area - Raked ceiling.

Interior**B00R - R0001 - Communal Space**

No Asbestos

B00R - R0002 - Raised Platform

No Asbestos

B00R - R0003 - Cleaning Distributed Store

No Asbestos

B00R - R0004 - No Access

No Asbestos

B00R - R0005 - Other-Vacant

No Asbestos

B00R - R0006 - Hall Chair Store

No Asbestos

B00R - R0007 - Other-Vacant

No Asbestos

B00R - R0008 - Toilet - Lobby

No Asbestos

B00R - R0009 - Sound Cupboard

No Asbestos

B00R - R0010 - Toilet - Lobby

No Asbestos

B00R - R0011 - Access Shower/Toilet/Change

No Asbestos

B00R - R0012 - Toilets - Boys

No Asbestos

B00R - R0013 - Toilets - Girls

No Asbestos

B00R - R0014 - Movement

No Asbestos

B00R - R0015 - Covered Outdoor Learning Area

No Asbestos

B00R - R0016 - Canteen Office/Store

No Asbestos

B00R - R0017 - Movement

No Asbestos

B00R - R0018 - Canteen Office/Store

No Asbestos

B00R - R0019 - Canteen

No Asbestos

B00R - R0020 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11608 - Learning Unit - Standard With P.A.A. : Placement Date - 2/06/2010

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos		70 m2
---------	---------------	------------------	--	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		3 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2835_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017