


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Para Meadows School (5644)  
**Region :** Illawarra and South East  
**State Electorate :** Wollongong  
**Local Government Area :** Wollongong

**Initial Survey :** Noel Arnold & Associates : 22 - Apr - 2008  
**Reviewed By :** AECOM : 18 - Jun - 2015

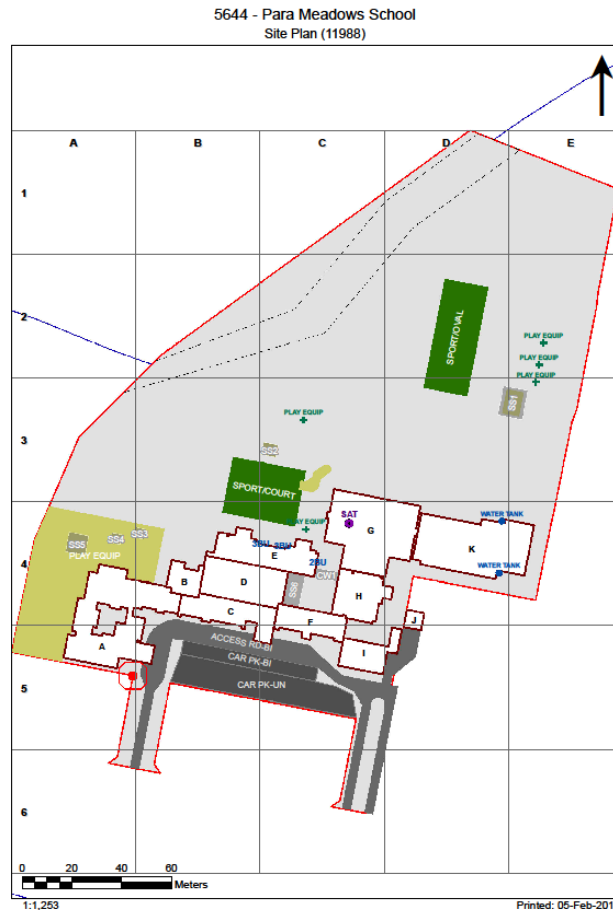

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Support Unit - 1982 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00A/Eaves Linings/S1					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00A/Eaves Linings/S1					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					

**Interior****B00A - R0001 - Entry Vestibule**

No Asbestos

**B00A - R0002 - Wheelchair Store**

No Asbestos

**B00A - R0003 - Distribution Board**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00A/R0003/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0004 - General Storeroom**

No Asbestos

**B00A - R0005 - Clerical Office**

No Asbestos

**B00A - R0006 - Toilet - S**

No Asbestos

**B00A - R0007 - Cleaning Distributed Store**

No Asbestos

**B00A - R0008 - Therapy**

No Asbestos

**B00A - R0009 - Home Base - E**

No Asbestos

**B00A - R0010 - Home Base - E**

No Asbestos

**B00A - R0011 - Home Base - E**

No Asbestos

**B00A - R0012 - Practical Activities - 1hb**

No Asbestos

**B00A - R0014 - Practical Activities - 1hb**

No Asbestos

**B00A - R0017 - Home Base - E**

No Asbestos

**B00A - R0018 - Home Base - E**

No Asbestos

**B00A - R0019 - Home Base - E**

No Asbestos

**B00A - R0020 - Staff Room**

No Asbestos

**B00A - R0021 - Staff Room Annexe**

No Asbestos

**B00A - R0022 - Practical Activities - 1hb**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0023 - Hydrotherapy - Pool</b>						
No Asbestos						
<b>B00A - R0025 - Interview</b>						
No Asbestos						
<b>B00A - R0026 - Staff Toilet</b>						
No Asbestos						
<b>B00A - R0027 - Distribution Board</b>						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00A/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
<b>B00A - R0028 - Therapy Store</b>						
No Asbestos						
<b>B00A - R0029 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00A/R0029/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
<b>B00A - R0030 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00A/R0029/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
<b>B00A - R0031 - Covered Vehicle Area/Porte Cochere</b>						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00A/R0029/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
<b>B00A - R0032 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00A/R0029/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
<b>B00A - R0033 - Movement</b>						
No Asbestos						
<b>B00A - R0034 - General Storeroom</b>						
No Asbestos						
<b>B00A - R0035 - Access Shower/Toilet/Change</b>						
No Asbestos						
<b>B00A - R0036 - Movement</b>						
No Asbestos						
<b>B00A - R0037 - Laundry - S</b>						
No Asbestos						
<b>B00A - R0038 - Plant</b>						
No Asbestos						
<b>B00A - R0039 - Access Shower/Toilet/Change</b>						
No Asbestos						
<b>B00A - R0040 - Toilets - Girls</b>						
No Asbestos						
<b>B00A - R0041 - Toilets - Boys</b>						
No Asbestos						
<b>B00A - R0042 - Movement</b>						
No Asbestos						
<b>B00A - R0043 - Staff Kitchen</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Staff Facilities - 1975 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

**Interior****B00B - R0001 - Staff Room Annexe**

No Asbestos

**B00B - R0002 - Staff Room**

No Asbestos

**B00B - R0004 - Plant**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00B/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	

**B00B - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00B/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	

**B00B - R0006 - Covered Outdoor Learning Area - S**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00B/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Support Unit/Pupil Facilities - 1975 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00A/Eaves Linings/S1					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/Gable Verge Lining/S20					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					

**Interior****B00C - R0001 - Toilet - M**

No Asbestos

**B00C - R0002 - Shower/Change**

No Asbestos

**B00C - R0003 - General Storeroom**

No Asbestos

**B00C - R0004 - Food Technology L.S.**

No Asbestos

**B00C - R0005 - Staff Room Annexe**

No Asbestos

**B00C - R0006 - Laundry - S**

No Asbestos

**B00C - R0007 - Pantry**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/R0007/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B00C - R0008 - Home Base - M**

No Asbestos

**B00C - R0009 - Home Base - S**

No Asbestos

**B00C - R0010 - Home Base Store - S**

No Asbestos

**B00C - R0011 - Practical Activities - S - 1hb**

No Asbestos

**B00C - R0012 - Canteen**

No Asbestos

**B00C - R0015 - Canteen Office/Store**

No Asbestos

**B00C - R0016 - Covered Vehicle Area/Porte Cochere**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/R0018/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00C - R0017 - Movement**

No Asbestos

**B00C - R0018 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/R0018/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00C - R0019 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0020 - Canteen Office/Store</b>						
No Asbestos						
<b>B00C - R0021 - Movement</b>						
No Asbestos						
<b>B00C - R0022 - Toilets-Unisex</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00D - Communal Facilities/Special Purpose - 1975 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling

Non Accessible Area  
- Area inaccessible

Underfloor Voids - Slab on Ground

No Asbestos Found

**Interior****B00D - R0001 - Main Switch Board**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0002 - Shower/Change**

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0003 - Communal/Performance Store**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0004 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0006 - General Storeroom**

No Asbestos

**B00D - R0010 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0011 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0012 - Disabled Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0013 - Disabled Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0014 - General Storeroom**

Ceiling Space Access Panel	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

5644/B00D/R0002/Ceiling Structures/Linings/S9

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00D - R0015 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00D/R0018/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
<b>B00D - R0016 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00D/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00D - R0017 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00D/R0018/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
<b>B00D - R0018 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00D/R0018/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
<b>B00D - R0019 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00D/R0018/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
<b>B00D - R0020 - Hydrotherapy - Pool</b>						
No Asbestos						
<b>B00D - R0021 - Sound Cupboard</b>						
No Asbestos						
<b>B00D - R0022 - Raised Platform</b>						
No Asbestos						
<b>B00D - R0023 - Communal Space</b>						
No Asbestos						
<b>B00D - R0024 - Movement</b>						
No Asbestos						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Support Unit - 1975 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling  
Non Accessible Area  
- Area inaccessible

Underfloor Voids - Slab on Ground  
No Asbestos Found

**Interior****B00E - R0001 - Home Base - S**

In-fill-panel  
Flat AC Sheeting  
5644/B00E/R0001/In-fill-panel/S11  
**No Asbestos Detected**

**B00E - R0002 - Home Base - S**

Floor Coverings Res/Textile  
Vinyl Tiles  
10m2  
Throughout  
Good Condition (1)  
Low (1) Low Priority (2-3)  
5644/B00C/R0007/Floor Coverings Res/Textile/S6  
**Chrysotile (white asbestos)**

**B00E - R0005 - P.E. Store**

Ceiling Structures/Linings  
Flat AC Sheeting  
27m2  
Throughout  
Good Condition (1)  
Low (1) Low Priority (2-3)  
5644/B00E/R0005/Ceiling Structures/Linings/S12  
**Chrysotile (white asbestos)**

**B00E - R0007 - Home Base - S**

In-fill-panel  
Flat AC Sheeting  
5644/B00E/R0001/In-fill-panel/S11  
**No Asbestos Detected**

**B00E - R0008 - Home Base - S**

In-fill-panel  
Flat AC Sheeting  
5644/B00E/R0001/In-fill-panel/S11  
**No Asbestos Detected**

**B00E - R0009 - Hall Chair Store**

No Asbestos

**B00E - R0010 - Movement**

Ceiling Structures/Linings  
Flat AC Sheeting  
6m2  
Throughout  
Good Condition (1)  
Low (1) Low Priority (2-3)  
5644/B00E/R0012/Ceiling Structures/Linings/S10  
**Chrysotile (white asbestos)**

**B00E - R0011 - Movement**

Ceiling Structures/Linings  
Flat AC Sheeting  
6m2  
Throughout  
Good Condition (1)  
Low (1) Low Priority (2-3)  
5644/B00E/R0012/Ceiling Structures/Linings/S10  
**Chrysotile (white asbestos)**

**B00E - R0012 - Movement**

Ceiling Structures/Linings  
Flat AC Sheeting  
18m2  
Throughout  
Good Condition (1)  
Low (1) Low Priority (2-3)  
5644/B00E/R0012/Ceiling Structures/Linings/S10  
**Chrysotile (white asbestos)**

In-fill-panel  
Flat AC Sheeting  
5644/B00E/R0001/In-fill-panel/S11  
**No Asbestos Detected**

**B00E - R0014 - Movement**

No Asbestos

**B00E - R0015 - Movement**

No Asbestos

**B00E - R0017 - Movement**

Ceiling Structures/Linings  
Flat AC Sheeting  
12m2  
Throughout  
Good Condition (1)  
Low (1) Low Priority (2-3)  
5644/B00E/R0012/Ceiling Structures/Linings/S10  
**Chrysotile (white asbestos)**

**B00E - R0019 - Toilets - Girls**

No Asbestos

**B00E - R0020 - Toilets - Boys**

No Asbestos

**B00E - R0021 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Administration - 1975 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0023/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	40m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0023/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00F - R0001 - Special Programs Room**

In-fill-panel	Flat AC Sheeting					
	5644/B00F/R0001/In-fill-panel/S13				<b>No Asbestos Detected</b>	

**B00F - R0002 - Computer Resource**

No Asbestos

**B00F - R0003 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00F/R0003/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	

**B00F - R0004 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00F/R0004/Ceiling Structures/Linings/S14				<b>Chrysotile (white asbestos)</b>	

**B00F - R0005 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00F/R0004/Ceiling Structures/Linings/S14				<b>Chrysotile (white asbestos)</b>	

**B00F - R0006 - Deputy Principal**

No Asbestos

**B00F - R0007 - Principal**

No Asbestos

**B00F - R0008 - Entry Vestibule**

No Asbestos

**B00F - R0009 - Clerical Office**

No Asbestos

**B00F - R0010 - Duplicating Workroom**

No Asbestos

**B00F - R0011 - General Storeroom**

No Asbestos

**B00F - R0012 - Clerical Office/Workroom**

No Asbestos

**B00F - R0013 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00F/R0004/Ceiling Structures/Linings/S14				<b>Chrysotile (white asbestos)</b>	

**B00F - R0014 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0015 - Movement**

No Asbestos

**B00F - R0016 - Interview**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00F - R0017 - Sick Bay**

No Asbestos

**B00F - R0018 - Toilets - Boys/Girls**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

5644/B00F/R0004/Ceiling Structures/Linings/S14

**Chrysotile (white asbestos)**

**B00F - R0020 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

5644/B00D/R0018/Ceiling Structures/Linings/S8

**Chrysotile (white asbestos)**

**B00F - R0021 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

5644/B00D/R0018/Ceiling Structures/Linings/S8

**Chrysotile (white asbestos)**

**B00F - R0022 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

5644/B00D/R0018/Ceiling Structures/Linings/S8

**Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Library/Support Unit - 1985 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0023/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00G - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0003/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>

**B00G - R0002 - K.L.A. Store**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00A/R0003/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00G - R0003 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0003/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>

**B00G - R0006 - Home Base - S**

No Asbestos

**B00G - R0007 - Practical Activities - S - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/R0007/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B00G - R0008 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0023/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>

**B00G - R0009 - Home Base - M**

No Asbestos

**B00G - R0010 - Practical Activities - M - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/R0007/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B00G - R0011 - Staff Room**

No Asbestos

**B00G - R0012 - Distribution Board**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0012/Ceiling Structures/Linings/S19					<b>Chrysotile (white asbestos)</b>

**B00G - R0013 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0003/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>

**B00G - R0014 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0003/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>

**B00G - R0015 - Garden Store**

No Asbestos

**B00G - R0016 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00G/R0023/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
<b>B00G - R0017 - K.L.A. Store</b>						
No Asbestos						
<b>B00G - R0018 - Reading Area</b>						
No Asbestos						
<b>B00G - R0019 - K.L.A. Store</b>						
No Asbestos						
<b>B00G - R0020 - Library Office/Workroom</b>						
No Asbestos						
<b>B00G - R0021 - K.L.A. Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00C/R0007/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
<b>B00G - R0022 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00G/R0023/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
<b>B00G - R0024 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00G/R0023/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
<b>B00G - R0025 - Movement</b>						
No Asbestos						
<b>B00G - R0026 - Covered Outdoor Learning Area</b>						
No Asbestos						
<b>B00G - R0027 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00G/R0023/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
<b>B00G - R0029 - Disabled Toilet</b>						
No Asbestos						
<b>B00G - R0030 - Disabled Shower/Toilet</b>						
No Asbestos						
<b>B00G - R0031 - Laundry - P</b>						
No Asbestos						
<b>B00G - R0032 - Movement</b>						
No Asbestos						
<b>B00G - R0033 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
5644/B00G/R0023/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
<b>B00G - R0034 - Movement</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Support Unit - 1975 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00G/R0023/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00H - R0001 - Toilet - M**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00H/R0009/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>

**B00H - R0002 - Cleaning Distributed Store**

No Asbestos

**B00H - R0003 - Home Base - M**

No Asbestos

**B00H - R0004 - Home Base - M**

Floor Coverings Res/Textile	Vinyl Tiles	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/R0007/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B00H - R0005 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00H/R0009/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/R0007/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B00H - R0006 - Home Base - M**

No Asbestos

**B00H - R0007 - Toilet - M**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00H/R0009/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>

**B00H - R0008 - Home Base - M**

No Asbestos

**B00H - R0009 - Toilet - M**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00H/R0009/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>

**B00H - R0010 - Distribution Board**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00H/R0009/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>

**B00H - R0011 - Garden Store**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00H/R0009/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>

**B00H - R0012 - Craft Store**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00H/R0009/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>

**B00H - R0013 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00D/R0018/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0014 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00D/R0018/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0015 - Movement</b>						
No Asbestos						
<b>B00H - R0016 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5644/B00D/R0018/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0017 - Movement</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Special Purpose - 1985 - Brick/Veneer (Brick/Veneer)****Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00C/Gable Verge Lining/S20					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00I - R0001 - General Assistant/Bulk Store**

No Asbestos

**B00I - R0003 - Distribution Board**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00D/R0018/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

**B00I - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00D/R0018/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

**B00I - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5644/B00D/R0018/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

**B00I - R0006 - Home Base - Bd/Cd/Ed**

No Asbestos

**B00I - R0007 - Special Programs Room**

No Asbestos

**B00I - R0008 - Garage/Carport**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Other-Community Use - 1990 - Brick/Block (Brick/Block)**

**Exterior**

No Asbestos

**Interior**

**B00J - R0001 - Other-Community Use**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00K - General Learning - 2014 - Brick/Veneer (Brick/Veneer)****Exterior**

No Asbestos

**Interior****B00K - R0001 - Practical Activities**

No Asbestos

**B00K - R0002 - Home Base**

No Asbestos

**B00K - R0003 - Kitchen - Pre**

No Asbestos

**B00K - R0004 - Other**

No Asbestos

**B00K - R0005 - Breakout Area**

No Asbestos

**B00K - R0006 - Toilets - Boys/Girls**

No Asbestos

**B00K - R0007 - Shower/Change**

No Asbestos

**B00K - R0008 - Breakout Area**

No Asbestos

**B00K - R0009 - Home Base**

No Asbestos

**B00K - R0010 - Other**

No Asbestos

**B00K - R0011 - Kitchen - Pre**

No Asbestos

**B00K - R0012 - Practical Activities**

No Asbestos

**B00K - R0013 - External Movement**

No Asbestos

**B00K - R0014 - Covered Outdoor Learning Area**

No Asbestos

**B00K - R0015 - Other**

No Asbestos

**B00K - R0016 - Other**

No Asbestos

**B00K - R0017 - Practical Activities**

No Asbestos

**B00K - R0018 - Home Base**

No Asbestos

**B00K - R0019 - Kitchen - Pre**

No Asbestos

**B00K - R0020 - Other**

No Asbestos

**B00K - R0021 - Breakout Area**

No Asbestos

**B00K - R0022 - Toilets - Boys/Girls**

No Asbestos

**B00K - R0023 - Shower/Change**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00K - R0024 - Breakout Area</b>						
No Asbestos						
<b>B00K - R0025 - Other</b>						
No Asbestos						
<b>B00K - R0026 - Home Base</b>						
No Asbestos						
<b>B00K - R0027 - Kitchen - Pre</b>						
No Asbestos						
<b>B00K - R0028 - Practical Activities</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017