


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Queanbeyan Public School (2922)
Region : Illawarra and South East
State Electorate : Monaro
Local Government Area : Queanbeyan

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : Parsons Brinckerhoff : 15 - Feb - 2017

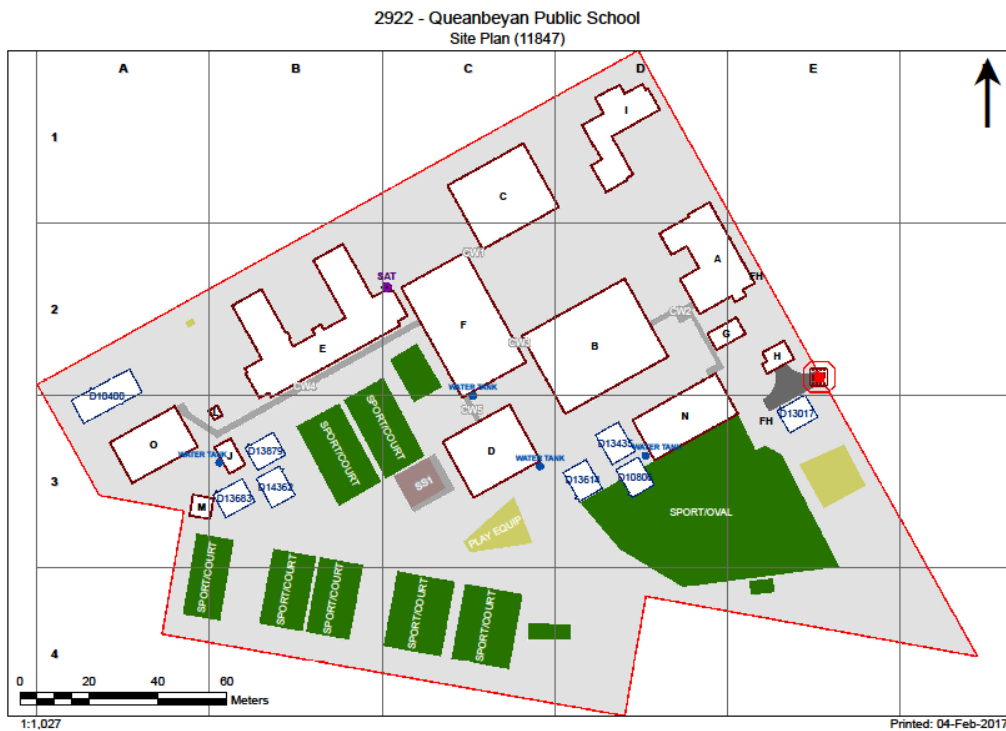

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1933 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Packing to Floor Joists
No Asbestos Found

Ceiling Voids - Raked Ceiling
No Asbestos Found

Interior**B00A - R0001 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

B00A - R0002 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00D/R0009/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		

B00A - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

B00A - R0004 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

B00A - R0005 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

B00A - R0006 - Staff Room Annexe

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

B00A - R0007 - Interview

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

B00A - R0008 - Music Store

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00D/R0009/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
2922/B00A/R0012/Ceiling Structures/Linings/S10						

B00A - R0010 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)		

B00A - R0011 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00D/R0009/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		

B00A - R0012 - Personal Effects Storage

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting 2922/B00A/R0012/Wall Linings Internal/S9					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2922/B00A/R0012/Ceiling Structures/Linings/S10					No Asbestos Detected
B00A - R0013 - Distribution Board					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting 2922/B00A/R0008/Ceiling Structures/Linings/S16	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0014 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting 2922/B00A/R0008/Ceiling Structures/Linings/S16	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0015 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles 2922/B00D/R0009/Floor Coverings Res/Textile/S6	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0016 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles 2922/B00D/R0009/Floor Coverings Res/Textile/S6	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0017 - Toilets - Girls						
No Asbestos						
B00A - R0018 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles 2922/B00D/R0009/Floor Coverings Res/Textile/S6	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0019 - Toilets - Boys						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Pupil Facilities - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids No Asbestos Found

Interior**B00B - R0001 - Toilets - Girls**

Ceiling Structures/Linings Flat AC Sheeting 53m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0004/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

Partition Walls (Cubicles) Compressed AC Sheet 14m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0013/Partition Walls (Cubicles)/S4 **Chrysotile (white asbestos)**

B00B - R0002 - Staff Toilet

Ceiling Structures/Linings Flat AC Sheeting 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0004/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

Partition Walls (Cubicles) Compressed AC Sheet 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0013/Partition Walls (Cubicles)/S4 **Chrysotile (white asbestos)**

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Flat AC Sheeting 1m2 Throughout Some Damage / Unsealed (3) Low (1) Low Priority (2-3)
2922/B00F/R0004/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

Electrical Backing Board Resinous Board 2m2 North Good Condition (1) Low (1) Low Priority (2-3)
Assumed Asbestos - Not able to be sampled live electrical

Wall Linings Internal Flat AC Sheeting 4m2 South Some Damage / Unsealed (3) Low (1) Low Priority (2-3)
2922/B00B/R0004/Wall Linings Internal/S7 **Chrysotile (white asbestos)**

B00B - R0005 - General Storeroom

Floor Coverings Res/Textile Vinyl Tiles 1m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0003/Floor Coverings Res/Textile/S3 **Chrysotile (white asbestos)**

B00B - R0006 - Home Base

Floor Coverings Res/Textile Vinyl Tiles 20m2 South, West Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0003/Floor Coverings Res/Textile/S3 **Chrysotile (white asbestos)**

B00B - R0008 - Personal Effects Storage

No Asbestos

B00B - R0010 - Home Base Store

Ceiling Structures/Linings Flat AC Sheeting 14m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0004/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

Floor Coverings Res/Textile Vinyl Tiles 14m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0003/Floor Coverings Res/Textile/S3 **Chrysotile (white asbestos)**

B00B - R0011 - Toilets - Boys/Girls

Partition Walls (Cubicles) Compressed AC Sheet 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
2922/B00F/R0013/Partition Walls (Cubicles)/S4 **Chrysotile (white asbestos)**

B00B - R0015 - Toilets - Boys/Girls

No Asbestos

B00B - R0016 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00B - R0017 - Personal Effects Storage						
No Asbestos						
B00B - R0018 - Personal Effects Storage						
No Asbestos						
B00B - R0019 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00B - R0020 - Home Base						
No Asbestos						
B00B - R0021 - Home Base						
No Asbestos						
B00B - R0022 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0013/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)
B00B - R0023 - Staff Toilet						
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - No access to internals of incinerator					
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0013/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)
B00B - R0024 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	188m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0015/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0025 - Practical Activities						
No Asbestos						
B00B - R0026 - Practical Activities						
No Asbestos						
B00B - R0027 - Practical Activities						
No Asbestos						
B00B - R0028 - Home Base						
No Asbestos						
B00B - R0029 - Home Base						
No Asbestos						
B00B - R0030 - Home Base						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Interior**B00C - R0004 - Sick Bay**

No Asbestos

B00C - R0011 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

2922/B00F/R0004/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00C - R0013 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

2922/B00F/R0004/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00C - R0017 - Staff Toilet

Wall Linings Internal Flat AC Sheeting
2922/B00C/R0033/Wall Linings Internal/S8

No Asbestos Detected

B00C - R0018 - Staff Toilet

Wall Linings Internal Flat AC Sheeting
2922/B00C/R0033/Wall Linings Internal/S8

No Asbestos Detected

B00C - R0019 - Principal

No Asbestos

B00C - R0020 - Deputy Principal

No Asbestos

B00C - R0021 - Entry Vestibule

No Asbestos

B00C - R0026 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	144m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-------	------------	--------------------	---------	--------------------

2922/B00F/R0015/Ceiling Structures/Linings/S5

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0027 - Handwashing Facilities

Wall Linings Internal Flat AC Sheeting
2922/B00C/R0033/Wall Linings Internal/S8

No Asbestos Detected

B00C - R0028 - Staff Toilet

Wall Linings Internal Flat AC Sheeting
2922/B00C/R0033/Wall Linings Internal/S8

No Asbestos Detected

B00C - R0030 - Clerical Office

No Asbestos

B00C - R0031 - Security Store

No Asbestos

B00C - R0032 - Movement

No Asbestos

B00C - R0033 - Disabled Toilet

Wall Linings Internal Flat AC Sheeting
2922/B00C/R0033/Wall Linings Internal/S8

No Asbestos Detected

B00C - R0034 - Deputy Principal

No Asbestos

B00C - R0035 - Staff Room

No Asbestos

B00C - R0036 - Staff Room

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00C - R0037 - Staff Kitchen

No Asbestos

B00C - R0038 - Security Store

No Asbestos

B00C - R0039 - Duplicating Workroom

No Asbestos

B00C - R0040 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 1977 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior**B00D - R0001 - K.L.A. Store**

No Asbestos

B00D - R0002 - Library Office/Workroom

No Asbestos

B00D - R0003 - Library Office/Workroom

No Asbestos

B00D - R0004 - Seminar/Study

No Asbestos

B00D - R0005 - Seminar/Study

No Asbestos

B00D - R0006 - Reading Area

No Asbestos

B00D - R0007 - Cleaning Distributed Store

No Asbestos

B00D - R0008 - Staff Toilet

No Asbestos

B00D - R0009 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00D/R0009/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00D - R0010 - Staff Toilet

No Asbestos

B00D - R0011 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	-------	--------------------	---------	--------------------

Assumed Asbestos - Not able to sampled as live electrical

B00D - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	124m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00F/R0015/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0013 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Support Unit - 1935 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00E - R0001 - Movement**

No Asbestos

B00E - R0002 - Withdrawal Space - 1hb

No Asbestos

B00E - R0003 - Movement

Wall Linings Internal	Flat AC Sheeting	2922/B00E/R0004/Wall Linings Internal/S14	No Asbestos Detected
-----------------------	------------------	---	-----------------------------

B00E - R0004 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	2922/B00E/R0004/Wall Linings Internal/S14	No Asbestos Detected
-----------------------	------------------	---	-----------------------------

Ceiling Structures/Linings	Flat AC Sheeting	2922/B00E/R0004/Ceiling Structures/Linings/S15	No Asbestos Detected
----------------------------	------------------	--	-----------------------------

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - Movement

No Asbestos

B00E - R0007 - Movement

No Asbestos

B00E - R0008 - Other - Regional Use

No Asbestos

B00E - R0009 - Other - Regional Use

No Asbestos

B00E - R0010 - Other - Regional Use

No Asbestos

B00E - R0011 - Other - Regional Use

No Asbestos

B00E - R0012 - Other - Regional Use

No Asbestos

B00E - R0013 - Other - Regional Use

No Asbestos

B00E - R0014 - Other - Regional Use

No Asbestos

B00E - R0015 - Movement

No Asbestos

B00E - R0016 - Other - Regional Use

No Asbestos

B00E - R0017 - Other - Regional Use

No Asbestos

B00E - R0018 - Home Base

No Asbestos

B00E - R0019 - Home Base

No Asbestos

B00E - R0020 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00E - R0021 - General Storeroom						
No Asbestos						
B00E - R0022 - Home Base						
No Asbestos						
B00E - R0023 - Home Base Store						
No Asbestos						
B00E - R0024 - Movement						
No Asbestos						
B00E - R0025 - Home Base						
No Asbestos						
B00E - R0026 - Home Base Store						
No Asbestos						
B00E - R0027 - Personal Effects Storage						
No Asbestos						
B00E - R0028 - Withdrawal Space - 1hb						
No Asbestos						
B00E - R0029 - Home Base						
No Asbestos						
B00E - R0030 - Home Base						
No Asbestos						
B00E - R0031 - Craft Store						
No Asbestos						
B00E - R0032 - Movement						
No Asbestos						
B00E - R0033 - Cleaning Distributed Store						
No Asbestos						
B00E - R0034 - Movement						
No Asbestos						
B00E - R0035 - Movement						
No Asbestos						
B00E - R0036 - Movement						
No Asbestos						
B00E - R1001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16						Chrysotile (white asbestos)
B00E - R1002 - General Storeroom						
No Asbestos						
B00E - R1003 - Home Base						
No Asbestos						
B00E - R1004 - Home Base						
No Asbestos						
B00E - R1005 - Withdrawal Space - 1hb						
No Asbestos						
B00E - R1006 - Home Base						
No Asbestos						
B00E - R1007 - Home Base						
No Asbestos						
B00E - R1008 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00A/R0008/Ceiling Structures/Linings/S16						Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1009 - Special Programs Room						
No Asbestos						
B00E - R1010 - Movement						
No Asbestos						
B00E - R1011 - Withdrawal - M						
No Asbestos						
B00E - R1012 - General Storeroom						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities/Pupil Facilities - 1971 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior**B00F - R0001 - Canteen**

Ceiling Structures/Linings Flat AC Sheeting 37m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0004/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

Floor Coverings Res/Textile Vinyl Tiles 37m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0003/Floor Coverings Res/Textile/S3

Chrysotile (white asbestos)

B00F - R0003 - Movement

Floor Coverings Res/Textile Vinyl Tiles 3m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0003/Floor Coverings Res/Textile/S3

Chrysotile (white asbestos)

Ceiling Structures/Linings Flat AC Sheeting 3m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0004/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00F - R0004 - Staff Toilet

Ceiling Structures/Linings Flat AC Sheeting 3m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0004/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

Incinerator Encapsulated Insulation material within unit 1Unit(s) West Friable Asbestos (5) Low (1) Low Priority (2-3)

Assumed Asbestos - Not sampled as no acces to internals

B00F - R0005 - Main Switch Board

Ceiling Structures/Linings Flat AC Sheeting 10m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0004/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

Electrical Backing Board Resinous Board 2m2 East Good Condition (1) Low (1) Low Priority (2-3)

Assumed Asbestos - Not sampled due to live electrical

B00F - R0007 - Sports Store

Ceiling Structures/Linings Flat AC Sheeting 14m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0004/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00F - R0008 - Uniform Shop

Non Accessible

B00F - R0009 - Movement

No Asbestos

B00F - R0010 - Raised Platform

No Asbestos

B00F - R0012 - Toilets - Boys

Partition Walls (Cubicles) Compressed AC Sheet 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0013/Partition Walls (Cubicles)/S4

Chrysotile (white asbestos)

Ceiling Structures/Linings Flat AC Sheeting 12m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2922/B00F/R0004/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00F - R0013 - Toilets - Girls

Incinerator Encapsulated Insulation material within unit 1Unit(s) South Friable Asbestos (5) Low (1) Low Priority (2-3)

Assumed Asbestos - Not due to no access to internals of

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00F/R0013/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00F/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00F - R0014 - Communal Space						
No Asbestos						
B00F - R0015 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	206m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00F/R0015/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00F - R0017 - Sound Cupboard						
No Asbestos						
B00F - R0018 - Hall Chair Store						
No Asbestos						
B00F - R0019 - Hall Chair Store						
No Asbestos						
B00F - R0020 - Chair Storeroom						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00J/Eaves Linings/S1				Chrysotile (white asbestos)	

Interior

B00G - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00F/R0013/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 1964 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00H - R0001 - General Assistant/Bulk Store

No Asbestos

B00H - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Other-Regional Use - 1877 - Sandstone (Sandstone)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Interior**B00I - R0001 - Other - Regional Use**

No Asbestos

B00I - R0002 - Other - Regional Use

Wall Linings Internal	Flat AC Sheeting	8m2	Switchboard Cupboard	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00I/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Switchboard Cupboard	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2922/B00I/R0009/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00I - R0003 - Other - Regional Use

No Asbestos

B00I - R0004 - Other - Regional Use

No Asbestos

B00I - R0005 - Other - Regional Use

No Asbestos

B00I - R0006 - Other - Regional Use

No Asbestos

B00I - R0007 - Other - Regional Use

No Asbestos

B00I - R0008 - Other - Regional Use

No Asbestos

B00I - R0009 - Other - Regional Use

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00I/R0009/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00I - R0010 - Other - Regional Use

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2922/B00I/R0009/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00I - R0011 - Other - Regional Use

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
2922/B00I/R0011/Wall Linings Internal/S11						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1973 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	14m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2922/B00J/Eaves Linings/S1				Chrysotile (white asbestos)	

Interior

B00J - R0001 - Toilets - Boys

No Asbestos

B00J - R0002 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Shed - 1933 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00L - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Shed - 2004 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00M - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - External Movement

No Asbestos

B00N - R0002 - Practical Activities

No Asbestos

B00N - R0003 - Home Base Store

No Asbestos

B00N - R0004 - Home Base

No Asbestos

B00N - R0005 - Withdrawal - M

No Asbestos

B00N - R0006 - Home Base

No Asbestos

B00N - R0007 - Home Base Store

No Asbestos

B00N - R0008 - Practical Activities

No Asbestos

B00N - R0009 - Practical Activities

No Asbestos

B00N - R0010 - Special Programs Room

No Asbestos

B00N - R0011 - Home Base Store

No Asbestos

B00N - R0012 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B000 - R0001 - External Movement

No Asbestos

B000 - R0002 - Practical Activities

No Asbestos

B000 - R0003 - Home Base Store

No Asbestos

B000 - R0004 - Home Base

No Asbestos

B000 - R0005 - Personal Effects - E

No Asbestos

B000 - R0006 - Home Base

No Asbestos

B000 - R0007 - Home Base Store

No Asbestos

B000 - R0008 - Practical Activities

No Asbestos

B000 - R0009 - Plant

No Asbestos

B000 - R0010 - Toilet - E

No Asbestos

B000 - R0011 - Toilet - E

No Asbestos

B000 - R0012 - Laundry - P

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 534 - D10400 - Library/Group Study/Office/A V Store : Placement Date - 4/11/2004

Exterior

Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos		36 m2
---------	---------------	------------------	--	-------

R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

R4 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R5 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

R6 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

R7 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos		54 m2
---------	---------------	------------------	--	-------

R8 - Entry

Ceiling	Flat AC Sheet	Assumed Asbestos		14 m2
---------	---------------	------------------	--	-------

OS 602 - D10806 - Learning Unit - Standard With P.A.A. : Placement Date - 22/10/2014

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos		70 m2
---------	---------------	------------------	--	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		3 m2

OS 602 - D13017 - Learning Unit - Standard With P.A.A. : Placement Date - 6/01/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D13435 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D13614 - Learning Unit - Standard/Withdrawal : Placement Date - 22/01/2007						
Exterior						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D13683 - Learning Unit - Standard/Withdrawal : Placement Date - 13/06/1996						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

OS 601 - D13879 - Learning Unit - Standard/Withdrawal : Placement Date - 29/01/2016

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 601 - D14362 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 971 - D18087 - Shed - Container (Garden/Sports/Bulk) : Placement Date - 25/09/2003

Exterior

No Asbestos Found.

Interior

R1 - Garden Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017