


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ulladulla Public School (3302)
Region : Illawarra and South East
State Electorate : South Coast
Local Government Area : Shoalhaven

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : AECOM : 18 - Jun - 2015

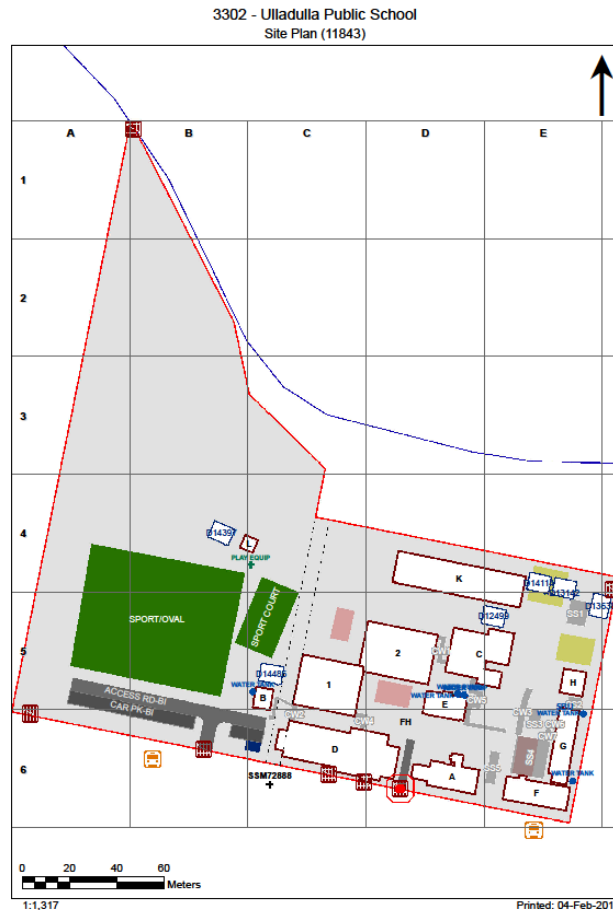

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B001 - General Learning/Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0015/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior**B001 - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3302/B00A/R0015/Wall Linings Internal/S3					
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00E/R0002/Partition Walls (Cubicles)/S10				Chrysotile (white asbestos)	

B001 - R0002 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0015/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B001 - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B001 - R0004 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0015/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B001 - R0005 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0015/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	2m	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B001 - R0006 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0015/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	2m	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B001 - R0007 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0015/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B001 - R0009 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0015/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B001 - R0010 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0015/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	2m	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B001 - R0011 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3302/B001/R0015/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3302/B001/R0010/In-fill-panel/S2					Chrysotile (white asbestos)	
B001 - R0012 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3302/B001/R0015/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B001 - R0013 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
3302/B00A/R0015/Wall Linings Internal/S3						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3302/B00E/R0002/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	
B001 - R0015 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	120m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
3302/B001/R0015/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B002 - General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B002 - R0001 - Practical Activities - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B002 - R0002 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

In-fill-panel	Flat AC Sheeting	2m	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B002 - R0003 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

In-fill-panel	Flat AC Sheeting	2m	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B002 - R0004 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B002 - R0005 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

In-fill-panel	Flat AC Sheeting	2m	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B002 - R0006 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B002 - R0008 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B002 - R0009 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	2m	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2			Chrysotile (white asbestos)		
B002 - R0010 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B002 - R0011 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	2m	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2			Chrysotile (white asbestos)		
B002 - R0012 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2			Chrysotile (white asbestos)		
B002 - R0013 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B002 - R0014 - Withdrawal Space - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B002 - R0015 - Distribution Board						
				Note: No inspection of live electrical installation.		
No Asbestos						
B002 - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B002 - R0017 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	60m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B002/R0017/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1880 - Sandstone (Sandstone)

Exterior

Eaves Linings	Flat AC Sheeting 3302/B00A/Eaves Linings/S15	10m2	East, Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Window In-fill-panel	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Duplicating Workroom

No Asbestos

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Deputy Principal

No Asbestos

B00A - R0006 - Principal

No Asbestos

B00A - R0008 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected

B00A - R0010 - Movement

No Asbestos

B00A - R0014 - Sick Bay - Shower/Toilet

Wall Linings Internal	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected

B00A - R0015 - Sick Bay

Wall Linings Internal	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected

B00A - R0017 - Deputy Principal

Ceiling Structures/Linings	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00A - R0018 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected

B00A - R0019 - Movement

Wall Linings Internal	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3302/B00A/R0015/Wall Linings Internal/S3					No Asbestos Detected

B00A - R0020 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting		3302/B00A/R0015/Wall Linings Internal/S3			No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting		3302/B00A/R0015/Wall Linings Internal/S3			No Asbestos Detected

B00A - R0021 - Movement

No Asbestos

B00A - R0022 - Clerical Office/Workroom

No Asbestos

B00A - R0023 - Entry Vestibule

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1964 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3302/B00B/R0002/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Withdrawal Space - 1hb**

No Asbestos

B00B - R0002 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00B/R0002/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00B/R0002/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - Staff Room Annexe

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00B/R0002/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0004 - Staff Room Annexe

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00B/R0002/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00B/R0002/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library/Staff Facilities - 1998 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - R0001 - Reading Area**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0002 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0003 - Communications Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0004 - External Movement

No Asbestos

B00C - R0005 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0006 - General Storeroom

No Asbestos

B00C - R0007 - Cleaning Distributed Store

No Asbestos

B00C - R0008 - Disabled Toilet

No Asbestos

B00C - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0010 - General Storeroom

No Asbestos

B00C - R0011 - General Storeroom

No Asbestos

B00C - R0012 - General Storeroom

No Asbestos

B00C - R0013 - External Movement

No Asbestos

B00C - R0014 - External Movement

No Asbestos

B00C - R1001 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R1002 - Interview

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R1003 - External Movement

No Asbestos

B00C - R1004 - Movement

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R1005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R1006 - Staff Toilet

No Asbestos

B00C - R1007 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00C - R1008 - External Movement

No Asbestos

B00C - R1009 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R1010 - Cleaning Distributed Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities/Pupil Facilities - 1998 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Canteen

No Asbestos

B00D - R0002 - Canteen Office/Store

No Asbestos

B00D - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0005 - Disabled Toilet

No Asbestos

B00D - R0006 - Cleaning Distributed Store

No Asbestos

B00D - R0007 - Movement

No Asbestos

B00D - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0009 - Plant

No Asbestos

B00D - R0010 - Movement

No Asbestos

B00D - R0011 - Movement

No Asbestos

B00D - R0012 - Toilets - Boys

No Asbestos

B00D - R0013 - Shower/Change

No Asbestos

B00D - R0014 - P.E. Store

No Asbestos

B00D - R0015 - Sports Store

No Asbestos

B00D - R0016 - Toilets - Girls

No Asbestos

B00D - R0017 - Hall Chair Store

No Asbestos

B00D - R0018 - Movement

No Asbestos

B00D - R0019 - Lift

No Asbestos

B00D - R0020 - Raised Platform

No Asbestos

B00D - R0021 - Communal Space

No Asbestos

B00D - R0022 - Movement

No Asbestos

B00D - R0023 - Movement

No Asbestos

B00D - R0024 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00E - Pupil Facilities/Building Services - 1963 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00E/Eaves Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior						
B00E - R0001 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00E/R0005/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0002 - Toilets - Boys						
No Asbestos						
B00E - R0003 - Staff Toilet						
No Asbestos						
B00E - R0004 - Staff Toilet						
No Asbestos						
B00E - R0005 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00E/R0005/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0006 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00E/R0005/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0007 - Toilets - Girls						
No Asbestos						
B00E - R0008 - Staff Toilet						
No Asbestos						
B00E - R0009 - Staff Toilet						
No Asbestos						
B00E - R0010 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00E/R0005/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0011 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00E/R0005/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0012 - Toilets - Boys						
No Asbestos						
B00E - R0013 - Toilets - Girls						
No Asbestos						
B00E - R0014 - Cleaning Supplies						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00E/Eaves Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Mounting Board	Resinous Board	1Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning/Pupil Facilities - 1960 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	45m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - Toilets - Boys/Girls**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/R0003/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0002 - Home Base

No Asbestos

B00F - R0003 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	80m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/R0003/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0004 - Home Base

Wall Linings Internal	Flat AC Sheeting	80m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/R0003/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0006 - Withdrawal Space - 1hb

No Asbestos

B00F - R0007 - Cleaning Distributed Store

No Asbestos

B00F - R0008 - Staff Room Annexe

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00F/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Floor Coverings Res/Textile

Vinyl Tiles
3302/B00F/R0009/Floor Coverings Res/Textile/S9**No Asbestos Detected****B00F - R0010 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3302/B00F/R0003/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0011 - General Storeroom

Recently Modified Space Requires Inspection

B00F - R0012 - Practical Activities/Movement - 4hb

Recently Modified Space Requires Inspection

B00F - R0013 - Personal Effects Storage

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Pupil Facilities - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	140m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00G/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00G - R0001 - Home Base**

In-fill-panel	Tilux	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B00G - R0002 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3302/B00G/R0002/Floor Coverings Res/Textile/S5				No Asbestos Detected	

B00G - R0003 - General Storeroom

No Asbestos

B00G - R0004 - Movement

No Asbestos

B00G - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00G/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0006 - Home Base

In-fill-panel	Flat AC Sheeting	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B00G - R0007 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3302/B00G/R0002/Floor Coverings Res/Textile/S5				No Asbestos Detected	

B00G - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	1.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00G/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0009 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles					
	3302/B00G/R0009/Floor Coverings Res/Textile/S6				No Asbestos Detected	

B00G - R0010 - Home Base

In-fill-panel	Flat AC Sheeting	1m	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3302/B001/R0010/In-fill-panel/S2				Chrysotile (white asbestos)	

B00G - R0011 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3302/B00G/R0002/Floor Coverings Res/Textile/S5				No Asbestos Detected	

B00G - R0012 - Movement

No Asbestos

B00G - R0013 - P.E. Store

No Asbestos

B00G - R9003 - General Assistant/Bulk Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00G - R9004 - Staff Room

No Asbestos

B00G - R9005 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Building Services - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

In-fill-panel	Flat AC Sheeting	8m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00H/In-fill-panel/S12					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	12m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3302/B00H/R0004/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00H - R0001 - Home Base

No Asbestos

B00H - R0002 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3302/B00G/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00H - R0003 - Personal Effects Storage

No Asbestos

B00H - R0004 - Movement

Flooring	Compressed AC Sheet					
	3302/B00H/R0004/Step/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3302/B00H/R0004/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00H - R9001 - General Assistant/Bulk Store

No Asbestos

B00H - R9002 - Kiln Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00K - General Learning - 2011 - Brick/Veneer (Brick/Veneer)**Exterior**

No Asbestos

Interior**B00K - R0001 - External Movement**

No Asbestos

B00K - R0002 - Practical Activities

No Asbestos

B00K - R0003 - Home Base

No Asbestos

B00K - R0004 - Home Base Store

No Asbestos

B00K - R0005 - Withdrawal Space - 2hb

No Asbestos

B00K - R0006 - Home Base

No Asbestos

B00K - R0007 - Practical Activities

No Asbestos

B00K - R0008 - Home Base Store

No Asbestos

B00K - R0009 - Practical Activities

No Asbestos

B00K - R0010 - Home Base Store

No Asbestos

B00K - R0011 - Home Base

No Asbestos

B00K - R0012 - Withdrawal Space - 2hb

No Asbestos

B00K - R0013 - Home Base

No Asbestos

B00K - R0014 - Practical Activities

No Asbestos

B00K - R0015 - Home Base Store

No Asbestos

B00K - R0016 - Practical Activities

No Asbestos

B00K - R0017 - Home Base Store

No Asbestos

B00K - R0018 - Home Base

No Asbestos

B00K - R0019 - Withdrawal Space - 2hb

No Asbestos

B00K - R0020 - Home Base

No Asbestos

B00K - R0021 - Practical Activities

No Asbestos

B00K - R0022 - Home Base Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Storage - 2013 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00L - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10444 - Learning Unit - Standard/Withdrawal : Placement Date - 9/08/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 603 - D12141 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 1/10/2014

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D12499 - Learning Unit - Standard/Withdrawal : Placement Date - 4/02/2005

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 602 - D13142 - Learning Unit - Standard With P.A.A. : Placement Date - 13/03/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13638 - Learning Unit - Standard With P.A.A. : Placement Date - 14/01/2010

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
OS 601 - D14114 - Learning Unit - Standard/Withdrawal : Placement Date - 7/01/2015						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 602 - D14397 - Learning Unit - Standard With P.A.A. : Placement Date - 1/03/2016						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D14486 - Learning Unit - Standard/Withdrawal : Placement Date - 30/09/2003						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 602 - D15660 - Learning Unit - Standard With P.A.A. : Placement Date - 25/09/2014						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017