


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Woodport Public School (1857)  
**Region :** Hunter/Central Coast  
**State Electorate :** Terrigal  
**Local Government Area :** Gosford

**Initial Survey :** Noel Arnold & Associates : 29 - Mar - 2008  
**Reviewed By :** AECOM : 29 - Apr - 2016

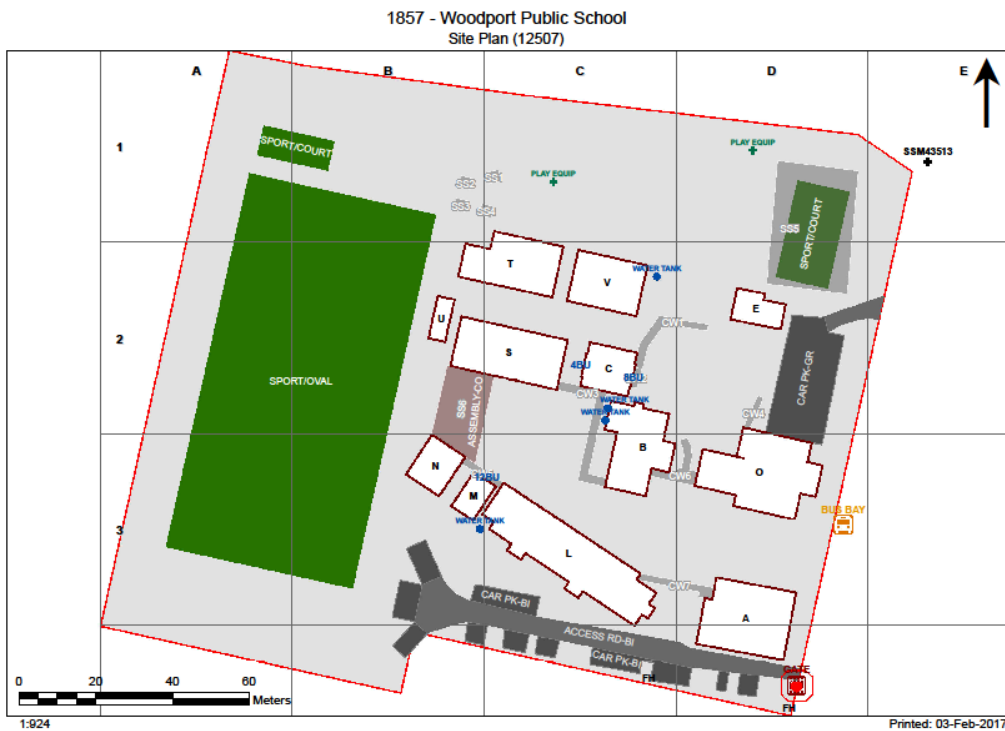

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1982 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area  
- on slab no access point

Ceiling Voids - Raked Ceiling No Asbestos Found

**Interior**

**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1857/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

**B00A - R0002 - Entry Vestibule**

No Asbestos

**B00A - R0003 - Deputy Principal**

No Asbestos

**B00A - R0004 - Principal**

No Asbestos

**B00A - R0005 - Staff Room**

No Asbestos

**B00A - R0006 - Staff Toilet**

No Asbestos

**B00A - R0007 - Security Store**

No Asbestos

**B00A - R0008 - Staff Toilet**

No Asbestos

**B00A - R0009 - Staff Toilet**

No Asbestos

**B00A - R0010 - Interview**

No Asbestos

**B00A - R0011 - Movement**

No Asbestos

**B00A - R0012 - General Storeroom**

No Asbestos

**B00A - R0013 - Cleaning Distributed Store**

No Asbestos

**B00A - R0014 - Security Store**

No Asbestos

**B00A - R0015 - Duplicating Workroom**

No Asbestos

**B00A - R0016 - Interview**

No Asbestos

**B00A - R0017 - Sick Bay**

No Asbestos

**B00A - R0018 - Main Switch Board**

No Asbestos

**B00A - R0019 - Clerical Office**

No Asbestos

**B00A - R0020 - Movement**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Library - 1982 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible no access point					
Underfloor Voids - Slab on Ground	Non Accessible Area - slab on ground no access point					
Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1857/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

**Interior**

**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1857/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

**B00B - R0002 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1857/B00B/R0004/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

**B00B - R0003 - Cleaning Distributed Store**

No Asbestos

**B00B - R0004 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1857/B00B/R0004/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

**B00B - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0006 - Library Office/Workroom**

No Asbestos

**B00B - R0007 - K.L.A. Store**

No Asbestos

**B00B - R0008 - Reading Area**

No Asbestos

**B00B - R0009 - Seminar/Study**

No Asbestos

**B00B - R0010 - Seminar/Study**

No Asbestos

**B00B - R0011 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
1857/B00B/R0011/Ceiling Structures/Linings/S3						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1892 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible no access point					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - Height Restriction 4.5**

**Interior**

**B00C - R0001 - Withdrawal Space - 1hb**

No Asbestos

**B00C - R0002 - Practical Activities - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

**Assumed Asbestos - Height Restriction 3.8**

**B00C - R0003 - Home Base Store**

No Asbestos

**B00C - R0004 - Movement**

No Asbestos

**B00C - R0005 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

**Assumed Asbestos - Height Restriction 3.8**

**B00C - R0006 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Other-After School Care - 1917 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction 3.4					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction 3.4</b>						
Eaves Linings	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction 3.6</b>						

**Interior**

**B00E - R0001 - Out Of School Hours Care Centre**

Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1857/B00A/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00E - R0002 - Out Of School Hours Care Centre**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1857/B00A/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00E - R0003 - Out Of School Hours Care Centre**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
1857/B00E/R0003/Wall Linings Internal/S5						

**B00E - R0004 - Clerical Office - Pre**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning - 1992 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - slab on ground no access point
Ceiling Voids	No Asbestos Found

**Interior**

**B00L - R0001 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0002 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0003 - Home Base Store**

No Asbestos

**B00L - R0004 - Practical Activities - 1hb**

No Asbestos

**B00L - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R0006 - Home Base Store**

No Asbestos

**B00L - R0007 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0008 - Practical Activities - 1hb**

No Asbestos

**B00L - R0009 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0010 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0011 - Practical Activities - 1hb**

No Asbestos

**B00L - R0012 - Home Base Store**

No Asbestos

**B00L - R0013 - Practical Activities - 1hb**

No Asbestos

**B00L - R0014 - Home Base Store**

No Asbestos

**B00L - R0015 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0016 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0017 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0018 - Home Base Store**

No Asbestos

**B00L - R0019 - Practical Activities - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00L - R0020 - Distribution Board</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00L - R0021 - Disabled Toilet</b>						
No Asbestos						
<b>B00L - R0022 - Movement</b>						
No Asbestos						
<b>B00L - R0023 - Personal Effects Storage</b>						
No Asbestos						
<b>B00L - R0024 - Personal Effects Storage</b>						
No Asbestos						
<b>B00L - R0025 - Personal Effects Storage</b>						
No Asbestos						
<b>B00L - R1001 - Withdrawal Space - 1hb</b>						
Vinyl Tiles (Under Floor      No Asbestos Found Covering/Carpet)						
<b>B00L - R1002 - Home Base</b>						
Vinyl Tiles (Under Floor      No Asbestos Found Covering/Carpet)						
<b>B00L - R1003 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00L - R1004 - Home Base Store</b>						
No Asbestos						
<b>B00L - R1005 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00L - R1006 - Home Base Store</b>						
No Asbestos						
<b>B00L - R1007 - Home Base</b>						
Vinyl Tiles (Under Floor      No Asbestos Found Covering/Carpet)						
<b>B00L - R1008 - Withdrawal Space - 1hb</b>						
Vinyl Tiles (Under Floor      No Asbestos Found Covering/Carpet)						
<b>B00L - R1009 - Home Base</b>						
Vinyl Tiles (Under Floor      No Asbestos Found Covering/Carpet)						
<b>B00L - R1010 - Home Base Store</b>						
No Asbestos						
<b>B00L - R1011 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00L - R1012 - Personal Effects Storage</b>						
No Asbestos						
<b>B00L - R1013 - Personal Effects Storage</b>						
No Asbestos						
<b>B00L - R1014 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00L - R1015 - Home Base Store</b>						
No Asbestos						
<b>B00L - R1016 - Home Base</b>						
Vinyl Tiles (Under Floor      No Asbestos Found Covering/Carpet)						
<b>B00L - R1017 - Withdrawal Space - 1hb</b>						
Vinyl Tiles (Under Floor      No Asbestos Found Covering/Carpet)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00L - R1018 - Home Base</b>						
Vinyl Tiles (Under Floor Covering/Carpet)		No Asbestos Found				
<b>B00L - R1019 - Home Base Store</b>						
No Asbestos						
<b>B00L - R1020 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00L - R1021 - Personal Effects Storage</b>						
No Asbestos						
<b>B00L - R1022 - Distribution Board</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00L - R1023 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00L - R1024 - Movement</b>						
No Asbestos						
<b>B00L - R1025 - Distribution Board</b>				Note: No inspection of live electrical installation.		
No Asbestos						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Pupil Facilities - 1982 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - no access point
Underfloor Voids - Slab on Ground	Non Accessible Area - on slab no access point

**Interior**

**B00M - R0001 - Movement**

No Asbestos

**B00M - R0002 - Toilets - Girls**

No Asbestos

**B00M - R0003 - Toilets - Boys**

No Asbestos

**B00M - R0004 - No Access**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Pupil Facilities - 1992 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - on slab no access point
Ceiling Voids	No Asbestos Found

**Interior**

**B00N - R0001 - Canteen**

No Asbestos

**B00N - R0002 - Canteen Office/Store**

No Asbestos

**B00N - R0003 - Sports Store**

No Asbestos

**B00N - R0004 - Cleaning Supplies**

No Asbestos

**B00N - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00N - R0006 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Communal Facilities - 1993 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - on slab no access point
Ceiling Voids	No Asbestos Found

**Interior**

**B000 - R0001 - Movement**

No Asbestos

**B000 - R0002 - Plant**

No Asbestos

**B000 - R0003 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B000 - R0004 - Special Programs Room**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B000 - R0005 - Security Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B000 - R0006 - Movement**

No Asbestos

**B000 - R0007 - Movement**

No Asbestos

**B000 - R0008 - Communal Space**

No Asbestos

**B000 - R0009 - Raised Platform**

No Asbestos

**B000 - R0010 - Plant**

No Asbestos

**B000 - R0011 - Hall Chair Store**

No Asbestos

**B000 - R0012 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B000 - R0013 - Plant**

No Asbestos

**B000 - R0014 - P.E. Store**

No Asbestos

**B000 - R9001 - Toilets - Boys**

No Asbestos

**B000 - R9002 - Toilets - Girls**

No Asbestos

**B000 - R9003 - Garden Store**

No Asbestos

**B000 - R9004 - General Assistant/Bulk Store**

No Asbestos

**B000 - R9005 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00S - General Learning - 1982 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - on slab noaccess point

**Interior**

**B00S - R0001 - Practical Activities - 1hb**

No Asbestos

**B00S - R0002 - Home Base**

No Asbestos

**B00S - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00S - R0004 - Home Base Store**

No Asbestos

**B00S - R0005 - Cleaning Distributed Store**

No Asbestos

**B00S - R0006 - Home Base Store**

No Asbestos

**B00S - R0007 - Home Base**

No Asbestos

**B00S - R0008 - Practical Activities - 1hb**

No Asbestos

**B00S - R0009 - Practical Activities - 1hb**

No Asbestos

**B00S - R0010 - Home Base**

No Asbestos

**B00S - R0011 - Withdrawal Space - 1hb**

No Asbestos

**B00S - R0012 - Home Base Store**

No Asbestos

**B00S - R0013 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00S - R0014 - Movement**

No Asbestos

**B00S - R0015 - Movement**

No Asbestos

**B00S - R0016 - Movement**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00T - General Learning - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - no asbestos
Ceiling Voids	No Asbestos Found

**Interior**

**B00T - R0001 - Practical Activities - 1hb**

No Asbestos

**B00T - R0002 - Personal Effects Storage**

No Asbestos

**B00T - R0003 - Home Base Store**

No Asbestos

**B00T - R0004 - Home Base**

No Asbestos

**B00T - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00T - R0006 - Practical Activities - 1hb**

No Asbestos

**B00T - R0007 - Personal Effects Storage**

No Asbestos

**B00T - R0008 - Home Base Store**

No Asbestos

**B00T - R0009 - Home Base**

No Asbestos

**B00T - R0010 - Access Shower/Toilet**

No Asbestos

**B00T - R0011 - Access Shower/Toilet/Change**

No Asbestos

**B00T - R0012 - Laundry - Type 3**

No Asbestos

**B00T - R0013 - Cleaning Distributed Store**

No Asbestos

**B00T - R0014 - External Movement**

No Asbestos

**B00T - R0015 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00U - Storage - 2011 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible on slab

Ceiling Voids      No Asbestos Found

**Interior**

**B00U - R0001 - Garden Store**

No Asbestos

**B00U - R0002 - General Assistant/Bulk Store**

No Asbestos

**B00U - R0003 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00V - General Learning - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00V - R0001 - Practical Activities - 1hb**

No Asbestos

**B00V - R0002 - Personal Effects Storage**

No Asbestos

**B00V - R0003 - Home Base Store**

No Asbestos

**B00V - R0004 - Home Base**

No Asbestos

**B00V - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00V - R0006 - Practical Activities - 1hb**

No Asbestos

**B00V - R0007 - Personal Effects Storage**

No Asbestos

**B00V - R0008 - Home Base Store**

No Asbestos

**B00V - R0009 - Home Base**

No Asbestos

**B00V - R0010 - External Movement**

No Asbestos

**B00V - R0011 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

1857\_ASB\_010713\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017